Submit 3 Copies To Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources		Form C-103 May 27, 2004
District I 1625 N. French Dr., Hobbs, NM 87240			WELL API NO.
District II 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION	ANJAKATON	30-025-09235 5. Indicate Type of Lease
District III 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fra Santa Fe NM 83	ncis Dr. Se	STATE X FEE
District IV	Santa TE, INIVI 65	189	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	m is	N . West	
SUNDRY NOTICE (DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR. USE "APPLICE" PROPOSALS.)	ES AND REPORTS ON WELL SALS TO DRILL OR TO DEEPEN C ATION FOR PERMIT" (FORM C-10	R PĽUG BACK TO A	7. Lease Name or Unit Agreement Name: STATE A A/C 1
1. Type of Well:	TO C	en and	8. Well Number
Oil Well X Gas Well	Other	1848 A	46
2. Name of Operator PETROHAWK OPERATING COMPAN	V		9. OGRID Number 194849
3. Address of Operator	I		10. Pool name or Wildcat
1100 LOUISIANA, STE. 4400	HOUSTON TX 77002		LANGLIE MATTIX 7 RVRS QUEEN,GB
4. Well Location			
Unit Letter ::	1980 feet from the SOU	TH line and	660 feet from the WEST line
Section 3 Township 23S Range 36E NMPM County LEA			
11. Elevation (Show whether DR, RKB, RT, GR, etc.)			
3425 ' RKB			
Pit or Below-grade Tank Application or Closure Pit type N/A Depth to Groundwater 149' Distance from nearest fresh water well 1000+ Distance from nearest surface water 1000+			
Pit Liner Thickness: N/A mil Below-Grade Tank: Volumebbls; Construction Material			
THE ZINCE THE ARCEST.			
12. Check Appropriate Box to Indicate, Nature of Notice, Report, or Other Data			
** *			SEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON X REMEDIAL WORK		ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLI	NG OPNS. PLUG AND
PULL OR ALTER CASING	MULTIPLE COMPLETION	CASING TEST AND	ABANDONMENT
	COMPLETION	CEMENT JOB	
OTHER:		OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. THE OIL CONSERVATION DIVISION MUST BE NOTIFIED 24 HOURS PRIOR TO THE			
PEOPERATO OF PLACENCE AND			
BECTIMING OF PLUGGING OPERATIONS. See attached for Procedure and Wellbore Schematic to Plug and Abandon Well			
dec abbasilea for trocedure and nerrobote containable to triag and ribaliasit nerr			
I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-			
grade tank has peop/will be constructed or closed according to NMOCD guidelines, a general permitor an (attached) alternative OCD-approved plan			
SIGNATURE TITLE Regulatory Analyst DATE 05/16/06			
Type or print name Anna Tarpey CFIELD REPRESENTATIVE II/STAFF MARCH No. 832-204-2760			
For State Use Only / 2006			
APPROVED BY aug 1	1). Winds TIT	TLE	MAY 1 9 2006
Conditions of Approval, if any:			



State A A/C-1 #46 Jalmat Field Lea County, NM

May 15, 2006

Plug and Abandonment Procedure

- 1. MIRU plugging rig. Dump 35' cement on top of CIBP at 3600'.
- 2. TIH with open ended workstring to PBTD and load hole with 10 ppg gelled brine.
- 3. Mix and spot 200' base of salt cement plug from 2875' to 2675' (23 sx of class A).
- 4. Perforate 5-1/2" casing at 1475'. Mix 200' top of salt cement plug (55 sx class A). Pump through perfs at 1475' leaving top of cement inside casing at 1275'.
- 5. Perforate 5-1/2" casing @ 390'. Mix surface plug (106 sx class A). Squeeze through perfs at 390', attempting to circulate cement to surface. Leave top of cement inside casing at surface.
- 6. Cut off wellhead, cap well and install P&A marker.
- 7. Clean location for OCD inspection.

WOC+ TAG



