/22	UNITED STATES DEPARTMENT OF THE I BUREAU OF AND MANA	IODINEDITI (HOBBS	FORM OM B N Expires: 5. Lease Serial No. LC 030133B	APPROVED to 1004-0137 March 31, 2007
Do not use the abandoned w	NOTICES AND REPORTED TO THE POPULATION OF PROPERTY STORY OF THE PROPERTY STORY OF THE POPULATION OF TH	OHIS ON WEL drill or to re-e (PD) for such pro	nter an posals.	5. If Indian, Allottee	e or Tribe Name
SUBMIT IN TRIPLICATE Other instructions on reverse side.				7. If Unit or CA/Agreement, Name and/or No. NM71034X	
1. Type of Well Oil Well	Gas Well ✓ Other		-	8. Well Name and N	la .
2. Name of Operator Breck Operating Corp.				South Eunice Unit #43 9. API Well No.	
3a Address		Phone No. (include area code) 30-6			
P.O. Box 911, Breckenridge, T 4. Location of Well (Footage, Sec.,	254-559-3355	10. Field a		r Exploratory Area s Queen, So.	
Unit Letter I, 1980' FSL & 660' FEL, Sec 29, T22S, R36E				11. County or Parish, State	
				Lea, NM	
	PPROPRIATE BOX(ES) TO I			ORT, OR OTHE	R DATA
TYPE OF SUBMISSION	 		E OF ACTION		
Notice of Intent	AcidizeAlter Casing	Deepen Fracture Treat	Production (Start/I	· —	tter Shut-Off ell Integrity
Subsequent Report	Casing Repair	New Construction	Recomplete		• •
Final Abandonment Notice	Change Plans ☐ Convert to Injection ☐	Plug and Abandon Plug Back	Temporarily Abana Water Disposal	ion	
testing has been completed. Fir	nal Abandonment Notices shall be file	sults in a multiple comple	etion or recompletion in a	new interval a Form	all be filed within 30 days 3160-4 shall be filed once
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix &	inal Abandonment Notices shall be file y for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 sxs). POH to.	sults in a multiple compled only after all requirem g & pkr. TIH with 5-1, 3000'. Mix & pump p	etion or recompletion in a nents, including reclamation '2" CIBP, set @ 3500'.	new interval, a Form in, have been comple SDON.	3160-4 shall be filed once ted, and the operator has
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ 5	inal Abandonment Notices shall be file y for final inspection.) ND WH, NU BOP. POOH w/tbg to pump plug #1 (25 sxs). POH to tur & tbg. Set pkr @ 1000'. Pressu #3 (25 sxs). Buddy Hill w/OCD on tit @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO tent @ 196'. Called OCD. TIH wi	sults in a multiple compled only after all requirents & pkr. TIH with 5-1, 3000'. Mix & pump pure up on csg to 800#. on location. POH & SI. Perf csg @ 412'. RD DH. LD pkr. TIH w/tb//tbg to 93'. Pump plu/	etion or recompletion in a nents, including reclamation /2" CIBP, set @ 3500'. lug #2 (25 sxs). Called No bleed off. Called COON. WL. PU & RIH w/pkr g to 480'. Mix & pump g #5 (93' to surface). R	new interval, a Form on, have been comple SDON. OCD & BLM. PO CD. Release pkr &	3160-4 shall be filed once ted, and the operator has the RU WL. Perf csg @ POH. TIH w/tbg to
testing has been completed. Fit determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ 5 to 300# & WOC. Tag cem.	inal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 sxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 sxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO tent @ 196'. Called OCD. TIH w. Approved as Liability und	sults in a multiple completed only after all requirer 3 & pkr. TIH with 5-1, 3000'. Mix & pump pure up on csg to 800#. In location. POH & SI Perf csg @ 412'. RD DH. LD pkr. TIH w/tb //tbg to 93'. Pump plug it o plugging of the	etion or recompletion in a nents, including reclamation of the control of the con	new interval, a Form on, have been comple SDON. OCD & BLM. PO CD. Release pkr &	3160-4 shall be filed once ted, and the operator has the RU WL. Perf csg @ POH. TIH w/tbg to
testing has been completed. Fit determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ 5 to 300# & WOC. Tag cem.	inal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 sxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 sxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO tent @ 196'. Called OCD. TIH w. Approved as Liability und	sults in a multiple compled only after all requirer g & pkr. TIH with 5-1, 3000'. Mix & pump p ure up on csg to 800#. on location. POH & SI Perf csg @ 412'. RD DH. LD pkr. TIH w/tb //tbg to 93'. Pump plug	etion or recompletion in a nents, including reclamation of the control of the con	new interval, a Form on, have been comple SDON. OCD & BLM. PO CD. Release pkr &	3160-4 shall be filed once ted, and the operator has the RU WL. Perf csg @ POH. TIH w/tbg to
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ 5 to 300# & WOC. Tag cem P&A'd.	inal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 sxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 sxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO tent @ 196'. Called OCD. TIH w. Approved as Liability und Surface restor	sults in a multiple completed only after all requirer 3 & pkr. TIH with 5-1, 3000'. Mix & pump pure up on csg to 800#. In location. POH & SI Perf csg @ 412'. RD DH. LD pkr. TIH w/tb //tbg to 93'. Pump plug it o plugging of the	etion or recompletion in a nents, including reclamation of the control of the con	new interval, a Form on, have been comple SDON. OCD & BLM. PO CD. Release pkr &	3160-4 shall be filed once ted, and the operator has ted, and the operator has the RU WL. Perf csg @ POH. TIH w/tbg to essure up on casing to POH. Pressure up on csg dig anchors. Well
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ £ to 300# & WOC. Tag cem P&A'd.	inal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 sxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 sxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO tent @ 196'. Called OCD. TIH w. Approved as Liability und Surface restor	sults in a multiple completed only after all requirem 3 & pkr. TIH with 5-1. 3000'. Mix & pump pure up on csg to 800#. on location. POH & SI Perf csg @ 412'. RD OH. LD pkr. TIH w/tb //tbg to 93'. Pump plug to plugging of the ler bond is retained pration is complete	etion or recompletion in a nents, including reclamation of the control of the con	new interval, a Form on, have been comple SDON. OCD & BLM. PO CD. Release pkr &	3160-4 shall be filed once ted, and the operator has ted, and the operator has the RU WL. Perf csg @ POH. TIH w/tbg to essure up on casing to POH. Pressure up on csg dig anchors. Well
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ £ to 300# & WOC. Tag cem P&A'd. 14. I hereby certify that the fore Name (Printed/Typed)	inal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 sxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 sxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO tent @ 196'. Called OCD. TIH w. Approved as Liability und Surface restor	sults in a multiple completed only after all requirem 3 & pkr. TIH with 5-1. 3000'. Mix & pump pure up on csg to 800#. on location. POH & SI Perf csg @ 412'. RD OH. LD pkr. TIH w/tb //tbg to 93'. Pump plug to plugging of the ler bond is retained pration is complete	etion or recompletion in a nents, including reclamation of the color o	new interval, a Form on, have been comple SDON. OCD & BLM. PO CD. Release pkr &	3160-4 shall be filed once ted, and the operator has H & RU WL. Perf csg @ POH. TIH w/tbg to essure up on casing to POH. Pressure up on csg dig anchors. Well APPRO JUN 13
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ £ to 300# & WOC. Tag cem P&A'd. 14. I hereby certify that the fore Name (Printed/Typed) Ernie Underwoo	inal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 xxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 xxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO lent @ 196'. Called OCD. TIH w Approved as Liability und Surface restor	sults in a multiple completed only after all requirers g & pkr. TIH with 5-1. 3000'. Mix & pump pure up on csg to 800#. on location. POH & SI Perf csg @ 412'. RD OH. LD pkr. TIH with ito plugging of the ler bond is retained pration is complete Title Dis Date	etion or recompletion in a nents, including reclamation of the color o	new interval, a Form in, have been completed SDON. OCD & BLM. PO CD. Release pkr & & tbg. to 190'. Proplug #4 (25 sxs). ID. Cut off WH & & & & & & & & & & & & & & & & & &	3160-4 shall be filed once ted, and the operator has the RU WL. Perf csg @ POH. TIH w/tbg to essure up on casing to POH. Pressure up on csg dig anchors. Well
determined that the site is ready 3-21-06 MIRU P&A rig. I 3-22-06 Circ mud. Mix & 1425'. RD WL. TIH w/pk 1475'. Mix & pump plug # 3-23-06 TIH & tax cemen 700#. EIR 1/4 bbl/min @ £ to 300# & WOC. Tag cem P&A'd. 14. I hereby certify that the fore Name (Printed/Typed) Ernie Underwoo	mal Abandonment Notices shall be filly for final inspection.) ND WH, NU BOP. POOH w/tbg pump plug #1 (25 xxs). POH to tr & tbg. Set pkr @ 1000'. Presst #3 (25 xxs). Buddy Hill w/OCD of at @ 1192'. Called OCD. LD tbg. 500#. Called OCD & BLM. POO lent @ 196'. Called OCD. TIH w. Approved as Liability und Surface restor THIS SPACE FOR FE	sults in a multiple completed only after all requirem 3 & pkr. TIH with 5-1. 3000'. Mix & pump pure up on csg to 800#. on location. POH & SI Perf csg @ 412'. RD OH. LD pkr. TIH w/tb //tbg to 93'. Pump plug to plugging of the ler bond is retained bration is complete Title Dis EDERAL OR ST	etion or recompletion in a nents, including reclamation of the complete of the	new interval, a Form in, have been completed SDON. OCD & BLM. PO CD. Release pkr & & tbg. to 190'. Proplug #4 (25 sxs). ID. Cut off WH & & & & & & & & & & & & & & & & & &	3160-4 shall be filed once ted, and the operator has OH & RU WL. Perf csg @ POH. TIH w/tbg to essure up on casing to POH. Pressure up on csg dig anchors. Well APPRO JUN 13

GWW