

DISTRICT I
1625 French Drive Hobbs, NM 88240

DISTRICT II
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P. O. Box 2088
Santa Fe, NM 7504-2088

WELL API NO.
30-025-33438

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
B-2148

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
Caprock Maljamar Unit

1 Type of Well:
OIL ☐ GAS ☐
WELL ☐ WELL ☐ OTHER **WTW**

2. Name of Operator
The Wiser Oil Company

8. Well No.
261

3. Address of Operator
P.O. Box 2568 Hobbs, New Mexico (505) 392-9797

9. Pool name or Wildcat
Maljamar Grayburg San Andres

4. Well Location
Unit Letter **O** : **2080** Feet From The **East** Line and **760** Feet From The **South** Line
Section **18** Township **17S** Range **33E** NMPM **Lea** County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4221' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6/09/03 MIRU Mayo Marrs Casing Pulling Inc. NU BOP. RIH w/2-3/8" tbg. Set CIBP @ 4150'.

6/10/03 Circulate hole w/10# mud. Spot 25 sks. @ 4150'-3896'. WOC. Tag @ 3896'. Spot 25 sks. @ 2300'-2050'. WOC. Tag @ 2050'. Spot 25 sks. @ 1320'-1074'. Tag @ 1074'. Test casing w/pkr. to 1000#. Perforate @ 375'. Set pkr. @ 3'. Test to 1000#. Test was witnessed by Buddy Hill w/NMOCD - gave ok to spot plug. Spot 25 sks. @ 425'-172'.

6/11/03 Tag @ 172'. POH. ND BOP. Cut off WH & anchors. Spot 10 sks. @ 50' to surface. Install dry hole marker. Level pit & cellar. RDMO.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE July 14, 2003
TYPE OR PRINT NAME Mary Jo Turner TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY Larry W. Wink
CONDITIONS OF APPROVAL, IF ANY:

OC FIELD REPRESENTATIVE II/STAFF MANAGER
DATE AUG 04 2003