Submit 3 Copies To Appropriate District Office	State of New Mexico	Form C-103
District I Energy	y, Minerals and Natural Resources	May 27, 2004
1625 N. French Dr., Hobbs, NM 88240 District II		WELL API NO. 30-025-02859
1301 W. Grand Ave., Artesia, NM 88210 OIL (	CONSERVATION DIVISION	5. Indicate Type of Lease
District III 1	220 South St. Francis Dr.	STATE STEE
1000 Rio Brazos Rd., Aztec, NM 87410 District IV	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM		B-1713
87505 SUNDRY NOTICES AND R	EPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL	L OR TO DEEPEN OR PLUG BACK TO A	, and the second
DIFFERENT RESERVOIR. USE "APPLICATION FOR PI PROPOSALS.)	ERMIT" (FORM C-101) FOR SUCH	East Vacuum Gb/SA Unit Tract #2335
1. Type of Well: Oil Well  Gas Well	Other	8. Well Number 002
2. Name of Operator		9. OGRID Number
	ny ATTN: Celeste Dale	217817
3. Address of Operator 4001 Penbrook Street C	Odessa Tevas 70762	10. Pool name or Wildcat  Vacuum Grayburg/San Andres
4. Well Location	Juessa, Texas 79702	vacuum Grayourg Sun Amares
	transition Court line and Of	90 feet from the West line
	rom the South line and 99 Township 17-S Range 35-E	
	Township 17-S Range 35-E on (Show whether DR, RKB, RT, GR, 6	
3,933	,	
Pit or Below-grade Tank Application  or Closure		
Pit type_STEELDepth to Groundwater	Distance from nearest fresh water well	Distance from nearest surface waterN/A
Pit Liner Thickness: STEEL mil Below-6	Grade Tank: Volumebbls;	Construction Material STEEL
12 Check Appropriate	Box to Indicate Nature of Notice	ce. Report or Other Data
• •		•
NOTICE OF INTENTION		JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND	DABANDON 🔲 REMEDIAL W	ORK
TEMPORARILY ABANDON CHANGE F		ORILLING OPNS. P AND A
PULL OR ALTER CASING MULTIPLE	COMPL CASING/CEM	ENT JOB
PULL OR ALTER CASING MULTIPLE OTHER:	CASING/CEMI	ENT JOB
PULL OR ALTER CASING MULTIPLE OTHER:  13. Describe proposed or completed operation	COMPL CASING/CEMIOTHER:  ons. (Clearly state all pertinent details,	ENT JOB   and give pertinent dates, including estimated date
PULL OR ALTER CASING MULTIPLE OTHER:  13. Describe proposed or completed operation	COMPL CASING/CEMIOTHER:  ons. (Clearly state all pertinent details,	ENT JOB
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.	COMPL CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details,  JLE 1103. For Multiple Completions:	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU	COMPL CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details,  JLE 1103. For Multiple Completions:	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety in	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meets a set of the safety meets and set o	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety in	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @
PULL OR ALTER CASING MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 starting @ 1,795'. RIH w/ packer, unable to set the starting of the sta	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP. eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 starting @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety mee	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP. eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD. eting. RIH w/ packer to 1,377'. Loa	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety mee BPM @ 1,400 psi. Squeezed 75 sx C cmt w/	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Loa/ 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 starting @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety mee	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Loa/ 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety mee BPM @ 1,400 psi. Squeezed 75 sx C cmt w/	CASING/CEMI OTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP.  Peting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  Peting. RIH w/ packer to 1,377'. Load / 2% CaCl <sub>2</sub> @ 1,795'. WOC and taken and to the completions.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4.	CASING/CEMI OTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load / 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta doo' to surface. RDMO.  e marker. Backfilled cellar.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP. eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD. eting. RIH w/ packer to 1,377'. Loa/ 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta 400' to surface. RDMO.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to planning of the Well Bore.  Liability and a bond is retained until
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4.	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP. eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD. eting. RIH w/ packer to 1,377'. Loa/ 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta 400' to surface. RDMO.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to plugging of the Well Bore.  Liability and a bond is retained until surface restauries a completed.
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4.	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP. eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD. eting. RIH w/ packer to 1,377'. Loa/ 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta 400' to surface. RDMO.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to plugging of the Well Bore.  Liability and a bond is retained until surface restauries a completed.
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to see 10/23/06 Notified NMOCD. Held safety mee BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4. Cut off wellhead & anchors, installed dry hole SEE ATTACHED WELLBORE DIAGRAM	CASING/CEMI OTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Loa / 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta 100' to surface. RDMO.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to plugging of the Well Bore.  Liability and a bond is retained until surface restauries as completed.
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4.	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions: meeting. POOH w/ rods. NU BOP. eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD. eting. RIH w/ packer to 1,377'. Loa/ 2% CaCl <sub>2</sub> @ 1,795'. WOC and ta 100' to surface. RDMO.  The marker is a complete to the best of my knowledge.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  Ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to planging of the Well Bore.  Liability and a band is retained until surface restoration as completed.
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 400'.	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load 22% CaCl2 @ 1,795'. WOC and take 100' to surface. RDMO.  e marker. Backfilled cellar.  and complete to the best of my knowledge to NMOCD guidelines \(\overline{\text{M}}\), a general permiting	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  Ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to plagging of the Well Bore. Liability and a bond is retained until surface restoration as completed.  Edge and belief. I further tify that any pit or below-in or an (attached) alternative OCD-approved plan [1].
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety mee BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 4.  Cut off wellhead & anchors, installed dry hole SEE ATTACHED WELLBORE DIAGRAM	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load 20' CaCl2 @ 1,795'. WOC and take 100' to surface. RDMO.  e marker. Backfilled cellar.  and complete to the best of my knowledge to NMOCD guidelines \(\sigma\), a general permitation.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  Ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @   Approved as to place of the Well Bore. Liability and a bond is retained until surface restoration to completed.  Edge and belief. I further tertify that any pit or an (attached) alternative OCD-approved plan [1].  P.E. (Triple N Services) DAS 15,1/06/06
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to scasing @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 400'. ND BOP and circulated 100 sx C cmt 400'. ND BOP and circulated 100 sx C cmt 400'. SEE ATTACHED WELLBORE DIAGRAM  I hereby certify that the information above is true grade tank has been/will be constructed or closed according SIGNATURE	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load 20' CaCl2 @ 1,795'. WOC and take 100' to surface. RDMO.  e marker. Backfilled cellar.  and complete to the best of my knowledge to NMOCD guidelines \(\sigma\), a general permitation.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  Ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @   Approved as to place of the Well Bore. Liability and a bond is retained until surface restoration to completed.  Edge and belief. I further tertify that any pit or an (attached) alternative OCD-approved plan [1].  P.E. (Triple N Services) DAS 15,1/06/06
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety meet 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to set 10/23/06 Notified NMOCD. Held safety meet BPM @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 400'.	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load 20' CaCl2 @ 1,795'. WOC and take 100' to surface. RDMO.  e marker. Backfilled cellar.  and complete to the best of my knowledge to NMOCD guidelines \(\sigma\), a general permitation.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  Ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @   Approved as to place of the Well Bore. Liability and a bond is retained until surface restoration to completed.  Edge and belief. I further tertify that any pit or an (attached) alternative OCD-approved plan [1].  P.E. (Triple N Services) DAS 15,1/06/06
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to scasing @ 1,795'. RIH w/ packer, unable to scasing @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 400'. ND BOP and circulated 100 sx C cmt 400'. ND BOP and circulated 100 sx C cmt 400'. SEE ATTACHED WELLBORE DIAGRAM  I hereby certify that the information above is true grade tank has been/will be constructed or closed according SIGNATURE  Type or print name  For State Use Only	CASING/CEMI OTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & rex C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load / 2% CaCl <sub>2</sub> @ 1,795'. WOC and talloo' to surface. RDMO.  e marker. Backfilled cellar.  and complete to the best of my knowledge to NMOCD guidelines \(\omega\), a general permit  TITLE James F. Newman  E-mail address: jim@trip  OC FIELD REPRESENTATIVE	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to planning of the Well Bore.  Liability and a head to retained until surface restoration to completed.  edge and belief. I further tertify that any pit or helper or an (attached) alternative OCD-approved plan []  P.E. (Triple N Services) DAST 21/06/06  plenservices.com []  plens
PULL OR ALTER CASING  MULTIPLE OTHER:  13. Describe proposed or completed operation of starting any proposed work). SEE RU or recompletion.  10/19/06 Set steel working pit. Held safety mee 4,127'. Circulated hole w/ mud, pumped 25 scasing @ 1,795'. RIH w/ packer, unable to scasing @ 1,795'. RIH w/ packer, unable to scasing @ 1,400 psi. Squeezed 75 sx C cmt w/ 400'. ND BOP and circulated 100 sx C cmt 400'. ND BOP and circulated 100 sx C cmt 400'. ND BOP and circulated 100 sx C cmt 400'. SEE ATTACHED WELLBORE DIAGRAM  I hereby certify that the information above is true grade tank has been/will be constructed or closed according SIGNATURE  Type or print name  James F. Newman	CASING/CEMIOTHER:  Ons. (Clearly state all pertinent details, JLE 1103. For Multiple Completions:  meeting. POOH w/ rods. NU BOP.  eting. Finished POOH w/ tubing & resx C cmt 4,127 – 3,874'. Pumped 2 et packer. POOH, SD.  eting. RIH w/ packer to 1,377'. Load 20' CaCl2 @ 1,795'. WOC and take 100' to surface. RDMO.  e marker. Backfilled cellar.  and complete to the best of my knowledge to NMOCD guidelines \(\sigma\), a general permitation.	and give pertinent dates, including estimated date Attach wellbore diagram of proposed completion  POOH w/ tbg, SDFN.  ods. RIH w/ HM tbg-set CIBP, set CIBP @ 25 sx C cmt 3,143 – 2,890'. Perforated  ded hole, set packer, established rate of 2 agged cmt @ 1,530'. Perforated casing @  Approved as to place of the Well Bore.  Liability and a bond is retained until surface restauration is completed.  edge and belief. I further triffy that any pit or taken or an (attached) alternative OCD-approved plan [].  P.E. (Triple N Services) Desire 1/06/06

## PROPOSED PLUGGED WELLBORE SKETCH

ConocoPhillips Company -- Permian Basin Business Unit

3 @ \_\_\_\_\_\_\_

Date: November 6, 2006

RKB @ 3934' DF @ 3933' GL @

1

11" Hole

100 sx C cmt 400' perf & sqz'd circulated cmt to surface TOC @ 472' (Calc)

Subarea :	Buc	ckeye			
	East Vacuum GB/SA Un	it, Tract 2335 Well	No.002		_
Legal Description :	330' FSL & 990' FWL, Se	ec. 23, T17S, R35E			_
County:	Lea	State :	New Me	xico	
Field :	Vacuum	(Grayburg-San A	ndres)		
Date Spudded :	Sept. 6, 1941	Rig Rel	eased:	Oct. 2, 1941	_
API Number :	30-025-02859				
Statue:	plugged 10/23/06				

Stimulation History:

Drilled as State Warn No. 2

Other Control	THOLOTY.			Lbs.	Max		Max	
<u>Interval</u>	<u>Date</u>	<u>Type</u>	<u>Gals</u>	Sand	Press	<u>ISIP</u>	Rate	
4170-4605	10/4/41	15% Acid	1,750					
4170-4605	10/13/41	15% Acid	4,000					
4170-4605	5/4/66	15% NE	1,000					
	5/4/66	Gelled Water	30,000	25,000	6200	2600		
	5/27/83	Install prod equipment						
4170-4605	5/10/95	Ferchek	4,000	2000# RS	2911	2149	3.9	
4170-4605	5/20/95	hot oil						
		test 16 BO, 14 BW, 2.7	Mcfpd					

8-5/8" 32# @ 1,685' w/ 300 sx 75 sx C cmt 1,795 - 1,530' perf & sqz TAGGED Top of Salt @ 1,795'

TOC @ 1,828' (Calc)

TRIPLE N

LA SERVICES INC.

MIOLANO, TX

## PLUGS SET 10/19/06 - 10/23/06

1) CIBP @ 4,127' w/ 25 sx C cmt 4,127 - 3,874'

State Lease No. B-1713

- 2) 25 sx C cmt 3,143 2,890'
- 3) 75 sx C cmt 1,795 1,530' perf & sqz TAGGED
- 1) 100 sx C cmt 400' perf & sqz, circulated to surf

Capacities				
4-1/2" 9.5# csg:	10.960	ft/ft3	0.0912	ft3/ft
5-1/2" 17# csg:	7.661	ft/ft3	0.1305	ft3/ft
7" 20# csg:	4.399	ft/ft3	0.2273	ft3/ft
7" 24# csg:	4.567	ft/ft3	0.2189	ft3/ft
7-5/8" 26.4# csg:	3.775	ft/ft3	0.2648	ft3/ft
8-5/8" 32# csg:	2.922	ft/ft3	0.3422	ft3/ft
9-5/8" 36# csg:	2.304	ft/ft3	0.4340	ft3/ft
10-3/4" 40.5# csg:	1.815	ft/ft3	0.5508	ft3/ft
7-7/8" openhole:	2.957	ft/ft3	0.3382	ft3/ft
8-3/4" openhole:	2.395	ft/ft3	0.4176	ft3/ft
11" openhole:	1.515	ft/ft3	0.66	ft3/ft

Base Salt @ 3,050'

25 sx C cmt 3,143 - 2,890'

7-7/8" Hole

CIBP @ 4,127' w/ 25 sx C cmt 4,127 - 3,874'

5-1/2" 17# @ 4,170' w/ 200 sx

4-3/4" Hole

OPEN HOLE 4,175 - 4,605'

Formation Tops:

Rustler Salado Yates Queen Grayburg San Andres

PBTD: TD:

4605' 4605'