Submit 3 Copies To Appropriate District Office State of New Mexico	Form C-103 May 27, 2004
District I 1625 N. French Dr., Hobbs, NM 88240  Energy, Minerals and Natural Resources WELL API NO	
District II OII CONSEDVATION DIVISION 30-025-31388	
5. Indicate Typ	
1000 Rio Brazos Rd., Aztec, NM 87410  Santa Fe NM 87505	
District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505	Jas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH  Arrowhead Grayburg Unit	
PROPOSALS.)  8. Well Number	Grayburg Unit
1. Type of Well: Oil Well	
2. Name of Operator 9. OGRID Nur XTO Energy, Inc.	nber 005380
3. Address of Operator 10. Pool name	
200 N. Loraine, Ste. 800 Midland, TX 79705 Arrowhead	; Grayburg
4. Well Location	
Unit Letter M: 630feet from theSouth line and660feet from theWestline	
Section 7 Township 22S Range 37E NMPM Lea County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)  KB 3442' GL 3436'	
Pit or Below-grade Tank Application or Closure	
Pit type Depth to Groundwater Distance from nearest fresh water well Distance from nearest st	• • •
Pit Liner Thickness: mil Below-Grade Tank: Volumebbls; Construction Material	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
12. Check Appropriate Box to indicate Nature of Notice, Report of Julia Data	
NOTICE OF INTENTION TO:  SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPHICAL PANDA CASING/CEMENT IOR	
PULL OR ALTER CASING   MULTIPLE COMPL   CASING/CEMENT JOB PONICE	293
OTHER: Repair Casing & RWTI X OTHER:	0°3
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion	
or recompletion.	
RUPU. Install BOP. RIH w/tubing to 3658'. Run downhole with video camera.	
RIH w/3 ¾ Taper Mill,, HYD jars and drill collars. Work mill up and down through spot in casing. RIH w4 ¼" OD bottom hole long	
taper mill, drill collar, HYD jars & OD drill collars on work string. Mill through and work mill up & down through spot in casing.	
RIH w 4 3/4: OD bottom hole long taper mill, OD drill collar, HYD jars & OD drill collars on work string. Mill through and work mill up	
& down through spot in casing.	
	له   م   المراجع من به به ا
RIH w 4 3/4" bit, OD drill collar, HYD jars & OD drill collars on work string. Work bit through & up and collar out to PBTD.	lown through spot in casing &
Clean out to PB1D.	
TIH w/ 5 ½" Arrowset 1-X packer, 5 ½" X 2 3/8" on/off tool, 5 jts of rite wrap exterior/IPC tubing, 5 ½" X 2 3/8" tandem tension packer,	
seating nipple, and injection string. Set Arrowset packer at 3690' & tension packer @ 3540'. RWTI @ 250 BWIPD first day and	
increasing 250 BWIPD until pressure limit is reached of 734 psi or 2000 BWIPD.	
RU service company and pump 2500 gals of 20% NEFE Acid w/500 gals spacers of 9# brine.	
	آنیہنی۔ کی د
I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan .	
SIGNATURE Ward TITLE Regulatory	DATE11/22/06
Type or print name Kristy Ward E-mail address: kristy_ward@xtoenergy.com Telephone No. 432-620-6740	
For State Use Only	
APPROVED BY: House Wish TITLE TITLE TO S 2006  Conditions of Approval (if thy):	