Office	State of New M	exico	Form C-103	
District I	Energy, Minerals and Natural Resources		May 27, 2004	
1625 N. French Dr., Hobbs, NM 88240 District II		WELL API NO.		
1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DIVISION		30-025-11714		
District III 1220 South St. Francis Dr.		5. Indicate Type of Lease		
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505		STATE FEE S		
1220 S. St. Francis Dr., Santa Fe, NM 8750		17505	6. State Oil & Gas Lease No.	
	ICES AND REPORTS ON WELL		7. Lease Name or Unit Agreement Name:	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			JH Wimberly Fed Com	
	Gas Well 🛛 Other		8. Well No. 1	
2. Name of Operator			9. OGRID Number	
Legacy Reserves Operating LP			240974	
3. Address of Operator			10. Pool name or Wildcat	
P. O. Box 10848, Midland	i, TX 79702		Justis, Glorietta (Pro Gas)	
4. Well Location				
Unit Letter H : 1980 feet from the N line and 660 feet from the E line				
Section 23		lange 37E	NMPM County Lea	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)				
Pit or Relow-grade Tank Applica	Pit or Below-grade Tank Application or Closure			
		fresh weter well	Di-tana Communication C	
Pit Liner Thickness:	water Distance from nearest	iresii water weii		
Bois, Construction Waterian				
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data				
NOTICE OF IN	TENTION TO:	SUB	SEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON □	REMEDIAL WORK		
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRIL		
PULL OR ALTER CASING	MULTIPLE	CASING/CEMENT		
	COMPLETION			
		OTHER:		
OTHER:		JOHNER.	Ł 1	
	d operations. (Clearly state all pert		re pertinent dates including estimated date of	
13. Describe proposed or complete	d operations. (Clearly state all pert EE RULE 1103. For Multiple Con	inent details, and giv	re pertinent dates, including estimated date of	
13. Describe proposed or complete	d operations. (Clearly state all pert EE RULE 1103. For Multiple Con	inent details, and giv	re pertinent dates, including estimated date of ellbore diagram of proposed completion or	
13. Describe proposed or complete starting any proposed work). S recompletion.	EE RULE 1103. For Multiple Con	inent details, and giv npletions: Attach we	ellbore diagram of proposed completion or	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN.	inent details, and giv inpletions: Attach we . Circulate hole w/n	ellbore diagram of proposed completion or * nud laiden fluid. Spot 25 sx cement on top	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN.	inent details, and giv inpletions: Attach we . Circulate hole w/n	ellbore diagram of proposed completion or * nud laiden fluid. Spot 25 sx cement on top	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25 4/10/07 POH w/tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20	* hud laiden fluid. Spot 25 sx cement on top 500'. SOZ. 45 sx cement, displace to 2700'.	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150'	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20. Spot 25 sx. cemen	*hud laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' v/tbg. to 1240'. Spot 45 sx cement	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20. Spot 25 sx. cemen	*hud laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN.	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. T	** hud laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Fag plug @ 185'. RIH to 62'. Spot 25 sx	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well her	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. T	*hud laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well hes location.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 cs	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. T	** hud laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Fag plug @ 185'. RIH to 62'. Spot 25 sx	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well her	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 cs	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. T	** hud laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Fag plug @ 185'. RIH to 62'. Spot 25 sx	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well hes location.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 cs	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. T	** hud laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Fag plug @ 185'. RIH to 62'. Spot 25 sx	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well hes location.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 cs	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. T	** hud laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Fag plug @ 185'. RIH to 62'. Spot 25 sx	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well her location. 4/16/07 Weld on Dry Hole Market	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ p g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - p ad. Found no cement on 13 3/8 csg c. Cut off dead men.	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. Tog. Pump 25 sx ceme	A stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well hes location.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men.	inent details, and given pletions: Attach we have a considered with the constant of the consta	And laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay docement to surface. Cut off well hes location. 4/16/07 Weld on Dry Hole Market	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. Approved as to Liability under	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20 '. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cemen plugging of the Webond is retained as a special point of the Webond is retained as a special point is retained as a special point in the webond is retained as a special point in the webond is retained as a special point in the webond is retained as a special point in the webond is retained as a special point in the webond is retained as a special point in the web and is retained as a special point in the web as	*hud laiden fluid. Spot 25 sx cement on top 600'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well he location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. Approved as to Liability under surface restorate re is true and complete to the best of means.	inent details, and given pletions: Attach we have a considered in the constant of the constant	Allbore diagram of proposed completion or the nud laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well he location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. Approved as to Liability under surface restorate re is true and complete to the best of means.	inent details, and given pletions: Attach we have a considered in the constant of the constant	Allbore diagram of proposed completion or the nud laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well he: location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu I hereby certify that the information abor has been/will be constructed or closed acceptable.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' v/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. Approved as to Liability under surface restorate re is true and complete to the best of m cording to NMOCD guidelines, a general conding to MOCD guidelines	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cemen plugging of the Wood is retained in the work of th	And laiden fluid. Spot 25 sx cement on top top 100'. SQZ. 45 sx cement, displace to 2700'. It from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean 13 1/28 29 30 30 30 30 30 30 30 30 30 30 30 30 30	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well he location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' v/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. Approved as to Liability under surface restorate re is true and complete to the best of m cording to NMOCD guidelines, a general conding to MOCD guidelines	inent details, and given pletions: Attach we conclude hole w/n packer and set @ 20. Spot 25 sx. cemen from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cemen plugging of the Wood is retained in the work of th	And laiden fluid. Spot 25 sx cement on top top 100'. SQZ. 45 sx cement, displace to 2700'. It from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean 13 1/28 29 30 30 30 30 30 30 30 30 30 30 30 30 30	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well hes location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu I hereby certify that the information abor has been/will be constructed or closed action.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. d Approved as to Liability under surface restorate re is true and complete to the best of m cording to NMOCD guidelines 7 TITLE	inent details, and given pletions: Attach we have a considered in the constant of the constant	All Baran of proposed completion or to hand laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean attached alternative OCD proceed plan attached. DATE	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well her location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu I hereby certify that the information abor has been/will be constructed or closed ac SIGNATURE X Left William Type or print name Kont William Type Or print name Type Or print nam	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. Approved as to Liability under surface restorate we is true and complete to the best of m cording to NMOCD guidelines, a g	inent details, and given pletions: Attach we have a considered and set @ 20. Spot 25 sx. cement from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cement plugging of the Wood is retained to general permit or an experienced and experience	And laiden fluid. Spot 25 sx cement on top	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well hes location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu I hereby certify that the information abor has been/will be constructed or closed action.	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. d Approved as to Liability under surface restorate re is true and complete to the best of m cording to NMOCD guidelines 7 TITLE	inent details, and given pletions: Attach we have a considered and set @ 20. Spot 25 sx. cement from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cement plugging of the Wood is retained to general permit or an experienced and experience	And laiden fluid. Spot 25 sx cement on top	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well her location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu I hereby certify that the information above has been/will be constructed or closed act SIGNATURE X Let William For State Use Only	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. d Approved as to Liability under surface restorate re is true and complete to the best of m cording to NMOCD guidelines 7 TITLE	inent details, and given pletions: Attach we have a considered and set @ 20. Spot 25 sx. cement from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cement plugging of the Wood is retained to general permit or an experienced and experience	And laiden fluid. Spot 25 sx cement on top	
13. Describe proposed or complete starting any proposed work). S recompletion. 4/09/07 MIRU. NU BOP RIH w/5 of BP. (4700 to 4447'). POH w 25: 4/10/07 POH w/ tbg. RU wireline. No pressure. WOC 4 hrs. Tag Plu and cut 5 1/2 @ 1184'. SDFN. 4/11/07 Lay down 5 1/2 csg. RIH v 4/12/07 Tag plug @ 1085'. Lay do cement to surface. Cut off well her location. 4/16/07 Weld on Dry Hole Market *9.5#/gallon salt gel mu I hereby certify that the information abor has been/will be constructed or closed ac SIGNATURE X Left William Type or print name Kont William Type Or print name Type Or print nam	EE RULE 1103. For Multiple Con 1/2 CIBP on tbg. Set BP @ 4700' stands. SWIFN. Perf. 5 1/2 csg. @ 2830'. RIH w/ g @ 2712'. Lay down tbg to 2150' w/tbg. to 1240'. Spot 45 sx cement wn tbg. to 320'. Spot 45 sx. 320 - 1 ad. Found no cement on 13 3/8 csg c. Cut off dead men. d Approved as to Liability under surface restorate re is true and complete to the best of m cording to NMOCD guidelines 7 TITLE	inent details, and given pletions: Attach we have a considered and set @ 20. Spot 25 sx. cement from 1240 - 1100'. 180'. POH. WOC. To g. Pump 25 sx cement plugging of the Wood is retained to general permit or an experienced and experience	All Baran of proposed completion or to hand laiden fluid. Spot 25 sx cement on top 500'. SQZ. 45 sx cement, displace to 2700'. t from 2150 to 1997'. RIH with wireline POH w/ 10 stands. SDFN. Tag plug @ 185'. RIH to 62'. Spot 25 sx nt down 13 3/8 to surface. Rig down, clean attached alternative OCD proceed plan attached. DATE	