

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

Form C-103
Revised 1-1-89

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT I
P.O. Box 1940, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-09829
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-934
7. Lease Name or Unit Agreement Name Humble State
8. Well No. 1
9. Pool name or Wildcat Jalmar

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Southwest Royalties, Inc.
3. Address of Operator P.O. Box 11390, Midland, TX 79702	4. Well Location Unit Letter <u>G</u> : <u>1980</u> Feet From The <u>North</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>36</u> Township <u>25S</u> Range <u>36E</u> NMPM Lea County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>N/A 2988'</u>

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Note: CIBP set @ 2951' and capped w/ 35' cmt. 11/07/02 (Buddy Hill w/ Hobbs NMOCDD witness).
- (1) 9-08-03 MIRU.
 - (2) 9-09-03 Trip in hole with tbgs. & tag TOC @ 2910', circulate hole w/ 10# MLF. POOH w/ tbgs. RU WL & cut 5-1/2" csg. @ 1500'.
 - (3) Pull & lay down 5-1/2".
 - (4) 9-10-03 Trip in hole with tbgs. to 1555' & spot 50 sx cmt. WOC & tag @ 1460'.
 - (5) 9-10-03 Spot 50 sx cement @ 1460' (WOC & tag @ 1412') 9-11-03.
 - (6) 9-10-03 Cut 7" csg. @ 700', csg. not free.
 - (7) 9-11-03 Spot 50 sx cmt. @ 1412' WOC & tag @ 1224'.
 - (8) 9-11-03 Spot 75 sx @ 700' WOC & tag @ 360'.
 - (9) 9-12-03 Perf. well @ 200' set pkr. @ 30' circ. to surface up backside of 7" csg. 125 sx cmt. Release pkr. & lay down 1 jt. fill csg. inside of 7" to surface w/ 5 sx cmt.
 - (10) RDMO. Install dry hole marker, cut off wellhead, & clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TYPE OR PRINT NAME

DAWN HOWARD

ROGER MASEY
BASIC OPS - CONTRACT PLUGGER

OPERATIONS ASST.

DATE

9/23/03

TELEPHONE NO.

432/696-9927

(This space for State Use)

APPROVED BY

Mary W. Wink

TITLE

OC DISTRICT SUPERVISOR/GENERAL MANAGER

DATE

SEP 25 2003