

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-32173

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil / Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI  
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator  
CHEVRON USA INC

3. Address of Operator  
15 SMITH RD, MIDLAND, TX 79705

4. Well Location  
Unit Letter F : 1800 Feet From The NORTH Line and 1650 Feet From The WEST Line  
Section 9 Township 23-S Range 37-E NMPM LEA COUNTY

7. Lease Name or Unit Agreement Name  
B.F. HARRISON 'B'

8. Well No.  
14

9. Pool Name or Wildcat  
TEAGUE GLORIETA UPPER PADDOCK SW

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
3314' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☒ CLEAN OUT & ACID STIMULATE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-30-07: MIRU. TBG STUCK @ 5045. CUT TBG 2.5 JTS ABOVE STUCK TBG.  
5-31-07: TIH W/OVER SHOT W/JARS, BMPR SUB, EXT JT, DC'S, 2 7/8" WS & TAG FISH @ 5022. JAR ON TBG. CAME FREE. KEPT HANGING UP - JAR LOOSE. TIH W/BIT & TAG @ 5036.  
6-01-07: TIH W/SN ON DC, STRING MILL, COLLARS, JARS, DC'S & WS. LEAVE SWINGING ABOVE WINDOW.  
6-04-07: TIH W/SN. TAG @ 5036. FEATHER MILL 5036-5039.  
6-05-07: TIH W/SN & TAG @ 5039. FEATHER MILL TO 5041. FELL THRU TO CIBP. TIH W/BIT TO 5000'.  
6-06-07: TIH W/BIT & TAG @ 5038. MILL 5038-5044.  
6-07-07: TIH W/BIT. START @ 5000 TO GET CIRC & WORK DN TO CIBP. WASH DN TO CIBP. DRILL 5286-5350.  
6-08-07: TOH W/WS. LEAVE 1500' OF TBG.  
6-11-07: TIH W/GAMMA GUN. PERF 5210-18, 5239-44, 5322-30. TIH W/PPI TOOLS, 1 JT BETWEEN PKRS, TAG @ 5350.  
6-12-07: PMP 5400 GALS ACID. TIH W/TBG TO BELOW PERFS & SPOT ACID TO EOT. REV OUT CSG. SN @ 4977. SET PKR.  
6-13-07: SWABBING.  
6-14-07: PUMP SCALE INHIBITOR. FLUSH WELL.  
6-15-07: TIH W/TBG, BPMA, SN, TAC. SET TAC.  
6-18-07: PU PMP & RODS. HANG WELL ON. RIG DOWN. FINAL REPORT.

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist

DATE 6/19/2007

TYPE OR PRINT NAME Denise Pinkerton

Telephone No. 432-687-7375

(This space for State Use)

APPROVED Gay W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER  
CONDITIONS OF APPROVAL, IF ANY.

DATE

JUN 22 2007