

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-005-10505
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. OG-1062
7. Lease Name or Unit Agreement Name KM Chaveroo SA Unit
8. Well Number 15
9. OGRID Number 006515
10. Pool name or Wildcat Chaveroo (San Andres)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Dugan Production Corp.

SEP 04 2007

3. Address of Operator
P. O. Box 420, Farmington, NM 87499-0420

OCD-ARTESIA

4. Well Location

Unit Letter L : 1980 feet from the South line and 660 feet from the West line
Section 2 Township 8S Range 33E NMPM County Chaves

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4377'

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Set cast iron bridge plug @ 4158'. Dump 35' of cement on plug. Circulate plugging mud. Run tubing to 3552'. Spot 25 sx Cement plug @ 3552'. Cut casing @ 1500'. Casing not free. Run tubing to 1550'. Spot 25 sx cement. Tagged cement @ 1291'. Cut casing @ 474'. Pulled 15 jts 5 1/2" csg. Run tubing to 524'. Spot 45 sx. Tagged cement @ 369'. Spot 20 sx from 60' to surface. Dig out cellar. Cut off wellhead. Install P&A marker. Job complete 7/24/2007.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE John Alexander TITLE Vice-President DATE August 29, 2007

Type or print name John Alexander E-mail address: johncalexander@duganproduction.com Telephone No. 505-325-1821

For State Use Only

APPROVED BY: Larry W. Wink TITLE OCD FIELD REPRESENTATIVE II/STAFF MANAGER DATE SEP 11 2007

Conditions of Approval (if any):

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

