

Eugene Coates No. 2
Lea County, New Mexico
Temporary Abandonment Procedure
October 9, 2003

Charge Work To: UWPNM-R3116

1. MIRUSU. Install 3000 psi manual BOP.
2. Pull rods, pump and tubing.
3. RIH with casing scrapper on a 2-7/8" workstring. Clean out casing to 3,175'. TOH.
4. RIH w/ 7" CIBP and set plug at 3,175'. Spot 35' of cement on top of CIBP. Notify OCD and perform casing integrity test to 1,000 psi.
5. RDMOSU.
6. File reports with the OCD.

CURRENT WELL DATA SHEET

Field: Jalmat Well Name: Eugene Coates #2
Location: 660' FSL & 1980' FWL Sec: 3-N Township: 24S
County: Lea State: New Mexico Refno: FB0544 API: 30-025-09506
Current Status: PS
Current Producing Formation(s): Tansill-Yates-Seven Rivers OH completion

Lease Type: Fee
Range: 36E
Cost Center: UCU338500

Surface Csg.


Size: 13 3/8"
Wt.:
Set @: 320'
Sxs cmt: 225
Hole:
TOC: surface

Intermediate Csg.

Size: 9 5/8"
Wt.: 36#
Set @: 3002'
Sxs cmt: 700
Hole: 11"
TOC: surface

Production Csg.

Size: 7"
Wt.: 24#
Set @: 3505'
Sxs Cmt: 225
Hole: 8 1/4"
TOC: unknown

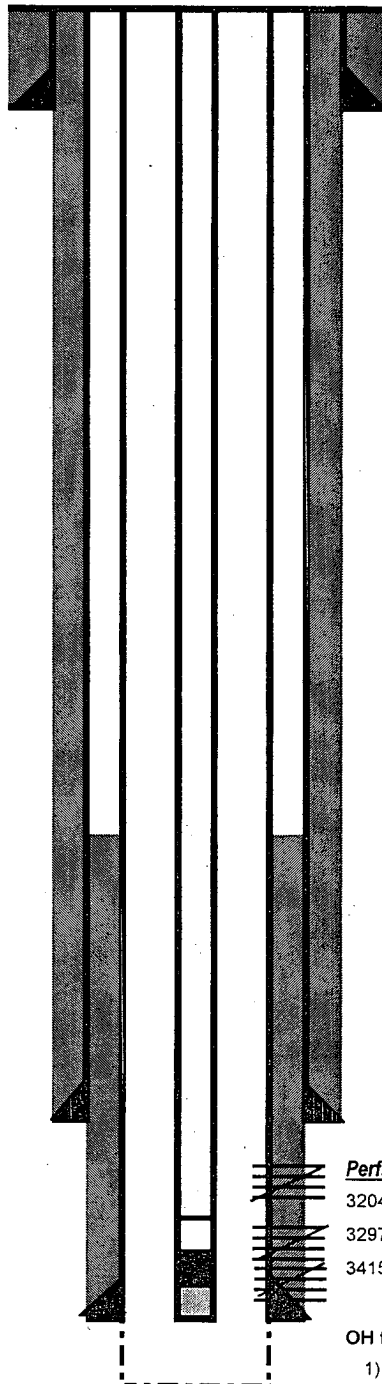

KB:
DF: 3398'
GL:
Spud Date:
Compl. Date: Sept 1935

oil

Perfs

3204-3222' (sqzd 3/70)
3297-3348' (sqzd 3/55)
3415-3427' (sqzd 3/55)

PBTD:
TD: 3668'

OH fr/ 3505-3668' (history below)

- 1) PB OH to 3500' on 3/43
- 2) PB OH to 3285' on 3/55
- 3) D/O OH to 3668 on 3/70

Prepared by: K M Jackson
Date: 10/7/2003