

Submit 3 Copies
to Appropriate
District Office

DISTRICT I
P.O. Box 1940, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

Revised 1-1-89

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ X OTHER SWD	WELL API NO. 30-025- 00355 09854
2. Name of Operator Southwest Royalties, Inc.	5. Indicate Type of Lease STATE ☐ FEE ☒
3. Address of Operator P.O. Box 11390, Midland, TX 79702	6. State Oil & Gas Lease No. LC 030180 A
4. Well Location Unit Letter <u>A</u> : 330 Feet From The <u>East</u> Line and <u>990</u> Feet From The <u>North</u> Line Section <u>13</u> Township <u>26S</u> Range <u>36E</u> NMPM <u>15a</u> County	7. Lease Name or Unit Agreement Name Farnsworth A Federal
8. Well No. <u>1</u>	
9. Pool name or Wildcat Scarborough	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>2952</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting (or proposed work) SEE RULE 1103.

- 9-25-03 MIRU.
- 9-25-03 Pickup 86 jts. of tbq. & tag bottom @ 2635'.
- 9-26-03 Mix & circulate hole w/ 10# MLF.
- 9-29-03 Cut 8-5/8" csg. @ 1400', csg. not free cut #2 @ 1350'. LD 8-5/8"
- 9-30-03 Cut 10-3/4" csg. @ 1320' pull & lay down 10-3/4" csg.
- 10-01-03 Spot 130 sx cmt. @ 1450', WOC & tag @ 1225'.
- 10-01-03 Cut 13" csg. @ 600', csg. not free cut #2 @ 546'. LD 13" csg.
- 10-02-03 Run tbq. to 650', spot 211 sx cmt. WOC & tag @ 508'. TIH w/ tbq. & spot 120 sx cmt. WOC & tag @ 376'.
- 10-03-03 Cut & pull 13" csg. from 196', spot 200 sx cmt. @ 250' w/ 50% returns, WOC.
- 10-06-03 Tag TOC @ 117', mix & spot 275 sx cmt. WOC & tag @ 80'.
- 10-06-03 Spot 110 sx cmt. to fill to surface.
- 10-06-03 RDMO. Cut off wellhead, install dry hole marker, & clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Roger Massey TITLE Agent DATE 10-09-03

TYPE OR PRINT NAME Roger Massey TELEPHONE NO. 432-530-0907

(This space for State Use)

OC DISTRICT SUPERVISOR/GENERAL MANAGER 16 2003

APPROVED BY Larry W. Wink TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: