

Submit 3 Copies To Appropriate District Office
District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S St Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐ Injection Well

2. Name of Operator
GP II Energy, Inc.

3. Address of Operator
PO Box 50682 Midland, TX 79710

4. Well Location

Unit Letter G : 1880 feet from the N line and 1800 feet from the E line
Section 19 Township 22S Range 37E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3429' DF

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See attached plugging procedure and bore hole schematic.

RECEIVED

JAN 16 2008

HOBBS OCD

THE OIL CONSERVATION DIVISION MUST
BE NOTIFIED 24 HOURS PRIOR TO THE
BEGINNING OF PLUGGING OPERATIONS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCDD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Michael Painter TITLE Production Clerk DATE 1-15-08

Type or print name
For State Use Only

E-mail address:

Telephone No.

APPROVED BY: Chris Williams TITLE DISTRICT SUPERVISOR/GENERAL MANAGER DATE JAN 30 2008

Conditions of Approval (if any): See plugging procedure

Squeeze and Plugging Procedures for the New Mexico "M" State #46

1. RUPU.
2. Install and test BOP.
3. GIH with tubing and packer. Pressure up backside to 500# for 15' to check tubing - casing integrity. If no leaks are found, TOH with Packer. Casing leaks are common in this area from 300' to 700'. If leaks are found, note their location and TOH with tubing and packer.
4. GIH with wire line CIBP and set at approximately 3425'. GIH with bailer and dump 35' cement on CIBP. WOC. PU and circulate hole with plugging mud. TOH. GIH and perforate casing above TOC @ ~2400. Squeeze perforations with 25 sx. WOC and tag plug. TOH with tubing. GIH and perforate top of salt @ 1230'. GIH with tubing and packer. Squeeze perforations with 25 sx. WOC and tag plug.
5. PU and pump 100'+ cement plug across 7 5/8" shoe, sufficient to bring plug 50'+ above top of shoe and 50'+ below 7 5/8" casing shoe. PU and WOC.
6. Tag plug set across 7 5/8" shoe. PU and set surface plug.
6a. 105KS or 60' surface plug.
7. Cut off casing and set dry hole marker.
8. Clean and remediate location.

Note: The NMOCD will be notified at least 24 hours before starting work on well.

RECEIVED

JAN 16 2008

HOBBS OCD


GP II ENERGY, INC.
NEW MEXICO "M" STATE #46
1880' FNL & 1800' FEL
SEC 19, T22S, R37E
LEA COUNTY, NEW MEXICO
T.D. 3703'

RECEIVED

JAN 16 2008

HOBBS OCD

CURRENT
ELEVATION 3429' (DF)

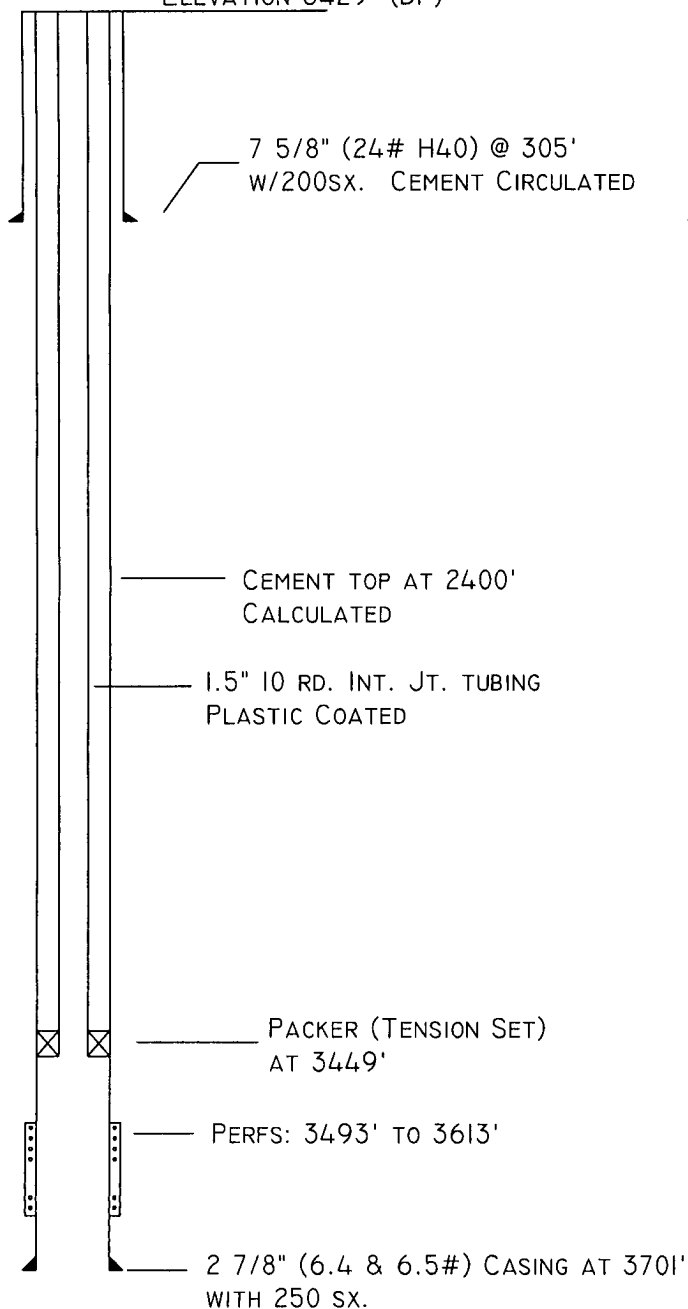

PROPOSED
ELEVATION 3429' (DF)

