

DISTRICT I

1625 French Drive Hobbs, NM 88240

DISTRICT II

P. O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P. O. Box 2088
Santa Fe, NM 7504-2088

WELL API NO.

30-025-28507

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1 Type of Well:

OIL

WELL ☒

GAS

WELL ☐

OTHER

2. Name of Operator

The Wiser Oil Company

8. Well No.

2

3. Address of Operator

P.O. Box 2568 Hobbs, New Mexico (505) 392-9797

9. Pool name or Wildcat

Scharb Bone Spring

4. Well Location

Unit Letter C : 660 Feet From The North Line and 1580 Feet From The West Line

Section 17 Township 19S Range 35E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3831.6' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Wiser request approval to plug and abandon the well by the procedure listed below.

Surface Casing: 13-3/8" set @ 410' w/cmt. circ.

Int. Casing: 9-5/8" set @ 4120' cmt. circ.

Prod. Casing: 7" liner f/3802' H-200'

TOC @ 7900'.

Perfs: 9256'-9902'

1. Set CIBP @ 9200'. Spot 35' cmt. plug on CIBP.

2. Circulate abandonment mud.

3. Perforate 7" casing @ 6200' & squeeze 50' outside casing & 50' inside casing. Tag plug @ 6150'.

4. Perforate casing @ 4170' & squeeze 50' outside casing & 50' inside casing. Tag plug @ 4120'.

5. Spot 100' cement plug @ 3150'-3050'. Tag plug.

6. Spot 100' cement plug @ 1900'-1800'. Tag plug.

7. Spot 100' cement plug @ 460'-360'. Tag plug

8. Spot 60' cement plug @ surface.

9. Install dry hole marker.

10. Clean location

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE C-103
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TYPE OR PRINT NAME

Mike Jones

TITLE Production Superintendent

DATE October 23, 2003

TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

OC FIELD REPRESENTATIVE II/STAFF MANAGER

DATE OCT 29 2003