Office Samuel Carlotte Control Carlotte	opriate District  State of New Mexico  Fileron Millerals and Natural Resources			Form C-103 Revised March 25, 1999
1625 N French Dr., Hobbs, NM 88240			WELL API NO.	
District II 811 South First, Artesia, NM 88210  AUGOUSERVATION DIVISION			30-025-24979	
			5. Indicate Type	
District III 1000 Rio Brazos Rd, Aztec, NM 87 10 District IV 1220 S. St. Francis Dr, Santa Fe, NM 87505 87505			STATE L	
			o. State Off & C	ias Lease No.
SUNDRY NOTICES AND REPORTS OF (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEED DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FOR PROPOSALS)  1. Type of Well:  Oil Well  Gas Well  Other	EPEN OR PL	UG BACK TO A	7. Lease Name or Julia Culp	Unit Agreement Name:
2. Name of Operator			8. Well No.	
Marks and Garner Production Ltd. Co.			1	
3. Address of Operator			9. Pool name or V	Vildcat
P.O. Box 1089, Hobbs, NM 88241	•		Townsend Permo	Upper - Penn
4. Well Location				
Unit Letter H, 1650 feet from the North  Section 34 Township 15S  10. Elevation (Show)	Rang		NMPM Lea	_line County
11. Check Appropriate Box to In NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON		SUB	SEQUENT REI	PORT OF:
FERT ORM REMEDIAL WORK FLOG AND ABANDON	<b>'</b>	REMEDIAL WORI	`	ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS		COMMENCE DRI	PLUG AND ABANDONMENT	
PULL OR ALTER CASING		CASING TEST AN CEMENT JOB	ND	
OTHER:		OTHER:		
<ol> <li>Describe proposed or completed operations. (Clearly s of starting any proposed work). SEE RULE 1103. For or recompilation.</li> <li>4/19/04 – 4/26/04</li> <li>Set CIBP @ 10272' w/ 25 sxs cement on top. WOC 24 hrs Spot 25 sx plug at 7772. WOC 24 hrs., tag. Shoot 5 ½" csg. @ free point (approx. 6000').</li> <li>Spot 50 sxs in and out of stub. WOC 24 hrs., tag. Spot 50 sxs in and out @ 4217'. WOC 24 hrs., tag. Spot 50 sxs @ 1900'. WOC 24 hrs., tag. Shoot 8 5/8" @free point @ 1000'.</li> <li>Spot 50 sxs in and out of stub. WOC 24 hrs., tag. Spot 50 sxs in and out of stub. WOC 24 hrs., tag. Spot 60 sxs @ 408'. WOC 24 hrs., tag. Install dry hole marker w 10 sxs @ surface. Clean Location. Witnessed by Bill Prichard.</li> </ol>	Multiple C	Completions: Attach	n wellbore diagram	of proposed completion
I hereby certify that the information above is true and compl	lete to the l	pest of my knowledg	ge and belief.	
SIGNATURE John Milvey TITLE	AGEN	T		_DATE <u>8/12/08</u>
Type or print name Quinton Welborn		Telephone No. 57	75-393-9358	
(This space for State use)		1		
APPPROVED BY Mus Wellesme Conditions of approval, if any:	C DST	CT SUPERVISOR/G	ENERGE AWAYGE	AUG 18 2008