	Form C-103 May 27, 2004
District I 1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
Distant II	30-025-35524
District III District IIII District III District III District III District III D	5. Indicate Type of Lease
	STATE FEE
District IV	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa F., NOUDDOUL	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	TOMCAT 15 FEDERAL
DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well Gas Well Other –Convert to SWD	8. Well Number
2. Name of Operator	9. OGRID Number
DEVON ENERGY PRODUCTION COMPANY, LP	6137
3. Address of Operator	10. Pool name or Wildcat
20 North Broadway, Ste 1500, Oklahoma City, OK 73102 405-552-4615	D DELWARE CHERRY CANYON-
4. Well Location	/
Unit Letter_D:660'feet from the _NORTH line and660	'feet from theWESTline
Section 15 Township 23S Range 32E	NMPM County LEA
11. Elevation (Show whether DR, RKB, RT, GR, etc.	
3709' KB; 3697' GL	
Pit or Below-grade Tank Application or Closure	
Pit typeDepth to GroundwaterDistance from nearest fresh water wellDistance from neare	stance from nearest surface water
Pit Liner Thickness: mil Below-Grade Tank: Volume bbls; C	Construction Material
12. Check Appropriate Box to Indicate Nature of Notice,	Report or Other Data
PERFORM REMEDIAL WORK D PLUG AND ABANDON REMEDIAL WOR	
	—
	vert to SWD, Admin. Order SWD-1120
	vert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated date
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 	wert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated date attach wellbore diagram of proposed completion
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 	wert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated date attach wellbore diagram of proposed completion
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 	wert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated date attach wellbore diagram of proposed completion
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCl. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 	wert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942'
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 	wert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942'
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co 	wert to SWD, Admin. Order SWD-1120 nd give pertinent dates, including estimated date attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below-
 OTHER: □ 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co 	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below- l or an (attached) alternative OCD-approved plan
 OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co 	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below- or an (attached) alternative OCD-approved plan chnicianDATE7/28/08_
OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCI. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co I hereby certify that the information above is true and complete to the best of my knowled. grade tank has been/will be constructed or closed according to NMOCD guidelines □, a general permit □ SIGNATURE	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below- or an (attached) alternative OCD-approved plan chnicianDATE7/28/08_
OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, at of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co I hereby certify that the information above is true and complete to the best of my knowled grade tank has been/will be constructed or closed according to NMOCD guidelines □, a general permit □ SIGNATURE Image: Mutual M	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below-] or an (attached) alternative OCD-approved plan []. chnician DATE $7/28/08$ a.com Telephone No. 405-552-4615
OTHER: OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCl. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co I hereby certify that the information above is true and complete to the best of my knowled grade tank has been/will be constructed or closed according to NMOCD guidelines [], a general permit [] SIGNATURE MMM TITLE Engineering Te Type or print name Ronnie Slack E-mail address: Ronnie.Slack@dvn For State Use Only Mit Multiment of Cuertee State Use Only Mit Multiment of Cuertee State Use Only Mit Multiment of Cuertee State Use Only	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below- or an (attached) alternative OCD-approved plan []. chnician DATE $7/28/08$ n.com Telephone No. 405-552-4615 ALMANNON
OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/4700 gals 7-1/2% HCl. Swab test no oil. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8' IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co I hereby certify that the information above is true and complete to the best of my knowled grade tank has been/will be constructed or closed according to NMOCD guidelines □, a general permit □ SIGNATURE WWW MWW TITLE Engineering Te Type or print name Ronnie Slack E-mail address: Ronnie Slack E-mail address: Ronnie.Slack@dvm For State Use Only Withum Withum Withum	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below- or an (attached) alternative OCD-approved plan []. chnician DATE $7/28/08$ n.com Telephone No. 405-552-4615 ALMANNON
OTHER: □ OTHER ⊠ Con 13. Describe proposed or completed operations. (Clearly state all pertinent details, at of starting any proposed work). SEE RULE 1103. For Multiple Completions: A or recompletion. 1. 5/29/08: MIRU. Set CIBP @ 6740'. Dumped 35' cement on top. 2. Set CIBP @ 6177'. Dumped 35' cement on top. PBD @ 6142'. 3. Perforated Delaware Cherry Canyon zone 2 spf, 120° phase at 5786'-580 4. Acidized 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 5. Fraced 5786'-5942' w/125,747# 16/30 sand w/72,744 gals frac fluid. 6. TIH w/2-3/8" IPC tubing & arrowset packer. Set packer @ 5734'. Release 7. Conducted MIT @ 520 psi for 30 minutes on 6/9/08. MIT chart attached. 8. 6/11/08: Rig down. Wait on injection line installation. 9. 7/23/08Trucked in and established injection at 75 BWPD at 75 PSI. Co I hereby certify that the information above is true and complete to the best of my knowled grade tank has been/will be constructed or closed according to NMOCD guidelines □, a general permit □ SIGNATURE Image: Mutual M	wert to SWD, Admin. Order SWD-1120 and give pertinent dates, including estimated data attach wellbore diagram of proposed completion 0'; 5852'-5878'; 5908'-5942' ed on/off tool, displaced hole w/packer fluic ntinue injection line installation. ge and belief. I further certify that any pit or below- or an (attached) alternative OCD-approved plan []. chnician DATE $7/28/08$ n.com Telephone No. 405-552-4615 ALMANNON

.



