

RECEIVED

SEP 12 2008
HOBBS OGD

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO.	30-025-34086
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Kyte
8. Well Number	6
9. OGRID Number	147179
10. Pool name or Wildcat	Warren; San Andres, East
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	3568' GR

SUNDY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator Chesapeake Operating, Inc.

3. Address of Operator P.O. Box 18496-0496
Oklahoma City, OK 73154-0496

4. Well Location

Unit Letter I : 2310' feet from the South line and 990' feet from the East line
Section 23 Township 20 S Range 38 E NMPM County Lea

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
 DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS. ☐ P AND A ☐
 CASING/CEMENT JOB ☐

OTHER: ☐OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dear Sirs/Madams:

Please find the following information in Chesapeake Operating, Inc.'s plan to plug and abandon this well:

Plug and abandonment procedure, workover schematic (actual and proposed) and NMOCD's C-144 CLEZ pit permit.

Spud Date: 08/11/1997

Rig Release Date: 11/28/1997

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Linda Good TITLE Sr. Reg. Compl. Specialist DATE 09/10/2008Type or print name Linda Good E-mail address: linda.good@chk.com PHONE: (405)767-4275

For State Use Only

APPROVED BY: [Signature] TITLE PETROLEUM ENGINEER DATE SEP 17 2008

Conditions of Approval (if any):




Proposal for Workover

KYTE 6-23

Field: EAST WARREN
County: LEA
State: NEW MEXICO
Location: SEC 23-20S-38E, 2310 FSL & 990 FEL
Elevation: GL 3,568.00 KB 3,589.00
KB Height: 21.00

Spud Date: 8/11/1997
Initial Compl. Date:
API #: 3002534086
CHK Property #: 890134
1st Prod Date: 10/2/1997
PBSD: Original Hole - 3050.0
TD: 5,350.0

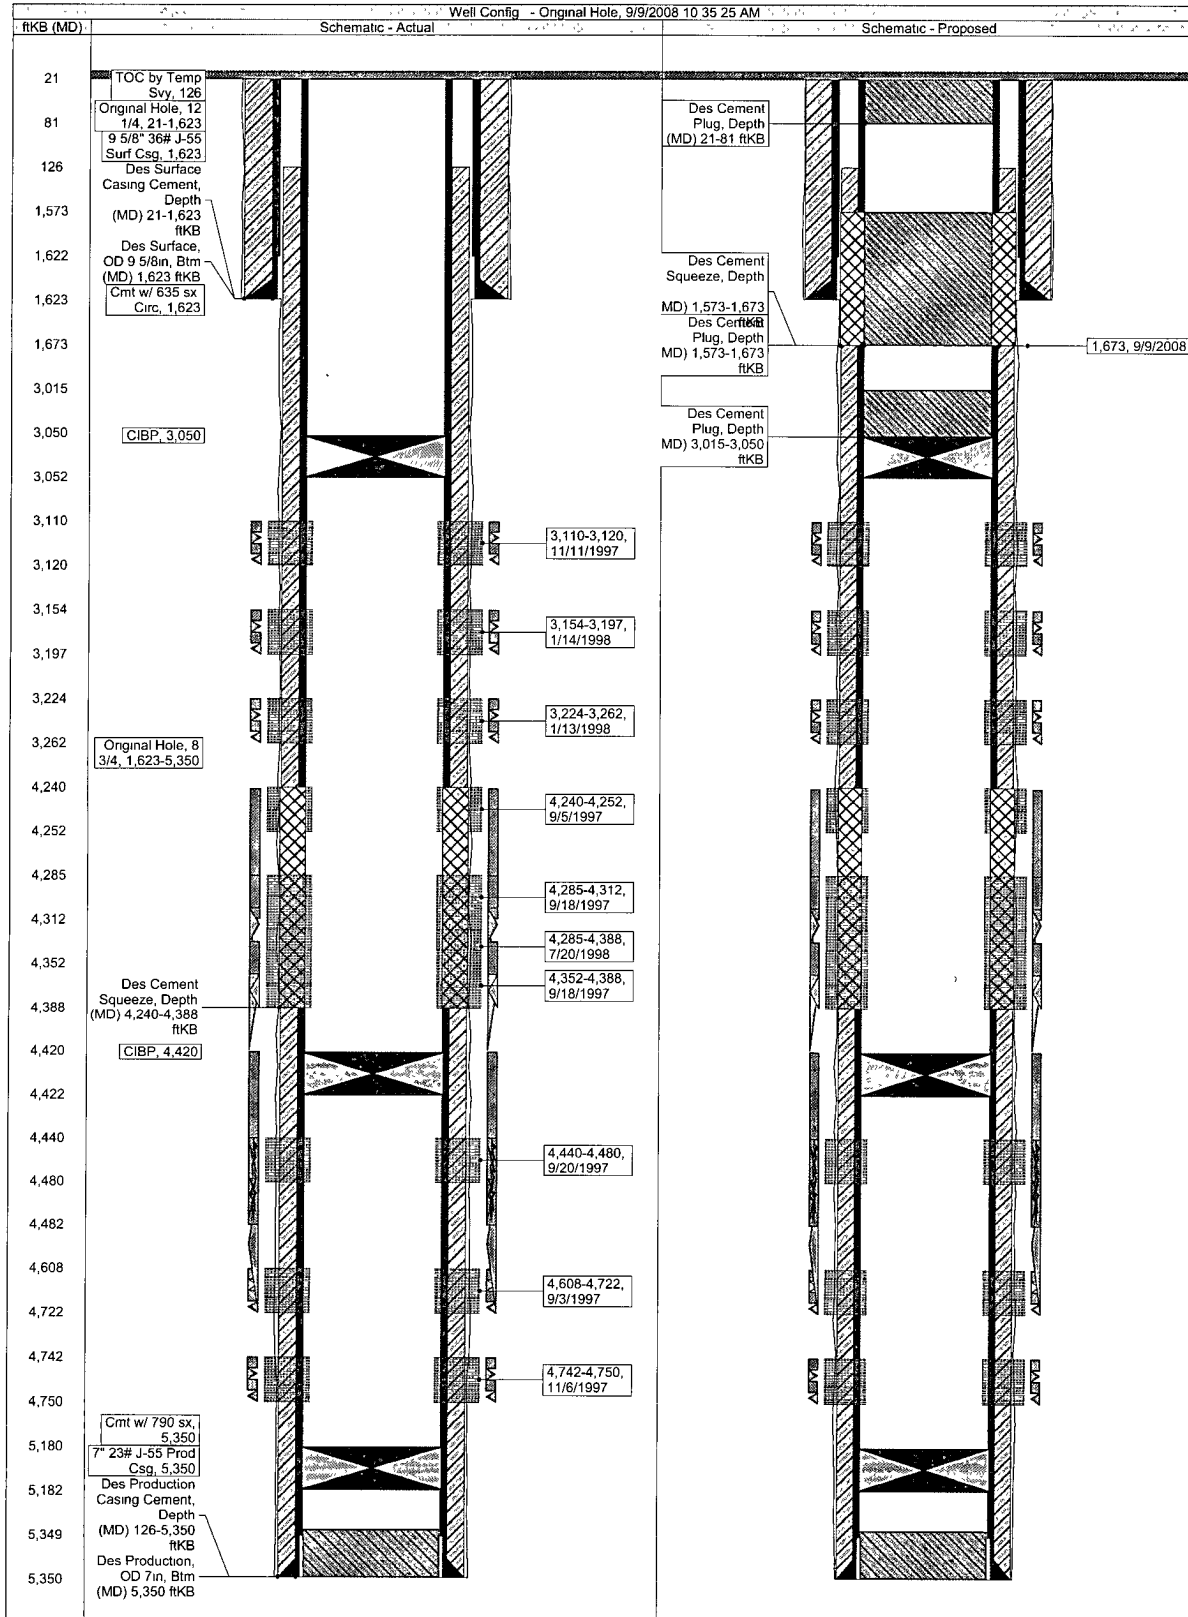

**Kyte #6-23
Plug and Abandonment
Lea County, NM**

Plug and Abandonment Procedure

1. Notify the NMOCD 24 hrs in advance prior to commencing plug and abandonment operations.

Current Wellbore Information

Surface Casing (9-5/8", J-55, 36#, 0-1,623')

Production Casing (7", 23#, J-55, 0-5,350')

GL: 3,568' **KB:** 3,589' **KB Height:** 21.00'

Current Perfs: San Andres 4,240' – 4,750'
Yates 3,110' – 3,120'

OIH: CIBP @ 5,180'

CIBP @ 4,420'

CIBP @ 3,050'

2. Test Anchors
3. Rack 102 joints of 2-3/8" N-80 Workstring.
4. MIRU PU. ND wellhead. NU BOP.
5. RU wireline unit. RIH w/ gauge ring and junk basket to 3,050'. RIH and dump bail 35' cement on CIBP @ 3,050'.
6. Circulate hole with 9.5# brine w/ 12.5 lbs of gel per bbl fluid and pressure test.
7. Perforate casing w/ 4 squeeze holes @ 1,673' and set a 100' cement plug inside and out. PUH, wait 4 hours and tag plug. (Surface casing shoe plug).
8. PUH w/ tbg to 60'. Fill casing back to surface w/ cement. POH w/ tbg. Top off casing w/ cement.
9. RDMO. Install dry hole marker and cut off dead man. Restore location.

Contacts

Workover Foreman

Lynard Barrera

Office: 575-391-1462

Cell: 575-631-4942

Production Foreman

Greg Skiles

Office: 575-391-1462

Cell: 575-631-1663

Asset Manager

Kim Henderson

Office: 405-879-8583

Cell: 405-312-1840

Field Engineer

Doug Rubick

Office: 575-391-1462

Cell: 575-441-7326