	State of New Mexico	Form C-103
<u> </u>	Ainerals and Natural Resources	June 19, 2008 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Ave., Qresia, NO 8612008 OIL CO	NICEDIATION DIVICIONI	30-025-31856
District III 122	0 South St. Francis Dr.	5. Indicate Type of Lease STATE X FEE
District IV 1220 S. St. Francis or Santa to MA	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		7. Lease Name or Unit Agreement Name West Teas Yates Seven Rivers Unit
1. Type of Well: Oil Well Gas Well G	Other SWD; Delaware	8. Well Number 600
2. Name of Operator Chesapeake Operating, Inc.		9. OGRID Number 147179
3. Address of Operator P.O: Box 18496-0496 Oklahoma City, OK 73154-0496		10. Pool name or Wildcat SWD; Delaware
4. Well Location		
	from the North line and 198	
	nship 20 S Range 33 E	NMPM County Lea
11. Elevation (3539' GR	(Show whether DR, RKB, RT, GR, etc.	
12. Check Appropriate Bo	ox to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENTION TO PERFORM REMEDIAL WORK PLUG AND AS TEMPORARILY ABANDON CHANGE PLA PULL OR ALTER CASING MULTIPLE CODOWNHOLE COMMINGLE	BANDON REMEDIAL WOR	ILLING OPNS. □ P AND A ☑
OTHER:	OTHER:	
13. Describe proposed or completed operations.		
or recompletion.	2 1103. For Multiple Completions: A	ttach wellbore diagram of proposed completion
	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP DF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO	TS OF 2 7/8" TBG. 4" BIT, 6- 3 1/2" DRILL COLLARS & TBG. TAG @ 4475'. DRILL & WASH TOOH & LAY DOWN BHA. TIH & WIRE 2 5186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO JP Approved for plugging of well bore only. Liability under bond is retained pending receipt
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RD	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP DF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO	TS OF 2 7/8" TBG. 4" BIT, 6- 3 1/2" DRILL COLLARS & TBG. TAG @ 4475'. DRILL & WASH TOOH & LAY DOWN BHA. TIH & WIRE 0, 5186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RDI CUT OFF WELL HEAD & GUY WIRE ANCHO	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP OF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO ORS. READY FOR FINAL CLEAN U	TS OF 2 7/8" TBG. 4" BIT, 6- 3 1/2" DRILL COLLARS & TBG. TAG @ 4475'. DRILL & WASH OOH & LAY DOWN BHA. TIH & WIRE \$\frac{1}{2}\$ 5186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO JP Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RDI CUT OFF WELL HEAD & GUY WIRE ANCHO	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP "DF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO DRS. READY FOR FINAL CLEAN URING REIGHT CONTROL TO THE PROPERTY OF T	TAG @ 4475'. DRILL & WASH TOOH & LAY DOWN BHA. TIH & WIRE 25186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms, www.cmnrd.state.nm.us/ocd.
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RD CUT OFF WELL HEAD & GUY WIRE ANCHO Spud Date: 05/29/1993	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP "DF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO DRS. READY FOR FINAL CLEAN URING REIGHT CONTROL TO THE PROPERTY OF T	TAG @ 4475'. DRILL & WASH TOOH & LAY DOWN BHA. TIH & WIRE 25186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms, www.cmnrd.state.nm.us/ocd.
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RD CUT OFF WELL HEAD & GUY WIRE ANCHO Spud Date: 05/29/1993	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP "DF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO DRS. READY FOR FINAL CLEAN URING REIGHT CONTROL TO THE PROPERTY OF T	TAG @ 4475'. DRILL & WASH OOH & LAY DOWN BHA. TIH & WIRE 0,5186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO IP Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms, www.cmnrd.state.nm.us/ocd. ge and belief.
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RD CUT OFF WELL HEAD & GUY WIRE ANCHO Spud Date: 05/29/1993 I hereby certify that the information above is true and SIGNATURE SIGNATURE Linda Good	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP OF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO ORS. READY FOR FINAL CLEAN U Rig Release Date: 11/05/1994 d complete to the best of my knowledg TITLE Sr. Regulatory Compl. Sp E-mail address: linda.good@chk	A" BIT, 6- 3 1/2" DRILL COLLARS & TBG. TAG @ 4475'. DRILL & WASH OOH & LAY DOWN BHA. TIH & WIRE 0,5186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO JP Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms, www.cmnrd.state.nm.us/ocd. ge and belief. DATE 10/03/2008 .com PHONE: (405)767-4275
or recompletion. 9/16/08 thru 9/26/2008: MIRU PU & SURF. EQUIP. NDWH, NUBOP. TIH W/ 4.65 GR & JB. TAG @ 3740'. STUCK JI TAG @ 4635'. CLEAN OUT TO TOP OF CIBP. TIH W/ 4 3/4' DOWN TO 5715'. CIRCU CLEAN. PU TO 5500 LINE SET CIBP @ 5520'. TIH W/ TBG & TAG @ 5520 & CIRCU PLUG MUD. SPOT 35 SXS OPUMP 25 SX PLUG @ 3014'. PU & WOC. TIH TIH W/ TBG. NO TAG @ 3014'. SPOT 25 SX P SURF. LD TBG. TOP OFF CSG TO SURF. RD CUT OFF WELL HEAD & GUY WIRE ANCHO Spud Date: 05/29/1993 I hereby certify that the information above is true and	RELEASE PKR & TOOH W/ 101 JT B. WORKED FREE. TOOH; PU 4 3/ "BIT & D.C. TIH W/ TBG & SOFT 0'. TIH TO 5717'. CIRCU CLEAN. T CIBP OF CMT ON PLUG. WOC & TAG @ NO TAG. RE-SPOT 25 SX PLUG & PLUG. WOC & TAG PLUG @ 2851'. MO ORS. READY FOR FINAL CLEAN U Rig Release Date: 11/05/1994 d complete to the best of my knowledg TITLE Sr. Regulatory Compl. Sp E-mail address: linda.good@chk	TS OF 2 7/8" TBG. 4" BIT, 6- 3 1/2" DRILL COLLARS & TBG. TAG @ 4475'. DRILL & WASH OOH & LAY DOWN BHA. TIH & WIRE 5186'. PU TO 3014. MAKE RIG REPAIRS. WOC. PU TO 547'. PUMP 65 SXS OF CMT TO JP Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms, www.cmnrd.state.nm.us/ocd. ge and belief. DATE 10/03/2008