Submit 3 Copies To Appropriate District Office State of New Mexico	Form C-103
District I Energy, Minerals and Natural Resources	Revised March 25, 1999
1625 N. French Dr., Hobbs, NM 88240 District II	WELL API NO. 30-025-10449
1301 W. Grand Avenue, Artesia, NM 88210 District III 1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505	STATE FEE Z
1220 S. St. Francis Dr., Santa Fe, NM 87505	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name:
1. Type of Well: Oil Well ☑ Gas Well ☐ Other	Amanda
2. Name of Operator	8. Well No.
Chevron USA Inc	1
3. Address of Operator 15 Smith Rd, Midland, TX, 79705	Pool name or Wildcat Paddock
4. Well Location	
Unit Letter J: 1980 feet from the South line and 1980 feet from the East line	
Section 25 Township 22-S Range 37-E	NMPM Lea County
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	
11 Chook Appropriate Device II 1' A N. C.	
11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING	
TEMPORARILY ABANDON	LLING OPNS. PLUG AND ABANDONMENT
PULL OR ALTER CASING MULTIPLE CASING TEST AN CEMENT JOB	
OTHER: OTHER:	
12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.	
1. Notify OCD 24 hrs prior to MI and RU. 2. RIH, retrieve RBP at 5380, RIH set 5 1/2 CIBP at 5625, spot 25sx, plug 5625-5575 (Blinebry) WOC Tag. 3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL. 4. Spot 30sx, plug 5100-4900 (Paddock) WOC Tag. 5. Spot 25sx, plug 3800-3600 (Queen). 6. Cut 5 1/2 csg at 3460, L/D csg. 7. Spot 140sx, plug 3550-2700 (7" Shoe, Yates, B-Salt) WOC Tag. 8. Spot 35sx, plug 1300-1100 (T-Salt) WOC Tag. 9. Perf 4 holes at 350, sgz 140 sx, plug 350-Surf 7" x 10 3/4" (10 3/4 Shoe, Surf) WOC Tag.	
10. Install dry hole marker.	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SIGNATURE	t DATE /1/13/2003
Type or print name G.R. Bledsoe	Telephone No. (432) 687-7153
APPPROVED BY LOWER OC FIELD REPRESENTATIVE TITLE	II/STAFF MANAGEBATE NOV 18 2003
Conditions of approval, if any	ONLANLIST DE NIOTIEIED 24