

Submit 3 Copies to Appropriate District
Office
District I
1625 N French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87400
District IV
1220 S St Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO. 30-025-24979
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Julia Culp
8. Well No. 1
9. Pool name or Wildcat Townsend Permo Upper - Penn

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☒

2. Name of Operator
Marks and Garner Production Ltd. Co.

3. Address of Operator
P.O. Box 1089, Hobbs, NM 88241

4. Well Location

Unit Letter H, 1650 feet from the North line and 330 feet from the East line

Section 34 Township 15S Range 35E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

4/19/04 - 4/26/04

Set CIBP @ 10272' w/ 25 sxs cement on top. WOC 24 hrs., tag. Loaded hole with gel.

Spot 25 sxs plug at 7772. WOC 24 hrs., tag.

Shoot 5 1/2" csg. @ free point (approx. 6000').

Spot 50 sxs in and out of stub. WOC 24 hrs., tag.

Spot 50 sxs in and out @ 4217'. WOC 24 hrs., tag.

Spot 50 sxs @ 1900'. WOC 24 hrs., tag.

Shoot 8 5/8" @ free point @ 1000'.

Spot 50 sxs in and out of stub. WOC 24 hrs., tag.

Spot 60 sxs @ 408'. WOC 24 hrs., tag.

Install dry hole marker w 10 sxs @ surface.

Clean Location.

Witnessed by Bill Prichard.

Approved for plugging of well bore only.
Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OED Web Page under Forms, www.emnrd.state.nm.us/oed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Debbie McKelvey TITLE AGENT DATE 10/06/08

Type or print name for Quinton Welborn

Telephone No. 575-393-9358

(This space for State use)

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE OCT 20 2008

Conditions of approval, if any: