


State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 5-27-2004

OIL CONSERVATION DIVISION	
DISTRICT 1 1220 South St. Francis Dr.	WELL API NO. 30-025-07597
Santa Fe, NM 87505	5. Indicate Type of Lease
1301 W. Grand Ave, Arthus 13 MM 2210	STATE X FEE
DISTRICT III 1000 Rio Brazos Rd, Aztec, NM 87410	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)	South Hobbs (G/SA) Unit Section 4
1. Type of Well Other Injector	8. Well No. 31
2 Name of Operator Occidental Permian Ltd.	9. OGRID No. 157984
3 Address of Operator	10. Pool name or Wildcat Hobbs (G/SA)
HCR I Box 90 Denver City, TX 79323 4. Well Location	
	From The West Line
Section 4 Township 19-S Range 38-E	NMPM Lea County
11. Elevation (Show whether DF, RKB, RT GR, etc.) 3612' DF	
Pit or Below-grade Tank Application or Closure	
Pit Type Depth of Ground Water Distance from nearest fresh water well	Distance from nearest surface water
Pit Liner Thickness mil Below-Grade Tank: Volume bbls; Construction Mai	
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature of Notice, Report, or Check Appropriate Box to Indicate Nature Of Notice, Report, or Check Appropriate Box to Indicate Nature I	
	EQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPI	ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPI	IS. PLUG & ABANDONMENT
PULL OR ALTER CASING Multiple Completion CASING TEST AND CEMEN	
PULL OR ALTER CASING Multiple Completion CASING TEST AND CEMEN	ТЈОВ
OTHER: OTHER: Clean out and a	T JOB X
OTHER: OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates,	T JOB X X including estimated date of starting any
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer.	T JOB X X including estimated date of starting any
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP.	T JOB X cid treat X including estimated date of starting any ompletion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars.	including estimated date of starting any completion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL acid	including estimated date of starting any completion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars.	including estimated date of starting any completion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL aci w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead	including estimated date of starting any completion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL aci w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD.	including estimated date of starting any completion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL aci w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection.	including estimated date of starting any completion or recompletion.
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well fron POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL aci w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection. RUPU 09-10-08 RDPU I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify the complete to the best of my knowledge and belief. I further certify the certify the complete to the best of my knowledge and belief. I further certify the certify the complete to the best of my knowledge and belief. I further certify the certify the complete to the best of my knowledge and belief. I further certify the certification the certification that the certification the certification the certification the certification the certification that the certification the certification that	including estimated date of starting any completion or recompletion. 1 4060-4248'. RD power swivel & stripperhead. 2 d in 3 settings w/gelled rock salt block. Flush
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL acid w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection. RUPU 09-10-08 RDPU 1 hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify the constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative	including estimated date of starting any completion or recompletion. 1 4060-4248'. RD power swivel & stripperhead. 2 d in 3 settings w/gelled rock salt block. Flush 1 409-17-08 1 any pit or below-grade tank has been/will be
OTHER: Clean out and a 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed c 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL aci w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection. RUPU 09-10-08 RDPU I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify toonstructed or	including estimated date of starting any completion or recompletion. 1 4060-4248'. RD power swivel & stripperhead. 2 d in 3 settings w/gelled rock salt block. Flush 1 409-17-08 1 hat any pit or below-grade tank has been/will be 2 OCD-approved
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL aci w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection. RUPU 09-10-08 RDPU 1 hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify the constructed or closed according to NMOCD guidelines ageneral permit or an (attached) alternative plan	including estimated date of starting any completion or recompletion. 1 4060-4248'. RD power swivel & stripperhead. 2 d in 3 settings w/gelled rock salt block. Flush 1 409-17-08 1 and any pit or below-grade tank has been/will be 2 OCD-approved
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL acid w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection. RUPU 09-10-08 RDPU 1 hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify to constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative plan SIGNATURE Administrative A	including estimated date of starting any completion or recompletion. 1 4060-4248'. RD power swivel & stripperhead. 2 d in 3 settings w/gelled rock salt block. Flush 1 409-17-08 1 and any pit or below-grade tank has been/will be 2 OCD-approved Associate DATE 10/17/2008
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of 1. RUPU & RU. POOH w/tubing and injection packer. 2. ND wellhead/NU BOP. 3. RIH w/bit & drill collars. Tag fill @4060'. RU power swivel & stripperhead. Clean out well from POOH w/bit & drill collars. 4. RIH w/5" treating packer set @4140'. RU HES & acid treat well w/72 bbl of 15% NEFE HCL acid w/fresh water. RD HES. POOH w/treating packer. 5. RIH w/G-6 packer set on 121 jts of 2-3/8" Duoline tubing. Packer set @3852'. 6. ND BOP/NU wellhead 7. Test casing to 480# for 30 minutes and chart for the NMOCD. 8. RDPU & RU. Clean location and return well to injection. RUPU 09-10-08 RDPU Thereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify to constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative plan SIGNATURE TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy johnson@oxy.com	including estimated date of starting any completion or recompletion. 1 4060-4248'. RD power swivel & stripperhead. 2 d in 3 settings w/gelled rock salt block. Flush 2 and any pit or below-grade tank has been/will be 3 oCD-approved Associate DATE 10/17/2008

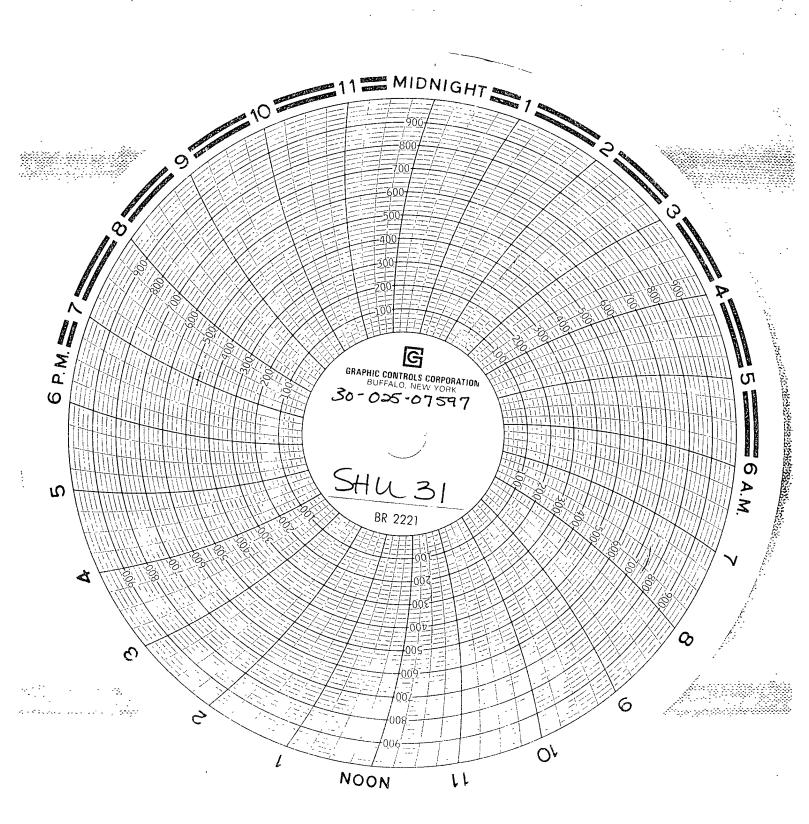

LARRY CINTON - WEATHER FORDS

9-16-08

SOUTH HOBBS # 31

CHANT RECONSER - PATE TRUCING

CAMBRITED 7-2-08

UNIT # 28