ECEWEL

Form 3160-5

(Instructions on page 2)

**UNITED STATES** (August 2007) G-F-2-1 2008 ARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

QCD-HOBBS

FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010

5. Lease Serial No. NM-0140977

	SUNDRY	NOTICES AND REPORTS ON WELLS form for proposals to drill or to re-enter an
8	Doing Luse this	form for proposals to drill or to re-enter an
	abandoned well	Use Form 3160-3 (APD) for such proposals

6. If Indian, Allottee or Tribe Name

SUBMI	IT IN TRIPLICATE – Other	instructions on page 2.		7. If Unit of CA/Agree	ment, Name and/or No.	
I. Type of Well		. ,		NMNM87877X		
Oil Well Gas V	Well Other			8. Well Name and No. SOUTH JUSTIS U	JNIT "C" #13 🗸	
2. Name of Operator LEGACY RESE	ERVES OPERATING LP			9. API Well No. 30-025-20544		
3a. Address		3b. Phone No. (include area of	ode)	10. Field and Pool or E	Exploratory Area	
P O. BOX 10848 MIDLAND, TX 7970	2	(432)689-5200	,		TUBB-DRINKARD	
Location of Well (Footage, Sec., T.,				11. Country or Parish,	State	
2310' FSL & 2310' FEL, UNIT LETTER J,	SECTION 11, T-25-S, R-37-E			LEA, NM		
12. CHEC	CK THE APPROPRIATE BO	X(ES) TO INDICATE NATU	RE OF NOTIC	E, REPORT OR OTHE	ER DATA	
TYPE OF SUBMISSION		Т	YPE OF ACT	ION		
Notice of Intent	Acıdize	Deepen	Produ	iction (Start/Resume)	Water Shut-Off	
<del></del>	Alter Casing	Fracture Treat	Recla	mation	Well Integrity	
✓ Subsequent Report	Casing Repair	New Construction	Recor	mplete *	Other	
	Change Plans	Plug and Abandon	Тетр	orarily Abandon		
Final Abandonment Notice	Convert to Injection	Plug Back	☐ Water	Disposal		
9-25-08 Tagged plug a Stand back 22	ed operations. If the operation Abandonment Notices must be refinal inspection.)  Assoc. Inc. Dig out cellar. t 4929'. Load hole w/ mud 200' tbg. Lay down rest.	e filed only after all requirement NUBOP. Well flowing back. laiden fluid. Spot 60 sxs cen	wait on stee ment at 4929	etion in a new interval, reclamation, have been o pit. RIH w/ 137 jts tbo WOC 4 hrs. Tagged	completed and the opera g. plug at 4549'.	ator has
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead \( \) Spot 115 sxs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tag Pull out of cem 9-30-08 RIH w/ tbg. Tag	ed operations. If the operation Abandonment Notices must be refinal inspection.)  Assoc. Inc. Dig out cellar. t 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loadecent. WOC 4 hrs. Tagged plug at 1769'.	n results in a multiple complet e filed only after all requirement NUBOP. Well flowing back. laiden fluid. Spot 60 sxs cent stretch and cut casing at 18 DC overnight	Wait on stee nent at 4929' 348'. Lay dow	pit. RIH w/ 137 jts tbe WOC 4 hrs. Tagged //n 7" 20# casing. NU	g. plug at 4549'.  BOP. RIH w/ tbg to 22  '. Spot 85 sxs at 1100  OC overnight.  Rig down.	ator has
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead N Spot 115 sxs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. TagPull out of cem 9-30-08 RIH w/ tbg. TagClean location.	ed operations. If the operation Abandonment Notices must be a final inspection.)  Assoc. Inc. Dig out cellar. t 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and instal	n results in a multiple complete filed only after all requirement of the filed only after all requirement of the filed only after all requirement of the filed only after all flowing back. I stretch and cut casing at 18 of the filed of the	Wait on stee nent at 4929' 348'. Lay dow	pit. RIH w/ 137 jts tbe WOC 4 hrs. Tagged //n 7" 20# casing. NU	g. plug at 4549'.  BOP. RIH w/ tbg to 22  Y. Spot 85 sxs at 1100  OC overnight.  RIG down.  FOR REC	ator has
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead. N Spot 115 sxs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tag Pull out of cem 9-30-08 RIH w/ tbg. Tag Clean location.	ed operations. If the operation Abandonment Notices must be a final inspection.)  Assoc. Inc. Dig out cellar. t 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and instal	n results in a multiple complete filed only after all requirement filed only filed filed. Spot 60 sxs centres of the filed filed only filed f	Wait on steelnent at 4929'. B48'. Lay downpot 25 sxs at tent at 973'. Froulate cemel	pit. RIH w/ 137 jts tbe. WOC 4 hrs. Tagged on 7" 20# casing. NU	g. plug at 4549'.  BOP. RIH w/ tbg to 22  '. Spot 85 sxs at 1100  OC overnight.  RIG down.	ator has
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead \( \) Spot 115 sxs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tag Pull out of cem 9-30-08 RIH w/ tbg. Tag	ed operations. If the operation Abandonment Notices must be a final inspection.)  Assoc. Inc. Dig out cellar. t 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and instal	n results in a multiple complete filed only after all requirement of the filed only after all requirement of the filed only after all requirement of the filed only after all flowing back. I stretch and cut casing at 18 of the filed of the	Wait on steelnent at 4929'. B48'. Lay downpot 25 sxs at tent at 973'. Froulate cemel	pit. RIH w/ 137 jts tb. WOC 4 hrs. Tagged // 7" 20# casing. NU 1769'. POH to 1100 Pull out of cement. WC ACCEPTE	g. plug at 4549'. BOP. RIH w/ tbg to 22  3'. Spot 85 sxs at 1100 DC overnight. Rig down: ED FOR REC	200'.
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead. N Spot 115 xs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tagendle of the standard	ed operations. If the operation Abandonment Notices must be a final inspection.)  Assoc. Inc. Dig out cellar. t 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and instal	n results in a multiple complete filed only after all requirement filed only filed filed. Spot 60 sxs centres of the filed filed only filed f	Wait on steement at 4929' B48'. Lay down pot 25 sxs at tent at 973'. Froulate cement	pit. RIH w/ 137 jts tb. WOC 4 hrs. Tagged /n 7" 20# casing. NU 1769'. POH to 1100 Pull out of cement. WC ACCEPTE	g. plug at 4549'.  BOP. RIH w/ tbg to 22  '. Spot 85 sxs at 1100  OC overnight.  RIG down.	200'.
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead. N Spot 115 xs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tagendle of the standard	ed operations. If the operation Abandonment Notices must be a final inspection.)  Assoc. Inc. Dig out cellar. It 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and install use and correct. Name (Printed/	NUBOP. Well flowing back. laiden fluid. Spot 60 sxs cen I stretch and cut casing at 10°C overnight  I hole w/ mud laiden fluid. S lug at 973°. Spot 50 sxs cem J. ND BOP. Pickup 2 jts. Ci J. dry hole marker.	Wait on steelnent at 4929'. 348'. Lay down pot 25 sxs at lent at 973'. Froulate cements at 973'. Froulate cements at 973'.	pit. RIH w/ 137 jts tb. WOC 4 hrs. Tagged /n 7" 20# casing. NU	g. plug at 4549'.  BOP. RIH w/ tbg to 22  Y. Spot 85 sxs at 1100 DC overnight.  RIG down.  T 1 2 2008  FLAND MANAGEM	200'.
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead. N Spot 115 xs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tagendle of the standard	ed operations. If the operation Abandonment Notices must be a final inspection.)  Assoc. Inc. Dig out cellar. It 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and install use and correct. Name (Printed/	NUBOP. Well flowing back. laiden fluid. Spot 60 sxs cen I stretch and cut casing at 10 occ overnight  Id hole w/ mud laiden fluid. Slug at 973'. Spot 50 sxs cen g. ND BOP. Pickup 2 jts. Cill dry hole marker.	Wait on steelnent at 4929'. 348'. Lay down pot 25 sxs at lent at 973'. Froulate cements at 973'. Froulate cements at 973'.	pit. RIH w/ 137 jts tb. WOC 4 hrs. Tagged /n 7" 20# casing. NU	g. plug at 4549'.  BOP. RIH w/ tbg to 22  Y. Spot 85 sxs at 1100  OC overnight.  FIG down.  This down.  The completed and the operation of the complete of the	200'. CORD
9-24-08 MIRU BCM & 9-25-08 Tagged plug a Stand back 22 9-26-08 ND wellhead. N Spot 115 sxs c 9-27-08 SDFWE 9-28-08 SDFWE 9-29-08 RIH w/ tbg. Tagendle of the system of the	Assoc. Inc. Dig out cellar. It 4929'. Load hole w/ mud 200' tbg. Lay down rest. Work slips out of head. Pull mt. Pull out of cement. WC gged plug at 1769'. Loaded ent. WOC 4 hrs. Tagged plug at 756'. Laydown tbg. Prepare to weld and instal ue and correct. Name (Printed/	NUBOP. Well flowing back. laiden fluid. Spot 60 sxs cent of the street o	Wait on steelnent at 4929'. 348'. Lay down pot 25 sxs at lent at 973'. Froulate cements at 973'. Froulate cements at 973'.	pit. RIH w/ 137 jts tb. WOC 4 hrs. Tagged /n 7" 20# casing. NU	g. plug at 4549'.  BOP. RIH w/ tbg to 22  Y. Spot 85 sxs at 1100  OC overnight.  RIG down.  ED FOR REC  CT 1 2 2008  FLAND MANAGEM  BAD FIELD OFFICE	200'. CORD