Form 3160-5 (August 2007)

## UNITED STATES DEPART

FORM APPROVED
OMB No 1004-0137
Expires July 31, 2010

FORM A	PPKOVED
OMB No	1004-0137
Expires Ji	alv 31, 2010

OTTI DD STITLDS	OMED
IMENT OF THE INTERIOR	OMB
IMENI OF THE INTERIOR	OCD-HOBES Serial No
	The state of the s
U OF LAND MANAGEMENT	Lease Serial No
U OF LAIND MANACEMENT	Deuse Serial Ne

DEC 0.8 ZONS	BUREAU OF LAND		· QCD-HO	Expires July 31, 2010  Expires July 31, 2010
UDB COMMI	RY NOTICES AND I	REPORTS ON WE	LLS	NM-112945
abandone	se this form for proposed well. Use Form 3160	sals to drill or to re-e -3 (APD) for such pr	nter an oposals.	6 If Indian, Allottee or Tribe Name
SUBMIT I	age 2	7 If Unit or CA/Agreement, Name and/or No		
Type of Well	<b>-</b>	•		8 Well Name and No
Name of Operator	Other			Gainer 27 #1
hompson, J Cleo	/			9 API Well No
a Address	3b	Phone No (include area coa	e)	30-25-38463
PO Box 12577, Odessa, TX 79768 432-550-8887				10 Field and Pool, or Exploratory Area
Location of Well (Footage, Sec., T.				Dickinson Devonian Penn
732' FNL & 1703' FWL		11 County or Parish, State		
- Sec. 27 - T-10-S, R-36-				Lea, NM
12. CHECK A	APPROPRIATE BOX(ES	S) TO INDICATE NA	TURE OF NOTICE, REI	PORT, OR OTHER DATA
TYPE OF SUBMISSION			TYPE OF ACTION	
	Acidize	Deepen	Production (Start/Resume	e) Water Shut-Off
Notice of Intent	Alter Casing	Fracture Treat	Reclamantion	Well Integrity
Subsequent Report	Casing Repair	New Construction	Recomplete	Other
	Change Plans	Plug and Abandon	Temporarily Abandon	
Final Abandonment Notice	Convert to Injection	Plug Back	Water Disposal	
3 Describe Proposed or Complete	ed Operation (clearly state all	pertinent details including	estimated starting date of an	y proposed work and approximate duration thereo
cement on top of CIBP. P 11/11/08 Spot 25 sx ceme Pull stretch on casing. Cu 11/12/08 Lay down 90 jts 11/13/08 Lay down rest of 11/14/08 RIH w/ tbg. Tag of cement. WOC 4 hrs. Ta 11/17/08 RIH w/ tbg. and	POH to 9115'. Spot 25 at @ 7888'. POH to 5 at casing @ 5250'. words. casing. SDFN. of casing. NU BOP RI g plug @ 030'. POH to ag plug @ 2700'. POH to ag plug @ 2747'. POH to g plug @ 2247'.	sx. POH to 7888'. 15760'. Spot 25 sx. Pork casing free. Rig (H w/ tbg. to 5300'. to 2890'. Load hole of the 2373'. Spot 45 to 575'. Spot 45	SDFN. OH w/ tbg. ND BOP of down casing jacks. SI /soit 90 sx, cement. Po w/ mud laiden fluid. So sx cement. Pull out of sx. cement. Pull out of	ull out of cement. WOC SDFN. Spot 45 sx. cement @ 2890. Pull out cement. WOC SDFN. of cement. WOC 4 hrs. Tag plug @
		ulate 25 sx. cement	from 60' to surface.	Cut off well head. Weld on Dry Hole
Marker. Rig down move	011.			Approved as to plugging of the well Liability under bond is retained until Surface restoration is completed.
14. I hereby certify that the foregoing Name (Printed Typed)	s is true and correct)	Title	Agent	APPROVED
Signature /// //////////	MUNINAN	Date	マーニー ハメ	
	TUIC CD A AP	TOD FEDERAL A	OR STATE OFFICE	
	THIS SPACE	FOR FEDERAL (	OR STATE OFFICE	USE
Approved by Conditions of approval, if any, are atta		XUH.	Title	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.