RECEIVED

Form 3160-5 (June 1990)

JAN 26 2009 UNITED STATES
DEPARTMENT OF THE INTERIOR

HOBBSONDEAU OF LAND MANAGEMENT

FORM APPROVED Budget Bureau No 1004-0135 Expires March 31,1993

5 Lease Designation and Serial No

NIMINIM 110274

OUNDDY NOTICES	INIVIINIVI-1192/4		
SUNDRY NOTICES	AND REPORTS ON WELLS	6 If Indian, Allottee or Tribe Name	
Do not use this form for proposals to de	rill or to deepen or reentry to a different reservoir.		
	OR PERMIT—" for such proposals		
USE AFFLICATION FO	on FERMIT— for such proposals		
		7 If Unit or CA, Agreement Designation	
SUBMI			
		4	
I Type of Well			
☐ Oil		8 Well Name and No	
2 Name of Operator	Peery Federal #2		
Mack E	9 API Well No		
3. Address and Telephone No			
•	30-005-00515		
P.OBox 960	10 Field and Pool, or Exploratory Area		
4 Location of Well (Footage, Sec , T R , M or Survey De	Little Lucky Lake;Morrow		
660 FSL & 1980 FEL, Sec. 29-T15S-R30E		11 County or Parish, State	
660 FSL & 1980			
	,	Chausa ND(
· · · · · · · · · · · · · · · · · · ·		Chaves, NM	
12 CHECK APPROPRIATE BOX	(s) TO INDICATE NATURE OF NOTICE, REPOR	RT, OR OTHER DATA	
TYPE OF SUBMISSION			
	57		
Notice of Intent	Abandonment	Change of Plans	
	Recompletion	New Construction	
Subsequent Report	Plugging Back	Non-Routine Fracturing	
	Casing Repair	Water Shut-Off	
Final Abandonment Notice	Altering Casing	Conversion to Injection	
	Other	Dispose Water	
		(Note Report results of multiple completion on Well	
		Completion or Recompletion Report and Log form)	
13 Describe Proposed or Completed Operations (Clearly state al	pertinent details, and give pertinent dates, including estimated date of starting cal depths for all markers and zones pertinent to this work)*	any proposed work If well is directionally drilled,	
give subsurface locations and measured and true verif	car depens for an markers and zones pertinent to this work)*		
0/20/2000 MIDIT 1: 00 1 1 1 11	1		
8/22/2008 MIRU unit 80, work pkr, could no			
8/25/2008 Rig up Rotary and free point tubin	g free @ 5215'. Cut tbg off @ 9645' and work tubing loo	se. Lay tubing down.	
8/26/2008 RIH w/6 1/8" bit and scraper. Tags		, ,	

8/26/2008 RIH w/6 1/8" bit and scraper. Tagged bottom @ 97/5', POH.
8/27/2008 Set CIBP.@ 9730', shoot 2 squeeze holes @ 7775'. RIH spot 35sx class H. RIH w/pkr and squeeze. POH.

8/28/2008 RIH w/pkr and pump 30sx H, displace to 7660', Shot 2 squeeze holes @ 6425', RIH w/pkr and pump 30sx C and displace to 6320', unset pkr and POH. Shot 2 squeeze holes @ 4378', RIH w/pkr and pump 30sx C and displace to 4260', Shot 2 squeeze holes @ 3000', RIH w/pkr and test.

8/29/2008 Pump 30sx C, displaced to 2900', Shot 2 squeeze holes @ 515', RIH w/pkr and pump 45sx C, displace to 360'. Shot 2 squeeze holes @ 65'. Tie on to 7" and pump 50sx C, no circulation, Pump 40sx C, circ. cement up 9 5/8". Install dry hole marker.

> APPROVED AS TO PLUGGING OF THIS WELL BORE. LIABILITY UNDER BOND IS RETAINED UNTIL SURFACE RESTORATION IS COMPLETED.

I hereby certify that the foregoing is true Signed wy W. S.	hendl	Title	·· Pro	oduction Clerk	Date	1/7/09
(This space for Federal or State office us	R. GLASS	ASS PETROLEUM ENGINEER		Date	JAN 2 2 2009	
Conditions of approval, if any	*	÷ , , ,		13	Date	

and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction