Submit 3 Copies To Appropriate District St.	ate of New Mexico	Form C-103
Office District I 1625 N. French Dr., Hobbs, NM 2020 C V P District II	nerals and Natural Resources	June 19, 2008 WELL API NO.
District II OIL CON	ISERVATION DIVISION	30-025-30554
District II 1301 W Grand Ave., Artesia, NM 88210 District III 1000 Rig Proper Rd. Artes NM 87410 1000 Rig Proper Rd. Artes NM 87410		5. Indicate Type of Lease STATE X FEE
1220 S St. Francis Dr , Santa Fe, NM	anta Fe, NM 87505	6. State Oil & Gas Lease No. V-0119
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		7. Lease Name or Unit Agreement Name YATES
PROPOSALS.) 1. Type of Well: Oil Well X Gas Well Other		8. Well Number 2
2. Name of Operator W. A. MONCRIEF, JR.		9. OGRID Number / 024225
3. Address of Operator		10. Pool name or Wildcat
950 COMMERCE, MONCRIEF BLDG, FORT WOL	RTH, TX 76102	LOVINGTON PENN NE
Unit Letter H : 1980 feet from the	ne NORTH line and 51	10feet from the EAST line
	nship 16S Range 37E	NMPM County LEA
	how whether DR, RKB, RT, GR, etc.	
3830KB		
12. Check Appropriate Box	x to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENTION TO	: SUE	SSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABA		
TEMPORARILY ABANDON CHANGE PLAN		ILLING OPNS. P AND A X
PULL OR ALTER CASING MULTIPLE COMPONENT DOWNHOLE COMMINGLE	MPL CASING/CEMEN	IT JOB L
OTHER: 13. Describe proposed or completed operations.	Clearly state all pertinent details, an	ad give pertinent dates, including estimated date
		ttach wellbore diagram of proposed completion
1/20/09 THRU 2/12/09		
SEE ATTACHED REPORT		
	Approved for plu Liability under b	agging of well bore only.
	of C-103 (Subsection)	quent Report of Well Plugging) und at OCD Web Page under
	Forms, www.cmn	and at OCD Web Page under urd.state.nm.us/oed.
4		
Spud Date:	Rig Release Date:	
I hereby certify that the information above is true and o	complete to the best of my knowledg	ge and belief.
Mal 12		
SIGNATURE Marla Dams	_TITLEAGENT	DATE2/17/09
Type or print nameMARLA DAVIS	_ E-mail address: _mdavis@moncr	riefoil.com PHONE:817-336-7232
For State Use Only	DIOTOIOT 4 QLUDE	DVISOD FFD A 2000
APPROVED BY: Conditions of Approval (if any):	_ _{TITLE} _ DISTRICT 1 9 UPE	RVISOR DATE FEB 2 4 2009

W. A. MONCRIEF JR. P & A REPORT YATES STATE #2 LEA CO., NM

1-20-09	MI & RU Rayco
1-21-09	FRU. PU on rods. Rods stuck w/ paraffin. W/O Hot oiler. Pump 70 bbls hot water down csg. Freed up rods. Unseated pump. PUH w/o elevators for F. G. rods. SWIFN.
1-22-09	Pump 40 bbls hot water down csg & 20 bbls down tbg. SOOH laying down rods.
1-23-09	FOOH w/ rods & pump. ND wellhead. NU BOP. PU on tbg. Work Tbg to 60k trying to release TAC. Work tbg 2 hrs. Release TAC. SOOH with tbg. Pulled 60 stands. SWIFWE.
1-26-09	FOOH w/ 359 jts tbg (tally out)
1-27-09	SD due to weather (ice)
1-28-09	GIH w/ 355 jts tbg to 11134'. RU pump. Pressure to 1000#. Tbg plugged w/ paraffin. SOOH laying down 16 jts. W/O workstring.
1-29 - 09	Lay down TTL 80 jts. PU 80 jts workstring. GIH 11138. Pump 50 bbls water. Got circulation. Mix 40 sx class H cmt & disp. POOH w/ 20 stands. SWIFN. WOC & Tag.
1-30-09	GIH w/ 14 stds. Tag cmt @ 10754'. Load hole w/ 220 bbls 9.8# brine. POOH lay down 94 jts. EOT @ 8145'. RU pump. Mix 25 sx class H Cmt & disp. POOH w/ 20 stands. SWIFWE.
2-2-09	FOOH w/ tbg. ND BOP ND Wellhead. W/O spool for BOP
2-3-09	RU csg jacks. PU on csg to 225. Couldn't remove slips. W/O welder. Weld slips to csg. PU & Remove slips. Work csg to 100k. 47" stretch FP @ 5900" NU BOP & jacks. SWIFN.
2-4-09	RU W.L. GIH w/ csg splitter to 5684 & fired. Work pipe w/ no success. GIH w/ wl & F.P. tool. Pipe free @ 5690. GIH w/ csg splitter to 5642 & fired. Pipe free. SOOH w/ csg. Jack out 22 jts. SWIFN.
2-5-09	Lay down ttl 130 jts 5 ½ csg. RU to run tbg. GIH w/ 60 stands SWIFN.

W. A. MONCRIEF JR. P & A REPORT YATES STATE #2 LEA CO., NM

2-6-09	GIH w/ 91 stands. Tag csg stub @ 5640'. Load hoe w/ 70 bbls brine. Mix 50 sx class C cmt & disp. POOH w/ 20 stands. SWIFWE.
2-9-09	GIH 19 stands Tag cmt @ 5638' RU to pump. Mix 35 sx class C cmt & disp. POOH w/ 40 jts. SWIFN. WOC.
2-10-09	GIH w/ 37 jts. Tag cmt @ 5544' LD 41 jts. EOT @ 4288' RU to pump. Mix 40 sx class C cmt. POOH w/ 20 stands. WOC SWIFN.
2-11-09	GIH w/ 19 stands. Tag cmt @ 4266 (8 5/8 shoe @ 4220) RU pump. Mix 33 sx class C cmt & disp. POOH w/ 10 stands. WOC 4 ½ hrs. GIH. Tag cmt @ 4106' Lay down 97 jts. EOT @ 1245'. Rum pump. Mix 35 sx class C cmt. PUH to 503'. Mix 35 sx class C cmt & disp. POOH WOC & tag.
2-12-09	GIH to 377' & tag cmt. POOH ND BOP GIH w/2 jts to 62'. Circ cmt to surface. Dig out cellar. Concrete on bottom. Weld plate & marker to flang 1 ½' bgl. RD Rayco.