Submit 3 Copies To Appropriate District	State of New Mexico	Form C-103
Office District I	Energy, Minerals and Natural Resou	June 19, 2008
1625 N. French Dr., Hobbs, NM 882	FIVED	WELL API NO. / 30-025-34197
District	TOU CONSERVATION DIVISI	ON 50-025-34197 5. Indicate Type of Lease
District III A DO	1 5 200 220 South St. Francis Dr. Santa Fe, NM 87505	STATE STEE
1000 Rio Brazos Rd., Aztec, NM 87410 APR District IV 1220 S St. Francis Dr., Santa Fe, NMHOB 87505	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S St. Francis Dr., Santa Fe, NMFIUD	990CD	29221
SUNDRY NOTICE	S AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSAL	S TO DRILL OR TO DEEPEN OR PLUG BACK T	
DIFFERENT RESERVOIR. USE "APPLICAT PROPOSALS.)	ION FOR PERMIT" (FORM C-101) FOR SUCH	Watson 6 #1
1. Type of Well: Oil Well Ga	s Well 🛛 Other Swp	8. Well Number 1
2. Name of Operator		9. OGRID Number 210091
DKD, LLC		10. Post over a Wildow of 10
3. Address of Operator		10. Pool name or Wildcat ろいり Upper Permo Penn
Box 682, Tatum, NM 88267		Opper remorem
4. Well Location	C . C	d 1417 feet from the W line
	Township 165 Range 36E	NMPM Lea County N. Mex
2	1. Elevation (Show whether DR, RKB, RT 974	, GR, etc.)
	714	> 1 - 1 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 -
12 Check An	propriate Box to Indicate Nature of	Notice Report or Other Data
12. Check App	oropitate box to indicate Nature of	Notice, Report of Outer Data
NOTICE OF INTE	ENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK [] F		IAL WORK 🔼 ALTERING CASING 🚨
		NCE DRILLING OPNS. P AND A
	NULTIPLE COMPL	CEMENT JOB
DOWNHOLE COMMINGLE		
	i	
OTHER:	☐ OTHER	
OTHER: 13. Describe proposed or complete	OTHER	letails, and give pertinent dates, including estimated date
13. Describe proposed or complete	ed operations. (Clearly state all pertinent of	letails, and give pertinent dates, including estimated date
13. Describe proposed or complete	ed operations. (Clearly state all pertinent of	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2	d operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completely J55 P/C Tubing	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion
 13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3 3-10-09: Run new Salta line, set 5 3 	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 1/8 J55 P/C Tubing 2 X 2 7/8 Model R Packer load with pack	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 1/8 J55 P/C Tubing 2 X 2 7/8 Model R Packer load with pack ole in casing 2840	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completed 1/8 J55 P/C Tubing 2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P.	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completely J55 P/C Tubing A X 2 7/8 Model R Packer load with pack pole in casing 2840 backed out in collar replaced casing with Retrieved	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completely 155 P/C Tubing /2 X 2 7/8 Model R Packer load with pack ple in casing 2840 backed out in collar replaced casing with Retrieved not hold.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completely J55 P/C Tubing A X 2 7/8 Model R Packer load with pack pole in casing 2840 backed out in collar replaced casing with Retrieved	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 1/2 X 2 7/8 Model R Packer load with pack to be in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 8 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 1 4-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 2 X 2 7/8 Model R Packer load with pack to be in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 2 7/8 Salta line pipe load casing, packer states.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 2 X 2 7/8 Model R Packer load with pack to be in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 2 7/8 Salta line pipe load casing, packer states.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 8 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 1 4-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string rund 4-14-09: Called OCD Maxey, Run	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing /2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new set at 10277.24, 63 ft above top perfs.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 8 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 1 4-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing /2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 ? 3-10-09: Run new Salta line, set 5 ? 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 c4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new set at 10277.24, 63 ft above top perfs.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 9 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 9-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string rund 4-14-09: Called OCD Maxey, Run	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new set at 10277.24, 63 ft above top perfs.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. I 4-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 c 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date:	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing.	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. I 4-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 c 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date:	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1.2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4-	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 9 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date: 3-9-2009	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4-	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs. 14-2009 knowledge and belief.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. I 4-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 c 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date:	od operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 J55 P/C Tubing 7/8 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4-	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 ? 3-10-09: Run new Salta line, set 5 ? 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 c 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date: 3-9-2009 I hereby certify that the information about the start of the	d operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Complete 1/8 J55 P/C Tubing 2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4- TITLE flux owner	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs. 14-2009 knowledge and belief.
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 9 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 cd 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date: 3-9-2009	d operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completed 1/8 J55 P/C Tubing 1/2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4- TITLE has owner	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs. 14-2009 knowledge and belief. DATE4-15-09 PHONE:575-398-3490
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. 14-1-09: Pressure up on casing, will 4-6-09: Shot 4 holes perf @ 2830 c 4-8-09: Drill out cement, test ok. 4-9-09 & 4-12-09: Drill out CIBP 4-13-09: Lay down work string run 4-14-09: Called OCD Maxey, Run Spud Date: 3-9-2009 I hereby certify that the information about the string run and the string run	d operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completed 1/8 J55 P/C Tubing 2/2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4- TITLE The owner TITLE The owner Titson E-mail address:	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs. 14-2009 knowledge and belief. DATE4-15-09 PHONE:575-398-3490
13. Describe proposed or complete of starting any proposed work) or recompletion. 3-9-09: Rig up pulling unit, pull 2 7 3-10-09: Run new Salta line, set 5 8 3-11-09: RIH with tubing, found he 3-16-09: Free point casing @ 2824 3-17-09-3-31-09: Fishing for B/P. Identity of the start of the second	d operations. (Clearly state all pertinent of SEE RULE 1103. For Multiple Completed 1/8 J55 P/C Tubing 1/2 X 2 7/8 Model R Packer load with pack ole in casing 2840 backed out in collar replaced casing with Retrieved not hold. irc 650 5X5 cement to sur 7 bbl to rev pit 1/2 2 7/8 Salta line pipe load casing, packer schart test, ok, Return to Disposing. Rig Release Date: 4- TITLE has owner	letails, and give pertinent dates, including estimated date stions: Attach wellbore diagram of proposed completion er fluid, fluid circ. to bradenhead N-80-17# new Set at 10277.24, 63 ft above top perfs. 14-2009 knowledge and belief. DATE4-15-09

