Submit 3 Copies To Appropriate District State of New Mexico	Form C-103
Office Energy, Minerals and Natural F	
1625 N. French Dr., Hobbs, NM 88249 District II 1301 W. Grand Ave., Artesia, NM 88210	WELL API NO. 30-025-24573
	D. Of Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 874HR 3 U ZUU9	
District IV 1220 S. St. Francis Dr., Santa FeHOBBSOCD 87505	6. State Oil & Gas Lease No. B-934
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BA DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SU	
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other	New Mexico "AB" State 8. Well Number 3
2. Name of Operator	9. OGRID Number 012024
John H. Hendrix Corporation 3. Address of Operator	10. Pool name or Wildcat
P. O. Box 3040, Midland, TX 79702-3040	Fowler – Upper Yeso
4. Well Location Unit Letter I : 2080 feet from the South line and 560 feet from the East line	
Section 16 Township 24S Ran	
11. Elevation (Show whether DR, RK	
3276' KB	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING	
	MMENCE DRILLING OPNS.□ P AND A 🛛 SING/CEMENT JOB □
OTHER: retuin-well to production D	HER:
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.	
Approved as to plugging of the Well Bore. 1. 2/20/00 MIRL POOL with a second s	
1. 3/30/09 MIRU. POOH w/tbg.	surface restoration is completed.
 2. 3/31/09 GIH w/ bit and TFF @ 5753'. 3. 4/1/09 POOH. GIH w/ pkr and tbg. Swab 100% water, no oil or gas. 	
4. 4/2/09 Cont. swab. No oil or gas. RDMO. Prep to P&A. Notify OCD of P&A and conferred w/ Buddy Hill.	
5. 4/4/09 MIRU. POOH w/ pkr.	
6. 4/6/09 Set CIBP @ 5200' w/ wireline. Dump bail 35' of cmt on top of CIBP. GIH w/tbg to 5150'. Circ csg w/ 120 bbls P&A mud (10# brine and 15#/bbl salt gel.) Spot 60 sx plug 2850-2257'. Perf 4 sqz holes @ 1117' and spot 60 sx cmt from 1120- 667'	
and attempt to sqz into holes. No pressure. POOH and WOC 2 hrs. GIH to tag and find no cmt down to 1120'. PUH to 600'	
and set pkr. Pump cmt thru perfs @ 1117' and up 8 5/8" x 5 1/2" annulus. Broke circ @ csg valve. SI csg valve and cont to	
sqz cmt and circ to surface total of 300 sx pumped. Rlsd pkr and POOH. Pump additional 40 sc and fill 5 ¹ / ₂ " csg inside and outside from 1117' to surface. OCD representative was not present, but again, conference w/ Buddy Hill.	
7. 4/9/09 Tag cmt inside 5 ¹ / ₂ " csg @ 8' BGS. Prep to attach P&A marker and clean location. P&A Schematic attached.	
	· · · · · · · · · · · · · · · · · · ·
Spud Date: Rig Release Date:	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SIGNATURE Musly Ann fay TIPLE Engineer DATE 4/22/09	
	cdoranhaynes@jhhc.org PHONE: 432-684-6631
APPROVED BY. MAY 1 2 2009	
APPROVED BY:	

.

