Submit 3 Copies To Appropriate District State of New Mexico	Form C-103
District I 1625 N. French Dr., Hobbs, NM 88240	May 27, 2004
	30-025-34761
District III 220 South St. Francis Dr.	5. Indicate Type of Lease STATE STATE
1000 R10 Brazos Rd., Aztec, NM 87410 HOBBSOC[Santa Fe, NM 87505 District IV 1220 S. St. Francis Dr, Santa Fe, NM 87505	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS	V-7020-1 7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	STATE 11
PROPOSALS) 1. Type of Well: Oil Well Gas Well Other SWD	8. Well Number 1
2. Name of Operator	9. OGRID Number 024010
V-F PETROLEUM INC.	· · · · · · · · · · · · · · · · · · ·
3. Address of OperatorP.O. BOX 1889, MIDLAND, TEXAS 79702	10. Pool name or Wildcat WEST MIDWAY – UPPER PENN
4. Well Location	
Unit Letter <u>M</u> : <u>660</u> feet from the <u>SOUTH</u> line and <u>660</u> feet from the <u>WEST</u> line Section 11 Township 17-S Range 35-E NMPM LEA County	
Section 11 Township 17-S Range 35-E 11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
3,942' GR	
Pit or Below-grade Tank Application] or Closure	
Pit typeDepth to GroundwaterDistance from nearest fresh water wellDistance from nearest surface water Pit Liner Thickness: mil Below-Grade Tank: Volumebbls; Construction Material	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT JOB Image: Comment of the comment of t	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or	
recompletion.	
02/16/09 - 02/23/09 Building road/location/install cattle guards.	
02/24/09 MI roustabout crew & welder. Cut off 13 3/8" surf csg. Install 13 3/8" x 8 5/8" WH. Weld onto 8 5/8" csg. Install 8 5/8" x 10' 900 series WH. Nipple up BOP. Move in & set reverse unit, cuttings tank. MI & rack	
11,500' 2 7/8" tbg.	
02/25/09 Clean and inspect threads on working tubing string.	
02/26/09 MIRU Basic WSU. TIH w/7 7/8", bit sub 10 4 1/8" drill clrs + 2 7/8" 8.7# PH6 tbg. Tag top of cmt at	
334'. RU power swivel. Drl cmt to 417'.	
02/27/09 Drl cmt to 1,507'. 02/28/09 Drl cmt to 1,635'.	
CONTINUED ON BACK	
I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below- grade tank has been/will be constructed or closed according to NMOCD guidelines \Box , a general permit \Box or an (attached) alternative OCD-approved plan \Box .	
SIGNATURE S.K. Lawlis TITLE Vice Reside	ent DATE 05/15/09
Type or print name E-mail address:	Telephone No. (432) 683-3344
(This space for State use)	
APPPROVED BY	DATE
Conditions of approval, if any: MAY 2 0 2009	

03/01/09 Drlg cmt to 1,730', drilling through 12 midnight on February 28, 2009. Cont drlg.

03/02/09 Drlg cmt to 1,743'.

03/03/09 TOH. TIH w/7 7/8" bit. Drl cmt to 3,145'.

03/04/09 Drl cmt to 4,566'. TOH. LD 4 ¹/₄" drl clrs & 7 7/8" bit.

03/05/09 TIH w/4 ³/₄" bit & 6 3 ¹/₂" drl clrs. Drill inside 5 ¹/₂" csg to 4,575'. TOH.

03/06/09 TIH w/4 ³/₄" concave mill. Mill on junk.

03/07/09 Mill on junk and cmt to 4,579'. TOH. TIH w/4 3/4" mill. Mill on junk & cmt to 4,600'.

03/10/09 Mill on junk & cmt to 4,850'. TOH. TIH w/4 ³/₄" bit. Drill trash & cmt.

03/11/09 Drl cmt to 6,650'. Test csg to 1,000#. No leak. Drl cmt to 6,670'.

03/12/09 Push CIBP to 7,350'. TOH. TIH w/drillable cmt retainer. Position cmt retainer at 6,650'.

03/13/09 Squeeze Blineberry perforations at 6,736' - 7,318' with 200 sxs Class "C" plus fluid lose additives followed by 150 sxs Class

"C" net cmt. Attained 4,000# standing squeeze pressure.

03/14 - 16/09 SD WOC.

03/17 - 19/09 Drl cmt & retainer. Fall thru cmt @ 7,250'. Test csg to 1,600# for 15 min. No leak. Set pkr @ 6,650'. Press test pkr & csg to 1,000#. Swb well

03/21/09 Set retainer. Press test tbg to 5,000#. Press test csg to 1,000#. Get injection rate on perf 0.75 bbls per min @ 4,300#. Mix & spot 100 sxs Class "H" cmt w/water loss additives plus 25 sxs Class "H" neat cmt to within 10 bbls of cmt retainer. Squeeze perf to 5,000# walking squeeze.

03/22 – 24/09. WOC.

03/24 - 26/09 Drill cint retainer & cmt to 7,580'. Press test csg to 1,000#, 15 min. No leak. Drill CIBP and push to 11,200'.

03/27 - 28 /09 Run GR-CBL-CCL log. TOC @ 9,000'. Perf Cisco zone 11,108'to 11,120' OA w/1 deep pen JSPF 03/29-30/09 SDFW.

03/31 - 04/01/09 Swb well, recvd wtr. Break dwn Cisco perf w/500 gallons 15% NeFe HCl acid. Pmp acid & ball job w/1,500 gallons as acid as above plus 40 ball sealers. Swb well 7 hrs. Swb well, recvd wtr.

04/02 - 04/03/09 Swb well, recvd wtr. Had trace of oil throughout day.

04/04/09 Perf 11,051' - 11,056' - 11,077' OA w/1 deep pen JSPF

04/05/09 - 06/09 SDFW.

04/07/09 Spot 500 gallons 15% NeFe HCl acid over perf 11,051'-11,077'OA.

04/08 - 09/09 Swb well, recvd wtr. Tr of oil.

04/10/09 Perf 10,976'-11,018' (OA) w/1 dp pen JSPF (11 holes). Rec 58 bbls wtr

04/11-13/09 SDF holiday.

04/14/09. Spot 500 gallons NeFe HCL acid.

04/15/09 Swb well

04/16/09 Spot 500 gallons 15% NeFe HCl acid over perf 10,976' - 11,018'. Swb well.

04/17/09 Swb well. Acidize w/1,500 gallons 15% NeFe HCl acid plus ball sealers. Swb well.

04/18/09 Swab well.

04/19-22/09 - SDFW. Swb well. Tbg became stuck. Fnd tbg stuck.

04/23 - 24/09 Run jet cutter. Cut tbg @ 4,460'. Run chemical cutter and cut tbg @ 2,800'. Jar on fish

04/25/09 Jar on fish .Latch onto fish. Fish came free. Rec 1 full jt of tbg from inside csg collapsed.

04/26/09 - 05/05/09 SDFW. Swdg out csg. 05/04/09 Notified Mark Whitaker at NMOCD of pipe running/cementing.

05/06 – 07/09 Run & set 4,416' of 5 ½'' 17# csg, N-80 & J-55. Cmt w/235 sx lite wgt cmt folwd by 335 sx prem plus. Circ 71 sx to surf. 05/08/09 Drill cmt to bttm of csg 4,416'. Test csg to 500#. No leak. Cont TIH to RBP. Circ sand off RBP. TOH. TIH w/retrieving tool for RBP. Latch onto & rel RBP. TOH. Start TIH w/retrieving tool for arrow set 1-x pkr. Run 4,000' of tbg. SWI. SDFN. 05/09/09 Latch onto & rel arrow set 1-x pkr. TOH. Make up pmpg BHA. TIH. Position SN at 8,500'. Remove BOP. Set TAC. 05/10/09 – 05/11/09 SDFW.

05/12/09 - 05/14/09 TIH w/pmp & rds. Space out rd string. Seat pmp. Ck pmp action w/WSU. Install 640 PU.