RECEIVED

JUN 10 2009



Form 2100BBSOCD UNITED STATES (April 100BBSOCD DEPARTMENT OF THE INTERIOR 100BBS

FORM APPROVED OM B No 1004-0137

BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS			Expires:	5. Lease Serial No. NM-77058	
Do not use t abandoned w	his form for proposals to drill vell. Use Form 3160-3 (APD) fo	6. If Indian, Allottee	If Indian, Allottee or Tribe Name 7. If Unit or CA/Agreement, Name and/or No.		
	RIPLICATE- Other instruction	7. If Unit or CA/Agn			
1 Type of Well Gas Well Other Swy			8. Well Name and N	· .	
Name of Operator STRATA P	RODUCTION COMPANY	9. API Well No.			
3a Address 3b. Phone No. (include area code) PO Box 1030, Roswell NM, 88202-1030 575-622-1127			30-025-18109 10. Field and Pool, or	V U V	
. Location of Well (Footage, Sec.,	T., R., M., or Survey Description)			Delaware	
821-T22S-R32E 1980' FSL & 660 FEL	/		11. County or Parish, LEA COUNTY	State	
12. CHECK A	PPROPRIATE BOX(ES) TO INDICA	TE NATURE OF NOTICE,	REPORT, OR OTHE	R DATA	
TYPE OF SUBMISSION		TYPE OF ACTION			
Notice of Intent Subsequent Report	Casing Repair New O	en Production ure Treat Reclamation Construction Recomplete und Abandon Temporarily	n	ter Shut-Off Il Integrity er Run 5 1/2" on SWD. Repair casing &	
Final Abandonment Notice Convert to Injection Plug E		 , ·		cement	
04/10/09- 04/13/09- 04/23/09- 04/24/09- 04/28/09- 05/05/09- 05/08/09- 05/09/09- Squeeze hole Drig cement 2 Tag up on fill Assemble 7 7/8" bit and TIH w/ 8 5/8" pipe @ 4688'. O5/08/09- 05/09/09- TIH w/ 5 1/2"	y for final inspection.) ase pkr. TOH. Prep to find hole in casin between 300' - 330'. Pump 100 sx CL "0 and metal. 8 5/8" casing parted @ 316'. n out top of 8 5/8" casing. Work 2 7/8" @ 2058". Wash down to 2115'. '8" string mill. Dress up top of stub. w/ over-shot mill. Clean out around man stabilizers. Clean out to 4800'. 'CIBP. Set pipe @ 4689'. TOH w/tbg. Cement w/ 760 sx 75#/Blend. Circ 71 sent float collar. Float shoe and CIBP. To Nickel coated pkr. Circ. pkr fluid. Set BLM and OCD. RD. Release equipments.	C". Circ up 11" casing. SI & tbg through casing stub. ndril. TOH. TIH w/ ret. tool. PU and GIH w/ float shoe. Flox to surface. WOC. Witness OH and lay down tools. pkr @ 4085'. Flange up. Tes	. Latch onto RBP & TOF loat collar and 114 jts 5 1/ ed by OCD.	2 17# LT&C. Set	
4 Thereby certify that the fore Name (Printed/Typed) FRANK MORG		Tide MICH PRESSER			
Signature Signature	111	Title VICE-PRESIDEN Date	05/18/2009 FPTF	D FOR RECOF	
- Jung	THIS SPACE FOR FEDER		1.00=: .=		
				J 6 2000	
onditions of approval, if any, are a	attached. Approval of this notice does not will or equitable title to those rights in the subject		Date JU	N 6 2009	
hich would entitle the applicant to	conduct operations thereon.	V /	DADENHAE	HAND MANACEMENIT	
tle 18 U.S.C. Section 1001 and Title ates any false, fictitious or fraudul	e 43 U.S.C. Section 1212, make it a crime for lent statements or representations as to any m	any person knowingly and willnater within its jurisdiction.	ally to make to any departme	nt of agency of the United AD FILLD UFFICE	