

Submit 3 Copies To Appropriate District Office	State of New Mexico	Form C-103
District I 1625 N French Dr , Hobbs, N	Energy, Minerals and Natural Resource	WELLADING
<u> </u>	OIL CONSERVATION DIVISION	30-025-37918 7
1301 W Grand Ave , Artesia, NM 88210 District III	5 2009 1220 South St. Francis Dr.	5. Indicate Type of Lease STATE FEE
1000 Kio Biazos Ku., Aziec, NW 67410	Santa Fe. NM 87505	6. State Oil & Gas Lease No.
1220 S St Francis Dr , Santa FF, 1088 87505	20CD	
SUNDRY NOTIC (DO NOT USE THIS FORM FOR PROPOSA	CES AND REPORTS ON WELLS ALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A ATION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name MONUMENT (35738)
PROPOSALS) 1. Type of Well: Oil Well C	Gas Well Other SWD	8. Well Number 001
2. Name of Operator	MENT DISPOSAL INC	9. OGRID Number 242044
3. Address of Operator		10. Pool name or Wildcat
	ANY, HOBBS NM 88240	SWD;SAN ANDRES (96121)
4. Well Location Unit Letter	2582 NORTH line and	809 EAST line V
Section 35	Township 19S Range 36E	NMPM County LEA
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		
		ACTIVATE OF THE CONTRACT OF TH
12. Check Ap	ppropriate Box to Indicate Nature of No	tice, Report or Other Data
TEMPORARILY ABANDON	PLUG AND ABANDON 🗵 REMEDIAL	E DRILLING OPNS. P AND A
OTHER:	OTHER:	
13. Describe proposed or comple	eted operations. (Clearly state all pertinent detail	ls, and give pertinent dates, including estimated date
13. Describe proposed or comple of starting any proposed work	eted operations. (Clearly state all pertinent detail	Is, and give pertinent dates, including estimated date is: Attach wellbore diagram of proposed completion
 13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pu North Monument GSA Unit) 3 Load hole with 9.5 salt base must 	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In p 300 sxs cement fill open hole interval to 5 ump additional cement as needed. (This plusted.) In the control of the cover base of Salt @ 2450' op Rustler Anhydrite @ 1093' and Ta The Oil of the cover base @ 364'. Wait and Ta	50 feet above 5 1/2 swage @ 4319'. g covers top disposal interval and base of
 13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pur North Monument GSA Unit) 3 Load hole with 9.5 salt base mure Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug 50' in/50' out 9 6 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 13 9 Set surface plug from 60-0' 	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In p 300 sxs cement fill open hole interval to 5 ump additional cement as needed. (This plusted.) In the control of the cover base of Salt @ 2450' op Rustler Anhydrite @ 1093' and Ta The Oil of the cover base @ 364'. Wait and Ta	S: Attach wellbore diagram of proposed completion 50 feet above 5 1/2 swage @ 4319'. g covers top disposal interval and base of
13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pur North Monument GSA Unit) 3 Load hole with 9.5 salt base mud Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug 50' in/50' out 9 6 Set 25 sxs plug from 2400-2300 7 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 13 9 Set surface plug from 60-0' 10 Place dry hole marker with info	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In 300 sxs cement fill open hole interval to sump additional cement as needed. (This plusted.) If (top of North Monument GSA Unit) 362. If (top of North Monument GSA Unit) 362. If (top of North Monument GSA Unit) 362. If (top of North Monument GSA Unit) 363. If (top of North Monument GS	S: Attach wellbore diagram of proposed completion 50 feet above 5 1/2 swage @ 4319'. g covers top disposal interval and base of
13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pu North Monument GSA Unit) 3 Load hole with 9.5 salt base mud Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug 50' in/50' out 9 6 Set 25 sxs plug from 2400-2300 7 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 13 9 Set surface plug from 60-0' 10 Place dry hole marker with info	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In p 300 sxs cement fill open hole interval to 5 ump additional cement as needed. (This plured. In g (top of North Monument GSA Unit) 362 In g (top of North Monument	So feet above 5 1/2 swage @ 4319'. g covers top disposal interval and base of Conservation Division Must be notified sprior to the beginning of plugging operations
13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pun North Monument GSA Unit) 3 Load hole with 9.5 salt base mud Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug from 2400-2300 7 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 139 Set surface plug from 60-0' 10 Place dry hole marker with info Spud Date:	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In p 300 sxs cement fill open hole interval to 5 ump additional cement as needed. (This plusted.) In g (top of North Monument GSA Unit) 362. In g (top of North Monument	So feet above 5 1/2 swage @ 4319'. If g covers top disposal interval and base of a conservation Division Must be notified sprior to the beginning of plugging operations wiedge and belief.
13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pur North Monument GSA Unit) 3 Load hole with 9.5 salt base mud Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug 50' in/50' out 9 6 Set 25 sxs plug from 2400-2300 7 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 13 9 Set surface plug from 60-0' 10 Place dry hole marker with info Spud Date:	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In 300 sxs cement fill open hole interval to sump additional cement as needed. (This plured.) Id. Id. Id. Id. Id. Id. Id.	So feet above 5 1/2 swage @ 4319'. If g covers top disposal interval and base of a covers top disposal interval and base of a cover top disposal interval a
13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pur North Monument GSA Unit) 3 Load hole with 9.5 salt base mud Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug 50' in/50' out 9 6 Set 25 sxs plug from 2400-2300 7 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 13 9 Set surface plug from 60-0' 10 Place dry hole marker with info Spud Date: I hereby certify that the information at SIGNATURE	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In p 300 sxs cement fill open hole interval to 5 ump additional cement as needed. (This plusted.) In g (top of North Monument GSA Unit) 362. In g (top of North Monument	So feet above 5 1/2 swage @ 4319'. If g covers top disposal interval and base of a conservation Division Must be notified sprior to the beginning of plugging operations wiedge and belief.
13. Describe proposed or comple of starting any proposed work or recompletion. 1 See attached before and after w 2 RIH with tubing and packer pum Tag cement top if necessary pur North Monument GSA Unit) 3 Load hole with 9.5 salt base mud Set 25 sxs plug @ top Grayburg 5 Set 25 sxs plug 50' in/50' out 9 6 Set 25 sxs plug from 2400-2300 7 Set 25 sxs plug 1150-1050' Top 8 Set 25 sxs plug 50' in/50' out 13 9 Set surface plug from 60-0' 10 Place dry hole marker with info Spud Date:	eted operations. (Clearly state all pertinent details). SEE RULE 1103. For Multiple Completion wellbore schematic. In 300 sxs cement fill open hole interval to sump additional cement as needed. (This plured.) Id. Id. Id. Id. Id. Id. Id.	So feet above 5 1/2 swage @ 4319'. g covers top disposal interval and base of Conservation Division Must be notified sprior to the beginning of plugging operations wledge and belief. DATE 6-9-09


PRESENT WELLBORE SCHEMATIC AND HISTORY

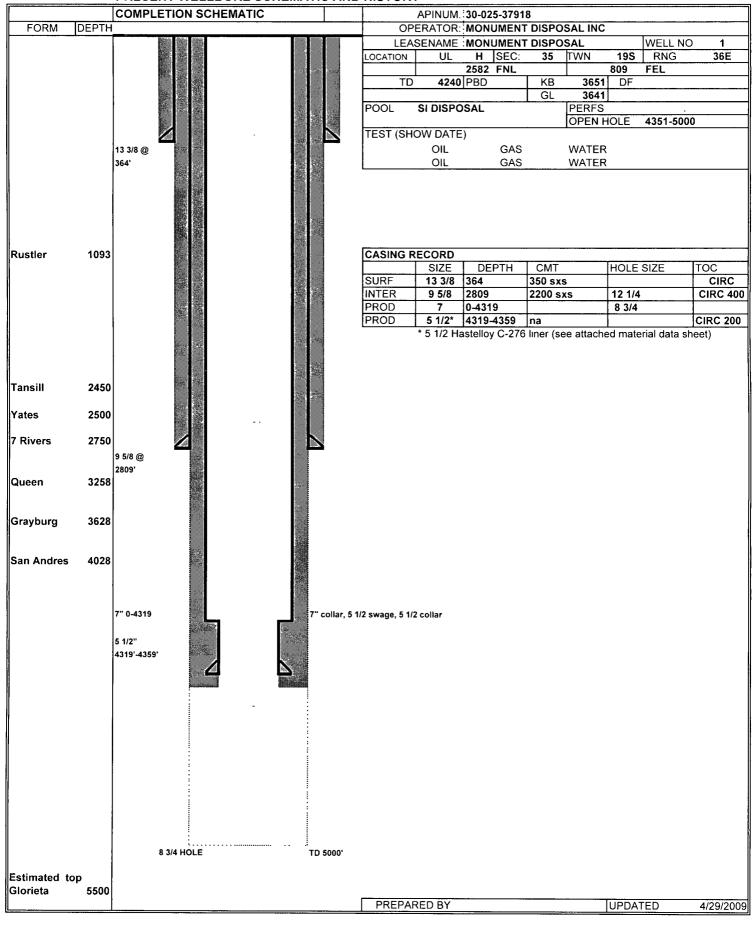

PROPOSED P&A WELLBORE SCHEMATIC AND HISTORY

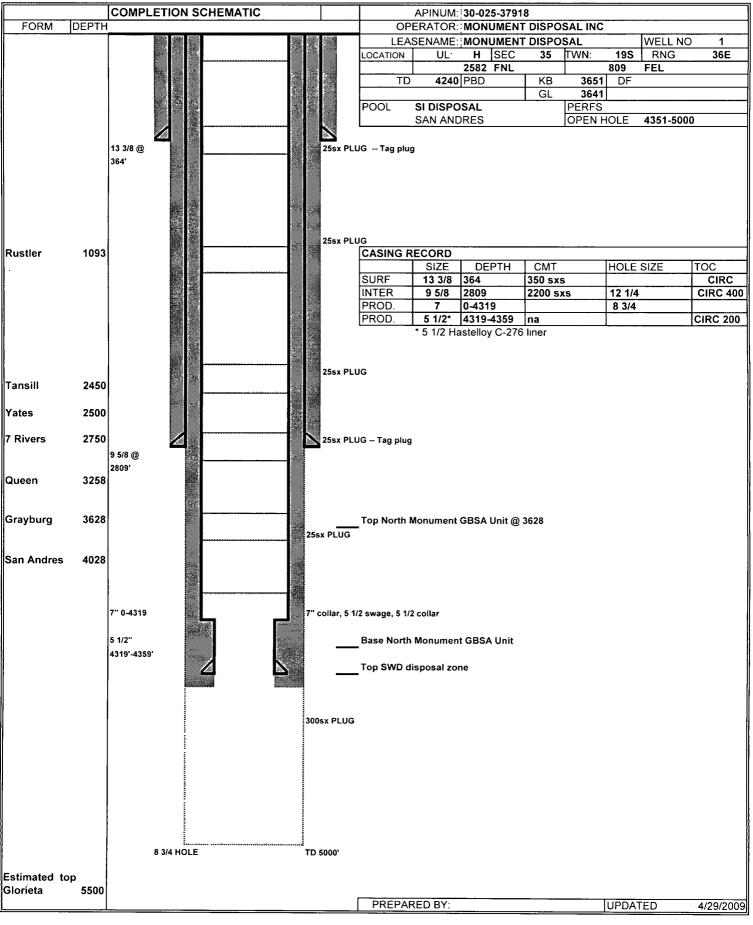



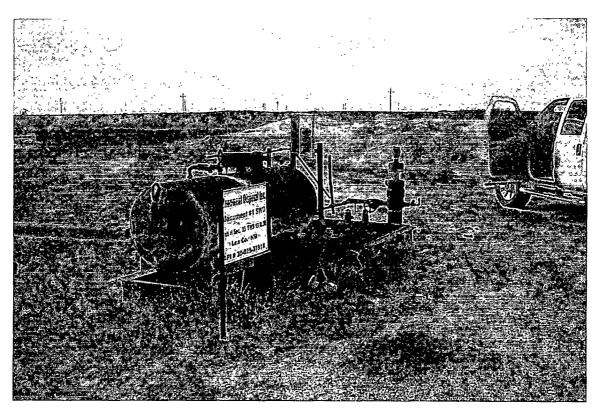

RECEIVED

JUN 15 2009 HOBBSOCD

NMOCD

ATTN: Maxey Brown 1625 N. French Drive Hobbs, NM 88240

RE: Monument Disposal Inc.

Violation Letter

Mr. Brown:

I am in receipt of the "Letter of Violation". A new well sign has been installed at well site. Photos of sign are attached.

Within is a C-103 for the proposed plugging of the listed well. When approval is received, we will proceed with getting AFE's and bids for the proposed work, and will proceed in a timely manner.

We apologize for the inconvenience. If you need anything further, please contact me.

Sincerely,

Kenneth Marsh

356 Blue Harron Dr.

Port Aransas, TX 78373

575-631-6979