Submit 3 Copies To App Office	ropriate District	State of New Mexico Minerals and Natural Res	Ources	Form C-103 June 19, 2008
1625 N French Dr., Hob	RECEIVED	,	WELL API	NO.30-005-10455
1301 W Grand Ave, Ar	tesia, NM 88HUN 1 Y 70Hb C	ONSERVATION DIVIS	SION 5 Indicate	Type of Lease
1000 Rio Brazos Rd , Az	teo, NMMOBBSOCD 12	220 South St. Francis Dr Santa Fe, NM 87505	· STA	TE X FEE
1220 S. St. Francis Dr , S		Sama 1 e, INNI 67505	6. State Of	l & Gas Lease No
87505 S	UNDRY NOTICES AND RE	PORTS ON WELLS	7. Lease N	ame or Unit Agreement Name
	DRM FOR PROPOSALS TO DRILL DIR USE "APPLICATION FOR PER			San Andres Unit
PROPOSALS.) 1. Type of Well C	_	• • • • • • • • • • • • • • • • • • • •	8. Well Nu	mber 49
2 Name of Operato	or		9 OGRID	Number 248802
	o Of New Mexico,	Inc.		ime or Wildcat
3. Address of Oper	ator Str Suite 3200 Unit	25 Fort Worth, TX 7		co; San Andres
4. Well Location				
Unit Letter				eet from the West line
Section		wnship 8S Range	30E NMPM	County Chaves
	11 Elevation	n (Show whether DR, RKB, F	RT, GR, etc.)	the transfer of the state of th
		GL 4143		
	12. Check Appropriate I	Box to Indicate Nature o	of Notice, Report or C	Other Data
NO	TICE OF INTENTION	то: І	SUBSEQUENT	Γ REPORT OF:
PERFORM REMED	OIAL WORK D PLUG AND	ABANDON 🗆 REME	DIAL WORK	☐ ALTERING CASING ☐
TEMPORARILY AB		_	MENCE DRILLING OPNS	B P AND A
PULL OR ALTER C DOWNHOLE COM		CASII	NG/CEMENT JOB	L
OTHER			P. Convert to	injection / M
OTHER 13. Describe pro	oposed or completed operation	OTHE		injection 🔀
13. Describe pro of starting a	ny proposed work). SEE RUL	s. (Clearly state all pertinen	t details, and give pertine	
13. Describe pro of starting a or recomple	ny proposed work). SEE RUL tion	is. (Clearly state all pertinen LE 1103. For Multiple Comp	t details, and give pertine eletions. Attach wellbore	ent dates, including estimated date
13. Describe pro of starting a or recomple 9/22/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT.	is. (Clearly state all pertinen "E 1103. For Multiple Comp PULLED RODS, PUM	t details, and give pertine pletions. Attach wellbore	ent dates, including estimated date
13. Describe pro of starting a or recomple 9/22/08 9/23/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON	is. (Clearly state all pertinen LE 1103. For Multiple Comp PULLED RODS, PUM E BIT AND CLEANED	t details, and give pertine oletions. Attach wellbore AND TUBING OUT TD (3555')	nt dates, including estimated date diagram of proposed completion
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT.	is. (Clearly state all pertinen E 1103. For Multiple Comp PULLED RODS, PUM E BIT AND CLEANED -55 FLUSH JT LINE	t details, and give pertine oletions. Attach wellbore P, AND TUBING OUT TD (3555') R FROM SURFACE	ent dates, including estimated date e diagram of proposed completion
13. Describe pro of starting a or recomple 9/22/08 9/23/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J	is. (Clearly state all pertinen E 1103. For Multiple Comp PULLED RODS, PUM E BIT AND CLEANED -55 FLUSH JT LINE 50/50 Poz AND 20	t details, and give pertine oletions. Attach wellbore P, AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO	ent dates, including estimated date e diagram of proposed completion
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN	is. (Clearly state all pertinen E 1103. For Multiple Comp PULLED RODS, PUM E BIT AND CLEANED -55 FLUSH JT LINE 50/50 Poz AND 200 DRES: 3414-3465	t details, and give pertine oletions. Attach wellbore P, AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO	ent dates, including estimated date e diagram of proposed completion
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX	is. (Clearly state all pertinent. E 1103. For Multiple Computer PULLED RODS, PUMPE BIT AND CLEANED -55 FLUSH JT LINES 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 28	t details, and give pertine oletions. Attach wellbore P, AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S	nt dates, including estimated date diagram of proposed completion TO TD. DC. SPF
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR	IS. (Clearly state all pertinent. E 1103. For Multiple Composition Pulled RODS, Pumble BIT AND CLEANED -55 FLUSH JT LINES 50/50 Poz AND 200 DRES: 3414-3465 Pos W/ 6,000 GAL 280 L TITE TUBING AND	t details, and give pertine oletions. Attach wellbore P, AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PAC	ent dates, including estimated date of diagram of proposed completion of TD. TO TD. DC. SPF CKER @ 3320'
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA	IS. (Clearly state all pertinent. E 1103. For Multiple Composition Pulled RODS, PUMP E BIT AND CLEANED -55 FLUSH JT LINES 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 281 L TITE TUBING AND FRESH WATER AND 1	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PACE PERFORMED MIT. N	ent dates, including estimated date of diagram of proposed completion of TD. TO TD. DC. SPF CKER @ 3320'
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W	IS. (Clearly state all pertinent. E 1103. For Multiple Composition Pulled RODS, PUMP E BIT AND CLEANED -55 FLUSH JT LINES 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 281 L TITE TUBING AND FRESH WATER AND 1	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PACE PERFORMED MIT. N	ent dates, including estimated date of diagram of proposed completion of TD. TO TD. DC. SPF CKER @ 3320'
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W	is. (Clearly state all pertinen E 1103. For Multiple Comp PULLED RODS, PUM E BIT AND CLEANED -55 FLUSH JT LINE 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 283 L TITE TUBING AND /FRESH WATER AND ECTION INTO SAN AI	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PACE PERFORMED MIT. N	ent dates, including estimated date of diagram of proposed completion of TD. TO TD. DC. SPF CKER @ 3320'
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W	IS. (Clearly state all pertinent. E 1103. For Multiple Composition Pulled RODS, PUMP E BIT AND CLEANED -55 FLUSH JT LINES 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 281 L TITE TUBING AND FRESH WATER AND 1	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PACE PERFORMED MIT. N	ont dates, including estimated date diagram of proposed completion TO TD. DC. SPF CKER @ 3320' MIT PASSED - 3 4
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W	is. (Clearly state all pertinen E 1103. For Multiple Comp PULLED RODS, PUM E BIT AND CLEANED -55 FLUSH JT LINE 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 283 L TITE TUBING AND /FRESH WATER AND ECTION INTO SAN AI	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PACE PERFORMED MIT. N	ont dates, including estimated date diagram of proposed completion TO TD. DC. SPF CKER @ 3320' MIT PASSED - 3 4
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08 12/4/08 Spud Date.	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W	is. (Clearly state all pertinent. E 1103. For Multiple Comp. E 1103. For Multiple Comp. PULLED RODS, PUM. E BIT AND CLEANED -55 FLUSH JT LINE. 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 285' L TITE TUBING AND FRESH WATER AND DECTION INTO SAN AI	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 STORES. PERFORMED MIT. MORES. TPI	ont dates, including estimated date diagram of proposed completion TO TD. DC. SPF CKER @ 3320' MIT PASSED - 3 4
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08 12/4/08 Spud Date.	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W STARTED WATER INJ	is. (Clearly state all pertinent. E 1103. For Multiple Comp. E 1103. For Multiple Comp. PULLED RODS, PUM. E BIT AND CLEANED -55 FLUSH JT LINE. 50/50 Poz AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 288 L TITE TUBING AND FRESH WATER AND DECTION INTO SAN ALL Rig Release Date	t details, and give pertine oletions. Attach wellbore P., AND TUBING OUT TD (3555') R FROM SURFACE TO SX CLASS C. WO 3492-3539' 4 S HCI PACKER. SET PACE PERFORMED MIT. MORES.	ont dates, including estimated date diagram of proposed completion TO TD. DC. SPF CKER @ 3320' MIT PASSED - 3 4
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08 12/4/08 Spud Date.	ny proposed work). SEE RULtion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W STARTED WATER INJ he information above is true an	S. (Clearly state all pertinent. E 1103. For Multiple Comp. E 1103. For Multiple Comp. E 1103. For Multiple Comp. PULLED RODS, PUM. E BIT AND CLEANED -55 FLUSH JT LINE. 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 285' ES W/ 6,000 GAL	t details, and give pertine oletions. Attach wellbore oletions. Attach wellbore of the pertine oletions. Attach wellbore of the pertine oletions. Attach wellbore oletions. Attach wellbore old oletions. Attach wellbore oletions of the pertine oletions olet	TO TD. CC. SPF CKER @ 3320' MIT PASSED - 3 Q DATE 6/4/09 6-25
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08 Spud Date. I hereby certify that to SIGNATURE Type or print name	ny proposed work). SEE RUL tion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN AN ACIDIZED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W STARTED WATER INJ	is. (Clearly state all pertinent. E 1103. For Multiple Comp. E 1103. For Multiple Comp. PULLED RODS, PUM. E BIT AND CLEANED -55 FLUSH JT LINE. 50/50 Poz AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 288 L TITE TUBING AND FRESH WATER AND DECTION INTO SAN ALL Rig Release Date	t details, and give pertine oletions. Attach wellbore oletions. Attach wellbore of the pertine oletions. Attach wellbore of the pertine oletions. Attach wellbore oletions. Attach wellbore old oletions. Attach wellbore oletions of the pertine oletions olet	TO TD. CC. SPF CKER @ 3320' MIT PASSED - 3 Q Well Perfect aut of zone 70 TO. 20 TO.
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08 Spud Date. I hereby certify that the SIGNATURE	ny proposed work). SEE RULtion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W STARTED WATER INJ he information above is true an	S. (Clearly state all pertinent. E 1103. For Multiple Comp. E 1103. For Multiple Comp. E 1103. For Multiple Comp. PULLED RODS, PUM. E BIT AND CLEANED -55 FLUSH JT LINE. 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 285' ES W/ 6,000 GAL	t details, and give pertine oletions. Attach wellbore oletions. Attach wellbore of the pertine oletions. Attach wellbore of the pertine oletions. Attach wellbore oletions. Attach wellbore old oletions. Attach wellbore oletions of the pertine oletions olet	TO TD. CC. SPF CKER @ 3320' MIT PASSED - 3 Q DATE 6/4/09 6-25
13. Describe pro of starting a or recomple 9/22/08 9/23/08 9/24/08 9/25/08 10/15/08 11/6/08 12/3/08 Spud Date. I hereby certify that to SIGNATURE Type or print name	ny proposed work). SEE RULtion MIRU PULLIN UNIT. TIH w/ 3-3/4" CON RAN 3-1/2" 9.3# J CEMENTED W/200 SX PERFORATED SAN ANDR RIH W/2-1/16" SEA LOADED BACKSIDE W STARTED WATER INJ The information above is true and the control of the control	S. (Clearly state all pertinent. E 1103. For Multiple Comp. E 1103. For Multiple Comp. E 1103. For Multiple Comp. PULLED RODS, PUM. E BIT AND CLEANED -55 FLUSH JT LINE. 50/50 POZ AND 200 DRES: 3414-3465' ES W/ 6,000 GAL 288 L TITE TUBING AND /FRESH WATER AND DECTION INTO SAN ALL RIG Release Date. RIG Release Date TITLE Regulatory. E-mail address: Cind.	t details, and give pertine oletions. Attach wellbore oletions. Attach wellbore of the pertine oletions. Attach wellbore of the pertine oletions. Attach wellbore oletions. Attach wellbore old oletions. Attach wellbore oletions of the pertine oletions olet	TO TD. CC. SPF CKER @ 3320' MIT PASSED - 3 Q DATE 6/4/09 6-25

