RECENSE	
Submit 3 Copies To Appropriate District State of New Mexico Office	Form C-103 June 19, 2008
Office District I 1625 N French Dr., Hobbs, NM 88240 00) 2 2 20 Energy, Minerals and Natural Resources	WELL API NO.
District II HOBBSOCOIL CONSERVATION DIVISION	30-025-24159 V 5. Indicate Type of Lease
District III 1000 Rio Brazos Rd, Aztec, NM 87410 District IV Santa Fe, NM 87505	STATE FEE
District IV 1220 S St Francis Dr., Santa Fe, NM	6. State Oil & Gas Lease No. B-934
87505 SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS )	New Mexico "M" State 8. Well Number 61
1. Type of Well: Oil Well   Gas Well   Other     2. Name of Operator   Image: Constraint of Constraints	9. OGRID Number 61
GP II Energy, Inc.	8359 🗸
3. Address of Operator PO Box 50682, Midland, TX 79710	10. Pool name or Wildcat
4. Well Location	
Unit Letter F : 1340 feet from the North line and	1340 feet from the West line
Section         29         Township         22S         Range         37E           11. Elevation (Show whether DR, RKB, RT, GR, etc.)         11. Elevation (Show whether DR, RKB, RT, GR, etc.)         11. Elevation (Show whether DR, RKB, RT, GR, etc.)	NMPM County Lea
3376' GL	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON IN REMEDIAL WORK ALTERING CASING	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS P AND A	
PULL OR ALTER CASING DIMULTIPLE COMPL CASING/CEMEN	Т ЈОВ
	······································
OTHER OTHER:	d give pertinent dates including estimated date
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.	
See attached procedure.	
	ified operations DE CORRECTIONS WIS
SEE ADDITIONS	
The Oil Conservation Division Must be notified DR CORPECT LEVE	
24 hours prior to the beginning of plugging operations	
	Y reasons .
Spud Date: Rig Release Date:	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SIGNATURE Agent DATE 10-20-2009	
SIGNATURE     Agent     DATE     10-20-2009       Type or print name     Use Compton     E-mail address:     compton@gp2energy.com     PHONE:     432-684-4748	
For State Use Only A to the second se	
APPROVED BY: Maley Strown Fitle Compliance Office Date 10/23/2009	
Conditions of Approval (if any):	

1. RUPU.

2. Install and test BOP.

3. GIH with tubing and packer. Pressure up backside to 500# for 15' to check tubing - casing integrity. If no leaks are found, TOH with Packer. Casing leaks are common in this area from 300' to 700'. If leaks are found, note their location and TOH with tubing and packer.

3425' 4. GIH with wire line CIBP and set at approximately 3525'. GIH with bailer and dump 35' cement on CIBP. WOC. PU and circulate hole with plugging mud. TOH. GIH and perforate casing at ~2400'. Squeeze perforations with 25 sx. WOC and tag plug. TOH with tubing. GIH and perforate top of salt @ 1240'. GIH with tubing and packer. Squeeze perforations with 25 sx. WOC and tag plug.

5. Perforate and squeeze at 350'. PU and pump 100'+ cement plug across 8 5/8" shoe, sufficient to bring plug 50'+ above top of shoe and 50'+ below 8 5/8" casing shoe. PU and WOC.

Perf @ 60'. CIRC CMT TO SURFACE.

6. Tag plug set across 8 5/8" shoe. PU and set surface plug.

7. Cut off casing and set dry hole marker.

8. Clean and remeditate location.

Note: The NMOCD will be notified at least 24 hours before starting work on well.

