Submit 3 Copies To Appropriat	te District							F	Form C-103
Office							LNO		June 19, 2008
<u>District I</u> 1625 N. French Dr. Hobbs, NM 88240						WELL API NO.			
1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Ave. Adecia NM 6040 P. T. CONSERVATION DIVISION						30-025-24082 / 5. Indicate Type of Lease			
District III									
1000 Rio Brazos Rd. Aztec, NM 87410 NV 1 3 2000 1220 South St. Francis Dr.						STATE FEE 6. State Oil & Gas Lease NO.			
District IV 1220 S. St. Francis Dr., Santa Fe, NOBBSOCD 87505 Santa Fe, NM 87505									
						A-1543-1			
SUNDRY NOTICES AND REPORTS ON WELLS							Name or Uni	-	1
(DON NOT USE THIS FORM FOR PROPOSALS TO DRILL OR DEEPEN OR PLUG BACK TO									
A DIFFERENT RESERVIOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH						Andres Unit Blk/3			
PROPOSALS.) 1. Type of Well: Oil Well						8. Well Number			
1. Type of Well: Oil Well Gas Well Other W						9 OGRID Numer			
Apache Corporation						0.001110	TTG///O	873	✓
3. Address of Operator						10. Pool Name			
6120 S. Yale, Ste. 1500 Tulsa, OK 74136						WSW-San Andres			
4. Well Location	•	4050		0 4 -		000		F4	. /
Unit Letter Section	1 : 17	1650 Township	feet from the 19S	South Range	line and 37E	990 NMPM	feet from th	East County	line Lea
Cection	 		how whether			141AIL 1AI	1	*, 33 3	
S. C. S.								Alternative States	
12. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data									
Ni	OTICE OF INTE	NTION TO	١.	•		CLIDGEO	HENT DED	OPT OF	-
NOTICE OF INTENTION TO:						SUBSEQUENT REPORT OF:			
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL TEMPORARILY ABANDON CHANGE PLANS COMMENCE								=	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE PULL OR ALTER CASING MULTIPLE COMPL CASING/CI							=	╡	
							D [
DOWNHOLE COMMINGLE ALTERING P AND A						CASING	L F	긁	
OTHER:									
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of									
starting any proposed work.) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram or proposed completion or									
recompletion.									
Apache Corporation plugged and abandoned by the attached well report.									
				ŕ÷	Approved for pl	u zalez a zad manii	l hara only		
•				14	Approved for pl Liability under	ugging of well sand is rotain	ed pending rece	ipt	
				1,	sFC-jo3 (Subse	auent Report	of Well Pluggir	ng)	
				1,	which may be fi	fund at OCD	Web Page unde	r	
				[1	Forms, www.cm	ned,state.nm.	ni/ocq.		
				D: 5 !	5 4				
Spud Date:				Rig Releas	se Date:	L			
•									
I horoby posific that the informa-	ation above is tweet	ad accomplete	io the best of	ماريو معايد	mal ballat			· · · · · · · · · · · · · · · · · · ·	
I hereby certify that the informa	ation above is true ar	na complete	to the best of m	y knowledge a	and belief.				
SIGNATURE	Duran	Bush	TITLE	Recla	mation Fore	aman	DATE	11/-	11/09
J. J. W. (1 Of the	XXIIII WY 1	عاديب.	III berbun	I VECIA	madon i Ole	2111GH	<i></i>	1 17	11103
Type or print name	Guinn Bu	ırks .	E-mail add.	guinn.burk	s@apache	corp.com	PHONE:	432-5	56-9143
For State Use Only	1	11/	M						
APPROVED BY:	Tarns M	1. Llis	TITLE	DISTRIC	it a supp		PA DATE	WOA	1 6 2009
Conditions of Approval (ii		177				·	· · · · -	····	
	U								

NORTH MONUMENT GRAYBURG SAN ANDRES UNIT 309SW API# 30-025-24082

8-18-09 BASIC ENERGY SERVICES MIRU, ND WH, NU B.O.P. SDFN.

8-19-09 CREW TO LOC. RIH W/ 2-3/8" TBG. COULD NOT GET PAST 2100', POOH W/ TBG. & RIH W/ MILL SHOE. COULD NOT GET DOWN. POOH W/ 2-3/8" TBG. LAYING IT DOWN. PICK UP 2-7/8" WORKSTRING & 6-1/8" BIT, RIH TO TOP OF B.S., PUMPED 100 BBLS. BRINE WATER, DID NOT GET CIRCULATION. PUH AND SDFN.

8-20-09 CREW TO LOC. DRILL OUT SALT RING @ 2100', RIH TO 2255', LOST CIRC. & WELL STARTED TO GAS. TRY TO KILL WELL W/ 200 BBLS. BRINE DOWN THE TBG. & 250 BBLS. DOWN THE 8-5/8" CSG. COULD NOT KILL WELL. PUH 6 JOINTS. SHUT DOWN & LEAVE WELL OPEN TO PIT OVER NIGHT. SDFN.

08-21-09 CREW TO LOC. OPEN WELL. HOOK UP PUMP ON 8-5/8" CSG. PUMP 200 BBLS. BRINE, 1-1/2 BPM, WELL & TBG. PRESSURED UP TO 400 PSI. BLED DOWN WELL, HOOKED UP PUMP TO TBG. PUMP 100 BBLS. 1-1/2 BPM. COULD NOT LOAD HOLE. CONTINUE DRILLING @ 2255'. DRILLED DOWN TO 2360', COULD NOT GET PAST 2360', STD. BACK 5 STANDS. CLOSE WELL IN. SDFN.

08-24-09 CREW TO LOC. WELL STILL BLOWING. BLED DOWN WELL. PUMPED 10 BBLS. BRINE. STARTED OUT OF HOLE W/TBG. STARTED BLOWING GAS. PUMPED 10 BBLS. BRINE. POOH W/TBG. LEFT BIT & SUB WITH 2-1/2 JTS. IN HOLE. TBG. SEEMED TO HAVE CLEAN BREAK. WELL GASSING REALLY BAD. PUMPED 100 BBLS. BRINE DOWN 8-5/8" CSG. SLOWED DOWN, BUT STARTED BLOWING AGAIN. SDFN. GUINN BURKS CALLED IN ASI SAFETY FOR GAS PROTECTION.

8-25-09 CREW TO LOC. BLED DOWN WELL. FIT TEST CREW FOR BREATHING APP. WORK UNDER AIR CASCADES, RIH W/OVERSHOT W/ 35 STDS. PUMPED 75 BBLS. FRESH WATER, RIH W/ 1 JT. OVER FISH. LATCHED ONTO FISH. POOH. NO FISH. RUN BACK IN HOLE. WORKED ON LATCHING ONTO FISH. SEEMED TO LATCH, BUT TURNED LOOSE. PUMPED REMAINING FRESH WATER. POOH. STAND BACK TBG. LAY DOWN OVERSHOT. DETERMINED CSG. HAD COLLAPSED. PICKED UP AND STORED EQUIPMENT. LEFT WELL OPEN TO PIT. SDFN.

08/26/09 CREW TO LOC. BLED DOWN WELL. RD SWIVEL & REVERSE UT. RU CASCADES. RIH W/ PKR. W/ 34-1/2 STDS. @ 2180'. WORK PKR, COULD NOT SET. RUN DOWN TO 2212', WORK PKR. COULD NOT SET. POOH W/ PKR. STAND BACK TBG. CALL IN 9" B.O.P. STAND BY. WILL GET B.O.P. IN THE A.M. SHUT IN. SDFN.

08/27/09 CREW TO LOC. ND 6" B.O.P, NU 10" B.O.P. BLOW DOWN WELL, KILLED WELL. RIH W/ 14 STDS. & 8-3/4" BIT. SDFN.

08/28/09 CREW TO LOC. RIG UP PUMP. KILL WELL. RIH W/ BIT TO 2060', SET DOWN, KILL WELL. START OUT OF HOLE W/ TBG. & BIT. PULLED 10 STDS. KILL WELL. HOLE FULL, COULD NOT KILL WELL. 7 STDS. & BIT STILL IN HOLE. CLOSED WELL IN. SDFN.

08-31-09 CREW TO LOC. BLOW DOWN WELL UNTIL 12:00 P.M. POOH W/ TBG. & BIT. RIH 8-5/8" PKR. TO 1805', SET MONITOR, WELL HAS HOLES COMING FROM BELOW PKR. SQZ. 110 SX CLASS "C" CMT. DISPLACED TO 2700', CLOSED WELL IN. SDFN.

09/01/09 CREW TO LOC. WELL WAS PRESSURED UP TO 250 PSI. BACK SIDE HAD 50 PSI. RESET 8-5/8" PKR. @ 1805'. PUMPED 20 BBLS. WATER, WELL WENT ON VAC. AND SUCKED 20 BBLS. BRINE DOWN. CALLED GUINN BURKS AND HE OKAYED 20 BBLS. LOST CIRC. WAITED 30 MIN. & PUMPED 200 SX CLASS "C" CMT. ON DISPLACEMENT. WELL ON VAC. SDFN.

09/02/09 CREW TO LOC. CHECKED WELL, 400 PSI ON TBG. 0 PSI ON BACKSIDE. PUMP 10 BBLS. BRINE IN WELL. 400 PSI TO VAC. CALLED GUINN BURKS, SAID PUMP 50 BBLS. LCM & 100 SX CLASS "C" CMT. CALLED MARK WHITAKER W/ OCD, SAID OKAY TO PUMP. MIX UP 50 BBLS. LCM & PUMPED. MIX 100 SX CLASS "C" CMT. PUMPED DOWN HOLE AND WENT ON VAC. SUCKED 45 BBLS., DISPLACMENT DOWN. SHUT IN WELL. WAIT UNTIL 2:30 P.M. & TEST, 350 PSI, PUMPED 12 BBLS. & WENT ON VAC. CALLED GUINN BURKS & HE OKAYED TO PUMP 150 SX CLASS "C" CMT. MIXED AND PUMPED THE 150 SX AND DISPLACED 50 BBLS. SDFN.

09/03/09 CREW TO LOC. WELL HAD 250 PSI ON TBG. PUMPED 10 BBLS. BRINE IN WELL, 250 PSI TO VAC. CALLED GUINN BURKS, HE OKAYED TO PUMP 50 BBLS. LCM & 100 SX. CLASS "C" CMT. CALLED MARK

WHITAKER W/ OCD AND HE OKAYED ALSO. MIXED UP 50 BBLS. LCM & 100 SX CLASS "C" CMT. & 2% CAL. CHLORIDE. & PUMPED DOWN HOLE. WAITED UNTIL 2:15 P.M. OPENED UP WELL, 400 PSI, PUMPED 10 BBLS. AND WENT ON VAC. CALLED GUINN BURKS AND HE SAID TO PUMP 50 BBLS. LCM & 150 SX CLASS "C" CMT. MIXED UP 50 BBLS. LCM & 150 SX CLASS "C" CMT. & 2% CAL. CHLORIDE AND PUMPED INTO WELL. STILL ON VAC. SDFN.

09-06-09 CREW TO LOC. WELL HAD 400 PSI ON IT. 408 PSI TO VAC. CALLED GUINN BURKS, HE OKAYED TO PUMP 50 SX CMT. W/ LCM & 100 SX "C" NEAT. PUMPED 50 SX CMT. W/ LCM & 100 SX "C" NEAT. WELL ON VAC. SI AND WAITED UNTIL 1:30 P.M. & OPENED WELL, 400 PSI, CALLED GUINN BURKS AND HE OKAYED TO PUMP SAME AS THIS MORNING. PUMPED 50 SX CMT. W/ LCM & 100 SX "C" NEAT. WASHED UP. SDFN.

09-08-09 CREW TO LOC. MIXED LCM & SQZ. 200 SX. WOC 4 HRS. CHECK TBG., HAD 425 PSI. PUMPED INTO TBG. GOT A PIR. MIXED LCM & SQZ. 150 SX. SI AND SDFN.

09-09-09 CREW TO LOC. BLED OFF WELL, 325 PSI. SQZ. 50 SX CLASS "C" CMT. W/ 2% CAL. & LCM. WOC 2 HRS. BLED OFF WELL, 275 PSI. SQZ. 50 SX CLASS "C" CMT. W/ 2% CAL. & LCM. SI. SDFN.

09-10-09 CREW TO LOC. RU PUMP, KILL WELL, GET A PIR. SQZ. 400 SX CMT. SI W/ 200 PSI. & SDFN.

09-11-09 CREW TO LOC. BLED OFF WELL, GOT A PIR. SQZ. 100 SX CMT. W/ CALC. & LCM, WOC 4 HRS. BLED OFF WELL 325 PSI. GOT A PIR. SQZ. 200 SX CMT. W/ CALC. & LCM. SI. SDFN.

09-14-09 CREW TO LOC. BLED OFF WELL, 350 PSI. GET A PIR. SQZ. 100 SX CMT., WOC 4 HRS. CHECK WELL PRESSURE, 325 PSI. WAIT ON PRESSURE PUMPING & LOAD BACKSIDE. SI. SDFN.

NOTE: GUINN BURKS CALLED BUDDY HILL AND WAS AUTHORIZED TO TRY PUMPING THIXATROPIC CMT FOLLOWED BY NEAT CMT AND DISPLACE TO 2700'.

09-15-09 CREW TO LOC. RU PUMP, LOAD BACKSIDE, RU PRESSURE PUMP ON 2-7/8" TBG. SQZ. 300 SX THIXATROPIC CMT. @ 5 BPM W/ 150 PSI. FOLLOWED W/ 200 SX CLASS "C" CMT. DISPLACED CMT. DOWN TO 1950', SI. SDFN.

09-16-09 CREW TO LOC. CHECK PRESSURE ON WELL, 300 PSI. BLED IT OFF. RU PUMP, PUMPED 30 BBLS. BRINE DOWN THE TBG. NO PRESSURE. WAIT ON PRESSURE PUMP. RU PUMP & SQZ. 300 SX THIXATROPIC CMT. 150 PSI. @ 4 BPM. SI. SDFN.

09-17-09 CREW TO LOC. CHECKED PRESSURE, WELL HAD 400 PSI, BLED OFF WELL, GET A PIR OF 4 BPM, NO PRESSURE. SI. SDFN.

NOTE: GUINN BURKS CALLED AND SPOKE WITH BUDDY HILL AND WAS AUTHORIZED TO PUMP A POLY PLUG, FOLLOWED BY NEAT CMT TO 2700'.

09-18-09 CREW TO LOC. RU & MIXED 40 SX. POLYMER W/ 8 SX. LCM. PUMPED DOWN HOLE @ 3 BPM, 400 PSI, DISPLACED 5 BBLS. OF FRESH WATER, PUMPED 200 SX. CLASS "C" CMT. W/ FLOWSEAL. PUMPED 195 SX OF CLASS "C" CMT. W/ 2% CAL. CHLORIDE. DISPLACED TO 2700'. SI. SDFN.

09-21-09 CREW TO LOC. CHECK WELL PRESSURE, 350 PSI. COMPANY SUPERVISOR DECIDED TO TRY AND ISOLATE THE HOLES WHERE THE GAS WAS COMING FROM AND ATTEMPT TO SQZ THEM OFF TO MAKE WORKSITE SAFER. TRIED TO BLEED WELL OFF. KILLED WELL W/ 40 BBLS. BRINE. UNSET 8-5/8" PKR, PULLED IT OUT OF HOLE. RIH W/ 7" OPEN HOLE PKR. SET IT @ 2219'. GOT A PIR OF 3-1/2 BPM. NO PRESSURE ON TBG. BACK SIDE HAD GAS PSI ON IT. SI. SDFN.

NOTE: ISOLATED GAS PRESSURE BETWEEN 1850' AND 2219'. MARK WHITAKER WAS ON LOC AND IT WAS DECIDED TO SQZ OFF GAS ZONE.

09-22-09 CREW TO LOC. CHECK WELL PRESSURE ON TBG. HAD NO PRESSURE. BACK SIDE HAD 180 PSI. WAIT ON PRESSURE PUMP. RU PUMP & SQZ. 125 SX THIXATROPIC & 100 SX OF CLASS "H" CMT AND DISPLACED TO 2700'. SI. SDFN.

NOTE: DECIDED BY GUINN BURKS AND MARK WHITAKER TO RIH W/ DHV CAMERA TO LOOK AT TOF.

09-23-09 CREW TO LOC. RU WL & RIH W/ DOWN HOLE CAMERA TO TOF. LOOKED AT FISH. POOH W/ CAMERA. POOH W/ OPEN HOLE PKR. HAD TO KILL WELL ALL THE WAY OUT OF THE HOLE. RU WL & SET A RBP @ 2223'. DUMP 3 SX OF SAND ON TOP. POOH. RIH W/ 8-5/8" PKR. SET @ 1616'. SI. SDFN.

09-24-09 CREW TO LOC. RU PUMP, GET A PIR 3 BPM, NO PRESSURE, SQZ. 200 SX CMT. SIW. WOC 6 HRS. WELL HAD 300 PSI, DID NOT SQZ OFF. BLED WELL OFF. GET A PIR, 3 BPM, NO PRESSURE, SIW. SDFN.

NOTE: GUINN BURKS CALLED BUDDY HILL @ OCD AND WAS AUTHORIZED TO PUMP ANOTHER POLY PLUG TO SQZ OFF GAS ZONE.

09-25-09 CREW TO LOC. MIX UP 1ST PILL OF 47 BBLS OF LCM, SAND, AND POLY FILL AND PMPD. STOP PUMPING. STARTED MIX (POLY PLUG) PUMPED 33 BBLS. OF 40 BBLS DOWN HOLE PRESSURE WENT UP TO 2000 PSI. SWITHED TO DISPLACMENT, DISPLACED DOWN TO 1705'. @ 0 BPM PIR @ 2200 PSI. SI. SDFN.

09-28-09 CREW TO LOC. CHECK PRESSURE ON WELL, 850 PSI. BLED OFF & GET 30 MINUTE CHECK, 90 PSI. UNSET PKR. POOH & RIH OPEN ENDED TO 1680', SPOT 25 SX. CMT. POOH W/ TBG. RIH W/ 8-5/8" PKR. TO 1458', SET PKR &PRESSURED UP TO 1000 PSI. HELD PRESSURE FOR 3 HRS. SI. SDFN.

09-29-09 CREW TO LOC. CHECKED WELL PRESSURE, TBG HAD 350 PSI.BACK SIDE 0 PSI, BLED IT OFF. POOH & PRESSURE TESTED 8-5/8" CSG. TO 500 PSI. TESTED GOOD. LD PKR., PU DRILL COLLARS, RIH & TAGGED @ 1990'. DRILLED DOWN TO 2085'. POOH W/ 5 STANDS. SI. SDFN.

9-30-09 CREW TO LOC. CHECKED WELL PRESSURE, NO PRESSURE. DRILLED DOWN TO TOP OF 7" LINER @ 2143'. CIRC. WELL CLEAN, SI FOR 1 HR. WELL DID NOT HAVE PRESSURE. POOH W/ BIT. RIH W/ OVERSHOT FOR RBP. WASHED OFF SAND, LATCHED ON RBP. STARTED POOH W/ RBP. WELL STARTED BLOWING OUT WATER. SI. BLED OFF WELL TO BLOW DOWN TANK. SI. SDFN.

10-01-09 CREW TO LOC. CHECKED WELL PRESSURE, 250 PSI. BLED IT OFF, RU SAFETY EQUIPMENT. POOH W/ RBP & RU WL, RIH W/ RBP & SET IT @ 2222', POOH. RIH W/ DUMP BAILER & DUMPED 3 SX OF SAND. NOTE: POLY PLUG DID NOT SHUT OFF ALL OF GAS. POOH. RIH W/ 8-5/8" PKR. TO 1806'. PUMPED 295 BBLS. BRINE. COULD NOT LOAD THE HOLE. POOH W/ PKR. SI. SDFN.

10-02-09 CREW TO LOC. CHECK WELL, NO PRESSURE. RIH OPEN ENDED & TAG TOP OF SAND @ 2217'. PUH TO 2092', SQZD. 150 SX CLASS "C" NEAT CMT, POOH WOC 4 HRS. RU WL & TAG @ 2000'. TRIED TO LOAD HOLE. RIH TO 1997', SPOTTED. 150 SX CLASS "C" NEAT CMT, POOH SI, SDFN.

10-05-09 CREW TO LOC. NO PRESSURE ON WELL. RU WL & RIH TAG @ 2000'. POOH. RIH W/ 8-5/8" PKR. TO 1870', PRESSURED UP TO 1000 PSI. UNSET PKR., FILL UP THE 8-5/8". POOH W/ PKR. RIH OPEN ENDED TO 1997', SPOT 100 SX CMT. POOH & PICK UP 8-5/8" PKR. RIH TO 1394', PRESSURE UP TO 800 PSI. SI. SDFN.

10-06-09 CREW TO LOC. WEL STILL HAD A LITTLE PSI BUT BLED DOWN. POOH W/PKR. RIH OPEN ENDED & TAGGED @ 1711'. SPOT 150 SX CMT. @ 1680'. POOH, PRESSUERED UP CSG, WOC 4 HRS. RIH W/ TBG. & TAGGED @ 1172'. POOH SI. SDFN.

10-07-09 CREW TO LOC. WELL STATIC. RIH W/ DRILL BIT TO 1176', DRILLED DOWN TO 1483'. PUH & CIRC. WELL. SI. SDFN

10-08-09 CREW TO LOC. TAG TOC @ 1483'. DRILLED DOWN TO 1815'. PUH, CIRC. WELL & SI. SDFN

10-09-09 CREW TO LOC. TAGGED TOC @ 1815'. DRILLED DOWN TO TOP OF LINER @ 2143', POOH W/ BIT, RIH W/ 6-3/4" BIT TO TOP OF SAND, WASH SAND TO TOP OF RBP. CIRC. HOLE, POOH. SI. SDFN.

10-12-09 CREW TO LOC. RIH W/ OVERSHOT GET RBP. POOH & RIH W/ GRAPPLE, COULD NOT GET FISH. POOH & RIH W/ IMPRESSION BLOCK. POOH AND LOOKED AT BLOCK. DETERMINED TO RUN A FLAT MILL. SI. SDFN.

10-13-09 CREW TO LOC. RIH W/ FLAT MILL, MILLED ON FISH FOR 3.5 HRS. STARTED MILLING @2250', MILLED DOWN TO 2253'. POOH W/ MILL. RIH W/ IMPRESSION BLOCK, POOH, RIH W/ OVER SHOT TO TOP OF LINER. SI. SDFN.

10-14-09 CREW TO LOC. RIH W/ OVER SHOT, COULDN'T GET THE FISH. POOH & RIH W/ FLAT MILL. MILLED DOWN TO 2327'. POOH. RIH W/ IMPRESSION BLOCK, DIDN'T TAG FISH. RIH TO 3804'. PUH TO 1838', TBG. WAS DRAGGING OUT OF THE HOLE. SI. SDFN.

10-15-09 CREW TO LOC. POOH W/ TBG. TBG. STARTED PULLING BAD AFTER 72 JTS. LD 48 BENT JTS. RIH W/ MILL SHOE DOWN TO 3804'. SI. SDFN.

10-16-09 CREW TO LOC. RU WL. RIH COULD NOT GET PAST 2297' BECAUSE OF BEND. POOH W/WL, EST PIR, SQZD. 280 SX CMT. @ 3804'. SI. SDFN.

10-19-09 CREW TO LOC. PUMPED 8 BBLS. BRINE DOWN THE TBG. PRESSURE UP TO 1000 PSI, IT BLED OFF. PUMPED 140 BBLS. DOWN THE BACKSIDE, COULD NOT LOAD IT. POOH W/ 72 JTS. & LAID DOWN 51 BENT JOINTS. LAID DOWN DC AND SI. SDFN.

10-20-09 CREW TO LOC. RIH W/ MILLSHOE & TAGGED @ 2250'. PUH & WENT DOWN TO 2330'. PIPE STARTED TO DRAG GOING IN THE HOLE. POOH & LAID DOWN 1 BENT JT. RIH W/ MILLSHOE. TRIED TO GET IN THE CASING, COULD NOT GET IN. POOH. RIH W/ 20' MILLSHOE, COULD NOT GET IN THE CSG. POOH. SI. SDFN.

10-21-09 CREW TO LOC. RU WL, RIH W/ DOWN HOLE VIDEO EQUIPMENT DOWN TO TOF. POOH W/ WL, CSG. IS PARTED @ 2250'. TALKED W/ BUDDY HILL W/ OCD. OK'D PLUGGING OUT FROM 2250'. RIH W/ 8-5/8" PKR. & SET @ 2092'. SI. SDFN.

10-22-09 CREW TO LOC. RU PUMP TRUCK, PUMPED 1000(GAL)LIQUID GLASS. POOH W/ 8-5/8" PKR. RIH OPEN ENDED TO 2250', SPOT 25 SX CMT. PUH 20 STDS. WOC 4 HRS. RIH, PLUG WAS NOT THERE, SPOT 50 SX CMT @ 2250', PUH W/ 20 STDS. SI. SDFN.

10-23-09 CREW TO LOC. RIH TO TAG PLUG, WAS NOT THERE. POOH & DUMPED 12 YDS PEA GRAVEL DOWN 8-5/8" CSG. RIH & TAGGED @919'. POOH. SI. SDFN.

10-26-09 CREW TO LOC. RU REVERSE UNIT, RIH & TAGGED @ 855'. CIRCULATED GRAVEL OUT OF THE WELL DOWN TO 1077', LOST CIRCULATION. LD SWIVEL, RIH TO 2250', POOH W/ 15 STANDS. SI. SDFN.

10-27-09 CREW TO LOC. ORDERED OUT 12 MORE YDS PEA GRAVEL.. DUMPED 6 YARDS IN 8 5/8" CSG. RIH W/TBG. TAGGED @ 1585'. TRY TO LOAD HOLE, PUMPED 100 BBLS. RIH TO 2250'. GRAVEL BROKE FREE. POOH & POURED 6 MORE YARDS OF GRAVEL IN 8-5/8" CSG. RIH TO 2250', NO TAG. PUH 15 STANDS. SI. SDFN.

10-28-09 CREW TO LOC. POURED 1" GRAVEL (6 YARDS) DOWN 8-5/8" CSG. RIH TO 2250', DID NOT TAG. POOH. START POURING MORE GRAVEL. SI. SDFN.

10-29-09 CREW TO LOC. POURED 1" GRAVEL IN 8-5/8" CSG. RIH, DID NOT TAG GRAVEL. CALLED GUINN BURKS, HE SPOKE TO BUDDY HILL AND WAS AUTHORIZED TO SET A CIBP @ 2225'. POOH. RD REVERSE UNIT, MIXED MUD. SI. SDFN.

10-30-09 CREW TO LOC. RU WL, RIH W/ GAUGE RING TO 2240'. POOH. RIH W/ 7" CIBP & SET @ 2220'. POOH. RIH TO TOP OF BP & CIRC. WELL W/ MLF. SPOT 30 SX @ 2219'. PUH 20 STANDS. WOC 4 HRS. RIH & TAGGED @ 2020'. POOH. RIH W/ 47 JTS. & 8-5/8" PKR TO 1489'. SET IT. RU WL &. PERF @ 1700', COULD NOT GET A PIR. SI. SDFN.

11-02-09 CREW TO LOC. POOH W/ 8-5/8" PKR. RIH OPEN ENDED TO 1750', SPOT 50 SX CMT.BAL PLUG OK'D BY BUDDY HILL, POOH. RIH W/ PKR. TO 1489', PRESSURED UP ON PLUG FOR 2 HRS. WOC. 4 HRS. POOH W/ PKR. RIH OPEN ENDED & TAGGED @ 1680'. POOH LAYING PIPE DOWN. RU WL & PERF @ 380'. RIH W/ PKR. TO 126', COULD NOT GET A PIR. POOH. RIH OPEN ENDED TO 443', SPOT 50 SX. TAG IN THE A.M. OKAYED BY MARK WHITAKER W/ OCD. SI. SDFN.

11-03-09 CREW TO LOC. RIH TAG @ 317'. SPOT 20 SX CMT. FROM 317' TO 243'. POOH LAYING PIPE DOWN. RUWL PERF @ 60'. COULD NOT GET A PIR. POOH W/ 8-5/8" PKR. RIH TO 126', PUMP 35 SX CMT. TO SURF OK'D BY MARK WHITAKER. RDMO.

BASIC ENERGY SERVICES WILL INSTALL DRY HOLE MARKER & CLEAN LOC.