

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N French Dr, Hobbs, NM 87240  
District II  
1301 W Grand Ave, Artesia, NM 88210  
District III  
1000 Rio Brazos Rd, Aztec, NM 87410  
District IV  
1220 S St Francis Dr, Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
June 19, 2008

RECEIVED  
FEB 10 2010  
HOBBSUCD

CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-06278
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: A B Reeves
8. Well Number 2
9. OGRID Number 005380
10. Pool name or Wildcat Eumont; Yates-7 Rvrs-Queen (Gas)
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other	7. Lease Name or Unit Agreement Name: A B Reeves
2. Name of Operator XTO Energy, Inc.	8. Well Number 2
3. Address of Operator 200 N. Loraine, Ste. 800 Midland, TX 79701	9. OGRID Number 005380
4. Well Location Unit Letter <u>E</u> : 1980' feet from the <u>North</u> line and 660' feet from the <u>West</u> line Section <u>29</u> Township <u>20S</u> Range <u>37E</u> NMPM County <u>Lea</u>	10. Pool name or Wildcat Eumont; Yates-7 Rvrs-Queen (Gas)
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☒  
CASING/CEMENT JOB ☐

OTHER: ☐

CONDITIONS OF PA APPROVAL: Approved as to plugging of the Well Bore. Liability under bond is retained until surface restoration is completed. OCD Hobbs office needs C-103 "Check Off List for Surface Inspection".

13. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 1103. For Multiple or recompletion.

1/21/10 MIRU P&A equip. Move in & rack 4,500' 2-3/8" 4.7# J-55 EUE 8rd prod tbg. ND WH. NU BOP. PU & RIH w/102 jts 2-3/8" J-55 & tag CIBP @3,225'. Circ 7" csg w/130 bbls 9.5# mud.  
1/25/10 Spot 35 sks class "C" cmt on CIBP @3,225'. PUH & circ clean. POOH w/tbg. RU WL. RIH & perf 7" csg @2,500' (2spf, 4 holes) POOH & RD WL. RIH w/7" pkr. Set pkr @ 2,200'. Rel pkr. POOH & ID pkr. RIH OE tbg. Spot 30 sks class "C" cmt across perfs. PUH & circ clean. POOH w/tbg. RIH & tag cmt @ 2,370'. Perf 7" csg @1,180' (2spf, 4holes). RD. RIH w/7" pkr. Set pkr @980'. RIH & spot 30 sks class "C" cmt across perfs. PUH & circ clean.

Procedure Cont'd. on next page

Spud Date:

1/21/10

Rig Release Date:

1/27/10

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kristy Ward TITLE Regulatory Analyst DATE 02/08/10  
Type or print name Kristy Ward E-mail address: kristy\_ward@xtoenergy.com PHONE 432-620-6740

For State Use Only

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE/STAFF MANAGER DATE 2-11-10  
Conditions of Approval (if any):

A B Reeves #2  
Plug & Abandon  
Cont'd.

- 1/26/2010      RIH & tag cmt @1,075'. Perf 7" csg @ 100' (2 spf, 4 holes) Press TCA to 500 psig. Unable to EIR. Contact OCD. They advised us to perf @ 60'. PUH & perf 7: csg @ 60' (2 spf, 4 holes). RD WL. Spot 35 sks class "C" cmt @ 450' OCD. PUH & circ clean. RIH & tag cmt @ 290'. POOH & LD tbg. Pmpd 30 sks cmt dwn 7" csg. Press cmt into perfs @60'. Circ cmt to surface.
- 1/27/2010      RDMO PU. Top off TCA w/cmt. Cut off WH & anchors. Install dry hole marker. Back drag location. Waiting on remediation to final report.