		REC	EIVE OCD HOD	bs	
Form 3160-5	UNITEDS ST	UNITEDS STATES		FORM APPROVED	
April 2004)	DEPARTMENT OF THE INTERIOREB 2 5 2010 BUREAU OF LAND MANAGEMENDBBSOCD			OMB No 1004-0137	
				Expires March	31, 2007
				5. Lease Serial No	
SUNDRY NOTICES AND REPORTS ON WELLS				NM 96858	
Do not use this form for proposals to drill or to re-enter an				6. If Indian, Alloite or Tribe Name	
aban	doned well. Use Form 3160 - 3 (APD) for such proposals	.		
				7 If unit or CA/Ac	reement, Name and/or No
SUBMIT IN :	TRIPLICATE - Other instruction	s on reverse side			
1 Type of Well				8. Well Name and No	
Oil Well Gay Well Other				OPAL "28" FEDERAL WELL NO. 1	
2 Name of Operator				9 API Well No	,
SUNDOWN ENERG	Y LP			30-025-34004	1
3a Address		3Ъ Р	hone No (include area code)	10 Field and Pool,	or Exploratory Area
13455 NOEL RD, S1	TE 2000 DALLAS, TX 75240	214	-368-6100	Hat Mesa, Delaware	
4 Location of Well (Lootage, Sec., L. R., M., or Survey Description)			_	11 County or Parish, State	
UNIT I, SEC. 28 T-20S, R-33E /				LEA CO., NM	/
1650' FSL & 660' FEL					1
	· · · · · · · · · · · · · · · · · · ·				
12 CHECK A	PPROPRIATE BOX(ES) TO INI		DTICE, REPORT, OR		
TYPE OF SUBMISS	ON	TYPE OF ACTION		- =	Water Shut-Off
<u> </u>	Acidize	Deepen	Production (Start/Resun	ne)	Well Integrity
Notice of Intent	Alter Casing	Fracture Treat	Reclamation		Other
Subsequent Report	Casing Repair	New Construction	Recomplete		
Final Abandonment No	tice Change Plans	Plug and Abandon	Temporarily Abandon		
	Convert to Injection	Plug Back	Water Disposal		
13 Describe Proposed of	or Completed Operation (clearly state all deepen directionally or recomplete horiz	pertinent details, including esti	mated starting date of any pr	roposed work and approximer entireal depths of all pertiner	ate duration therof
Attach the Bond und	er which the work will be performed or p	rovide the Bond No on file with	BLM/BIA Required subsequ	uent reports shall be filed w	ithin 30 days
following completion	of the involved operations. If the operat	ion results in a multiple complet	ion or recompletion in a new	r interval, a Form 3160-4 sh	all be filed once
	npleted Final Abandonment Notices sh	all be filed only after all require	ments, including reclamation,	, have been completed, and	the operator has
	site is ready for final inspection) with 9.5# mud laden fluid. S	Spot 30 ov al U amt f	rom 9001' Tag @ 0	9020' Shot add'l 3	0 sx_same.cmt
F	viiii 9.5# mud laden huld. S	oput ou sx trim time r sot & the 50 sy of U c	ont 8550 - 8063' P	$\frac{1}{10}$	'IBP @ 6800'
Load hole y	A! DI., #1 0001 002 // C.	ior acture ou sx ur m u		IH ON W/ I XI COLL	
Tag @ 886	4'. Plug #1 9091-8864'. Sp)C @ 6765' Snot &	tag 35 sy cl C neat i	$\frac{1H \text{ on } WL \& \text{ set } C}{cmt f / 5293 - 4924}$	$\frac{1}{2} \int \frac{1}{2} \int \frac{1}$
Tag @ 886 Dump bail	35' cmt on top of CIBP. TO	DC @ 6765'. Spot & 1	tag 35 sx cl C neat	cmt f/ 5293 - 4924	'. Cut & pull 5-1/2" csg @
Tag @ 886 Dump bail 3000'. Spot	35' cmt on top of CIBP. TO stub plug f/3442' using 37	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W	tag 35 sx cl C neat ('OC & tag @ 2083'	cmt f/ 5293 - 4924 '. Spot add'l 333 s	.'. Cut & pull 5-1/2" csg @ x f/ 2083'.
Tag @ 886 Dump bail 3000'. Spot WOC & tag	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat ('OC & tag @ 2083' cmt. Spot surface p	cmt f/ 5293 - 4924 '. Spot add'l 333 s	.'. Cut & pull 5-1/2" csg @ x f/ 2083'.
Tag @ 886 Dump bail 3000'. Spot WOC & tag	35' cmt on top of CIBP. TO stub plug f/3442' using 37	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat ('OC & tag @ 2083' cmt. Spot surface p	cmt f/ 5293 - 4924 '. Spot add'l 333 s lug f/ 60' to surfac	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt.
Tag @ 886 Dump bail 3000'. Spot WOC & tag	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat ('OC & tag @ 2083' cmt. Spot surface p	cmt f/ 5293 - 4924 . Spot add'l 333 s .lug f/ 60' to surfac	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat ('OC & tag @ 2083' cmt. Spot surface p	cmt f/ 5293 - 4924 . Spot add'l 333 s lug f/ 60' to surfac Accepted as to p Liability under	 '. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. blugging of the well bore. bond is retained until
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat ('OC & tag @ 2083' cmt. Spot surface p	cmt f/ 5293 - 4924 . Spot add'l 333 s lug f/ 60' to surfac Accepted as to p Liability under	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat o 'OC & tag @ 2083' cmt. Spot surface p <u>10.</u>	cmt f/ 5293 - 4924 . Spot add'l 333 s .lug f/ 60' to surfac Accepted as to p Liability under Surface restorat	". Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. hugging of the well bore. bond is retained until
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V	DC @ 6765'. Spot & 1 5 sx cl C neat cmt. W 1055' w/ total 708 sx	tag 35 sx cl C neat ('OC & tag @ 2083' cmt. Spot surface p	cmt f/ 5293 - 4924 . Spot add'l 333 s .lug f/ 60' to surfac Accepted as to p Liability under Surface restorat	". Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. hugging of the well bore. hond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V oregoing is true and correct	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20	tag 35 sx cl C neat o 'OC & tag @ 2083' cmt. Spot surface p <u>10.</u>	cmt f/ 5293 - 4924 2. Spot add'l 333 s lug f/ 60' to surfac Accepted as to p Liability under Surface restorat	". Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. hugging of the well bore. hond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37. g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V bregoing is true and correct ris	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20	tag 35 sx cl C neat of OC & tag @ 2083' cmt. Spot surface p <u>10.</u> Production For 1/21/2010	cmt f/ 5293 - 4924 Spot add'l 333 s Jug f/ 60' to surfac Accepted as to p Liability under Surface restorat reman ACCE HILLE	". Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. hugging of the well bore. hond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH	35' cmt on top of CIBP. TC stub plug f/3442' using 37. g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V bregoing is true and correct ris	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20 c Intle	ag 35 sx cl C neat of 2083' OC & tag @ 2083' cmt. Spot surface p 10. Production For 1/21/2010 FATE OFFICE US	cmt f/ 5293 - 4924 Spot add'l 333 s Jug f/ 60' to surfac Accepted as to p Liability under Surface restorat reman ACCE HILLE	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. blugging of the well bore. bond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH 14 Thereby certify that the I Name (Printed Typed) Jimmy Lew Signature	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V oregoing is true and correct ris <u>mmy Heisspace FO</u>	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20	tag 35 sx cl C neat of OC & tag @ 2083' cmt. Spot surface p <u>10.</u> Production For 1/21/2010	cmt f/ 5293 - 4924 Spot add'l 333 s Jug f/ 60' to surfac Accepted as to p Liability under Surface restorat reman AOCE HILLE	". Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. hugging of the well bore. hond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH 14 Thereby cerufy that the I Name (Printed Typed) Jimmy Lew Signature	35' cmt on top of CIBP. TC stub plug f/3442' using 37. g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V bregoing is true and correct ris	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20	ag 35 sx cl C neat of 2083' OC & tag @ 2083' cmt. Spot surface p 10. Production For 1/21/2010 FATE OFFICE US	cmt f/ 5293 - 4924 Spot add'l 333 s Jug f/ 60' to surfac Accepted as to p Liability under Surface restorat reman AOCE HILLE	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. blugging of the well bore. bond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH 14 Thereby certify that the I Name (Printed Typed) Jimmy Lew Signature	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. V oregoing is true and correct ris <u>mmy Heisspace FO</u>	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20 c total R FEDERAL OR S CCC 2/24 not warrant or	ag 35 sx cl C neat of 2083' OC & tag @ 2083' cmt. Spot surface p 10. Production For 1/21/2010 FATE OFFICE US	cmt f/ 5293 - 4924 Spot add'l 333 s Jug f/ 60' to surfac Accepted as to p Liability under Surface restorat reman AOCE HILLE	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. blugging of the well bore. bond is retained until ion is completed.
Tag @ 886 Dump bail 3000'. Spot WOC & tag Cut off WH 14 Thereby certify that the I Name (Printed Typed) Jimmy Lew Signature	35' cmt on top of CIBP. TC stub plug f/3442' using 37 g @ 1055'. Plug f/ 3442 - 1 I. Install dry hole marker. W bregoing is true and correct ris <u>mmy Leum</u> <u>THIS SPACE FO</u>	DC @ 6765'. Spot & t 5 sx cl C neat cmt. W 1055' w/ total 708 sx Well P&A'd 01/18/20 c total R FEDERAL OR S CCC 2/24 not warrant or	ag 35 sx cl C neat of OC & tag @ 2083' cmt. Spot surface p 10. Production For 1/21/2010 TATE OFFICE U	cmt f/ 5293 - 4924 Spot add'l 333 s lug f/ 60' to surfac Accepted as to p Liability under Surface restorat reman A O C SE	'. Cut & pull 5-1/2" csg @ x f/ 2083'. e w/ 25 sxs cl C neat cmt. blugging of the well bore. bond is retained until ion is completed.

بي يلجني

WELL DATA SHEET

