

State of New Mexico
Energy, Minerals and Natural Resources

RECEIVED

APR 29 2010

HOBBSCO

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO.

30-025-01310

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

MALMAR UNIT

8. Well Number 306

9. OGRID Number

266091

10. Pool name or Wildcat

MALJAMAR

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other Inject

2. Name of Operator

VPR Operating, LLC

3. Address of Operator

PO Box 2769, Hobbs, New Mexico 88241

4. Well Location

Unit Letter F : 1980 feet from the NORTH line and 2029 feet from theWEST lineSection 7 Township 17S Range 33E NMPM LEA County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

4233

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐TEMPORARILY ABANDON ☐ CHANGE PLANS ☐PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐DOWNHOLE COMMINGLE ☐OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐ P AND A ☒CASING/CEMENT JOB ☐OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

VPR Operating LLC did P/A the Malmar 306 4/21/10 as follows:

A] Set CIBP @ 4,100', with 35' of cement on top.

B] Perforate 5-1/2" casing @ 2550'.

C] Squeeze perforations @ 2550' w/ 25 sx Class C.

D] WOC. Did not tag plug.

E] Spot 25 sx Class C plug 2600' - 2350'.

F] WOC. Tag plug @ 2422'.

G] Perforate 5-1/2" casing @ 1350'.

H] Squeeze perforations @ 1350' with 50 sacks Class C.

I] WOC. Tag plug @ 1302'.

J] Perforate 5-1/2" casing @ 375'.

K] Squeeze/circulate to surface w/ 95 sx Class C. Circulate 3 bbls to surface. Squeeze 2 bbls in perms.

L] Cut off well head

M] Install approved NMOCD dry hole marker.

N] Clean and level location.

CONDITIONS OF PA APPROVAL: Approved as to plugging of the Well Bore. Liability under bond is retained until surface restoration is completed. OCD Hobbs office needs C-103 "Check Off List for Surface Inspection".

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



Royce Eades

TITLE

royceeades@penrocoil.com

Agent

DATE

4/29/10

Type or print name

E-mail address:

PHONE:

For State Use Only

APPROVED

BY:



TITLE

STAFF MEMBER

DATE 4-29-10

Conditions