Submit I Copy To Appropriate District Office State of New Mexico	Form C-103
District 1 Energy, Minerals and Natural Resources	October 13, 2009
1625 N. French Dr., Hobbs, NM 88240	WELL API NO. 30-025-05228
District II 1301 W. Grand Ave., Artesia, NM 882 F C LIGITON SERVATION DIVISION	5. Indicate Type of Lease
District III 1000 Rio Brazos Rd., Aztec, NM 8741APR 2 9 2010 Santa Fe, NM 87505	STATE X FEE
District IV Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NHOBBSOCD 87505	B-9774
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name State T Devonian
PROPOSALS.)	8. Well Number ₂
1. Type of Well: Oil Well X Gas Well Other	9. OGRID Number
2. Name of Operator CELERO ENERGY II, LP	247128
3. Address of Operator 400 W. Illinois, Ste. 1601 Midland, TX 79701	10. Pool name or Wildcat Denton Devonian
4. Well Location	
Unit Letter K: 1980 feet from the South line and 19	80 feet from the West line
Section 2 Township 15S Range 37E	NMPM CountyLea
11. Elevation (Show whether DR, RKB, RT, GR, etc.	
3801' GL	
12. Check Appropriate Box to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENTION TO	SEQUENT REPORT OF:
NOTICE OF INTENTION TO: SUE PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WOR	
	ILLING OPNS. P AND A
PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMEN	
DOWNHOLE COMMINGLE	,
	* 1
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, ar	
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co	mpletions: Attach wellbore diagram of
proposed completion or recompletion.	
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO	OH. Run roto-vert csg scraper, tag @ 10067'
proposed completion or recompletion.	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg &
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW &	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI.
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date:	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI.
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date:	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI.
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100	OH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & ntermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI.
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledges and the standard properties of the set of my knowledges. SIGNATURE TITLE Regulatory Analyst	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on it 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: Thereby certify that the information above is true and complete to the best of my knowledges and the standard properties of the best of my knowledges. Title Regulatory Analyst Type or print name Lisa Hunt E-mail address: LHunt@celeroe	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: Title Regulatory Analyst Type or print name Lisa Hunt E-mail address: LHunt@celeroe For State Use Only	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: Title Regulatory Analyst Type or print name Lisa Hunt E-mail address: LHunt@celeroe For State Use Only APPROVED B	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: Title Regulatory Analyst Type or print name Lisa Hunt E-mail address: LHunt@celeroe For State Use Only	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: Title Regulatory Analyst Type or print name Lisa Hunt E-mail address: LHunt@celeroe For State Use Only APPROVED B	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010
proposed completion or recompletion. 4/5 - 4/9/10 - POOH w/sub pump & 9898' of tbg. Run BHP tool, tag @ 10065' & POO & POOH. Run 7" HD pkr, tag hard @ 5400'+. RIH to 8012' & set. Load csg side w/8 recovered Devonian oil. Continue pumping 75 bbls down csg & broke circulation on in 1 hr to free it. Pkr dragging for 8 stands. POOH w/49 jts & well kicked. Stab TIW & POOH w/pkr. Pkr J-slot damaged. Run 40-arm caliper/csg inspection log. Tag @ 100 Spud Date: Rig Release Date: Title Regulatory Analyst Type or print name Lisa Hunt E-mail address: LHunt@celeroe For State Use Only APPROVED B	DH. Run roto-vert csg scraper, tag @ 10067' 8 bbls BW. Bled off intermediate csg & attermediate. Attempt to unset pkr & had to jar kill w/30 bbls 10# BW down tbg. Continue 53'. RIH w/2014' (65 jts) kill string & SI. ge and belief. DATE 04/27/2010

-3