Submit I Copy To Appropriate District Office	State of New Mexico	Form C-103
District I 1625 N French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resou	WELL API NO.
District II 1301 W. Grand Ave , Artesia, New 882016	CONSERVATION DIVISI 1220 South St. Francis Dr.	ON 30-025-12464 5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410		SIAIL LILL X
District IV 1220 S St. Francis Dr., Santa Fe, NMAY 87505	26 ZUIU Santa Fe, NM 87505	6. State Oil & Gas Lease No.
87505 SUNDRY 10	RESOCD PRES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROP	OSALS TO DRILL OR TO DEEPEN OR PLUG BACK T JICATION FOR PERMIT" (FORM C-101) FOR SUCH	WB Maveety
1. Type of Well: Oil Well	Gas Well X Other	8. Well Number 5
•	e Operating, Inc.	9. OGRID Number 147179
3. Address of Operator P.O. Box Oklahom	: 18496 a City, OK 73154-0496	10. Pool name or Wildcat Eumont Yates 7 Rvrs QN (Pro Gas)
4. Well Location		
		e and 1991 feet from the East line
Section 35	Township 19S Range 36E 11. Elevation (Show whether DR, RKB, RT)	
The second secon	3609' GR	Andrew Co.)
12. Check	Appropriate Box to Indicate Nature of	Notice, Report or Other Data
NOTICE OF II PERFORM REMEDIAL WORK [TEMPORARILY ABANDON [PULL OR ALTER CASING [DOWNHOLE COMMINGLE [COMME COMME CASING	SUBSEQUENT REPORT OF: IAL WORK
OTHER.	□ OTHER:	П
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re	vork). SEE RULE 19.15.7.14 NMAC. For Mu	etails, and give pertinent dates, including estimated date ltiple Completions: Attach wellbore diagram of
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs c 5/21/10: Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 s 5/24/10: RU WL unit. RIH & ta 15 #s brine to load casing. RU	pleted operations. (Clearly state all pertinent deports). SEE RULE 19.15.7.14 NMAC. For Must completion. on the plug and abandonment of this well from a equipment to location. Bled well down, NDV 60'. RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of the tag with the tag wit	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', & test csg to 500# for 30 min. Tested good, RIH & IH & perf @ 1198', POOH RD WL. RIH w/packer & Pokr, POOH laying down 28 jts WS & 7" pkr. Pump Load 7" & 9 5/8" & 13 3/8" w/brine, returns from 13 3 3/8". RD PU & equipment. Turn well over to pproved for plugging of well bore only. ability under bond is retained pending receipt (C-103 (Subsequent Report of Well Plugging))
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs ct 5/21/10: Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 s 5/24/10: RU WL unit. RIH & ta 15 #s brine to load casing. RU 3/" csng, sqz 200 sxs Class "C"	pleted operations. (Clearly state all pertinent deports). SEE RULE 19.15.7.14 NMAC. For Mustecompletion. on the plug and abandonment of this well from & equipment to location. Bled well down, NDV 60'. RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of the tag with the tag wit	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', & test csg to 500# for 30 min. Tested good, RIH & IH & perf @ 1198', POOH RD WL. RIH w/packer & 'pkr, POOH laying down 28 jts WS & 7" pkr. Pump Load 7" & 9 5/8" & 13 3/8" w/brine, returns from 13 3 3/8". RD PU & equipment. Turn well over to pproved for plugging of well bore only.
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs cmt. Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 starting for the starting for the starting for the starting for the starting for final clean up. W Spud Date:	pleted operations. (Clearly state all pertinent dework). SEE RULE 19.15.7.14 NMAC. For Multicompletion. on the plug and abandonment of this well from & equipment to location. Bled well down, NDV 60'. RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of the tag with tag with tag with the tag with tag with the tag with tag with the tag with th	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', which we will the test country to the test cou
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs cmt. Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 starting for the starting for the starting for the starting for the starting for final clean up. W Spud Date:	pleted operations. (Clearly state all pertinent devork). SEE RULE 19.15.7.14 NMAC. For Multicompletion. on the plug and abandonment of this well from & equipment to location. Bled well down, NDV 60'. RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of the well well down, NDV 60'. ROWC. POOH w/tbg & packer, RU WL contractor. Resease the work of the well well well well well and the well well well and the well and the well well and the well and	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', which we will the test country to the test cou
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs c 5/21/10: Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 s 5/24/10: RU WL unit. RIH & ta 15 #s brine to load casing. RU 3/" csng, sqz 200 sxs Class "C" production for final clean up. W	pleted operations. (Clearly state all pertinent dework). SEE RULE 19.15.7.14 NMAC. For Multicompletion. on the plug and abandonment of this well from & equipment to location. Bled well down, NDV 60'. RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of the tag with tag with tag with the tag with tag with the tag with tag with the tag with th	etails, and give pertinent dates, including estimated date a litiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', which we will be a subject of the
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs cmt. Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 starting for the starting for the starting for the starting for the starting for final clean up. W Spud Date:	pleted operations. (Clearly state all pertinent depork). SEE RULE 19.15.7.14 NMAC. For Multicompletion. on the plug and abandonment of this well from & equipment to location. Bled well down, NDV (10). RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of the tag with the tag wit	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', which we will the test country to the test cou
13. Describe proposed or com of starting any proposed w proposed completion or re Please find the work performed 5/19/10: Road WS service unit POOH, RIH & set CIBP @ 275 5/20/10: Spot 25 sxs cmt on CII perforate @ 2514', sqz 75 sxs c 5/21/10: Tag cmt plug @ 2293' tbg. Set packer @ 857', sqz 40 s 5/24/10: RU WL unit. RIH & ta 15 #s brine to load casing. RU V 3/" csng, sqz 200 sxs Class "C" production for final clean up. W Spud Date:	pleted operations. (Clearly state all pertinent dework). SEE RULE 19.15.7.14 NMAC. For Multicompletion. on the plug and abandonment of this well from & equipment to location. Bled well down, NDV 60'. RD WL. BP @ 2750', WOC, RIH & tag @ 2615'. Load of mt, WOC. POOH w/tbg & packer, RU WL contractor. Resease mt. WOC. Reg top of cmt @ 1076'. RD WL unit. Release 7" WL & perf @ 346'. RD WL, NDBOP, NUWH, cmt to surface, 7" csg full. Cmt out 9 5/8" & 13 yell P&A'd on 5/24/10. Rig Release Date: TITLE Senior Regulators. E-mail address: bryan.ar	etails, and give pertinent dates, including estimated date altiple Completions: Attach wellbore diagram of a 5/19/10 through 5/24/10. WH, NUBOP, RU WL. RIH w/gauge ring to 2770', which we will the well by the well over to the well by the well by the well by the well over to the well by the we