

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103

June 19, 2008

RECEIVED

MAR 07 2011

HOBBSUCCD

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-12509
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: North Hobbs G/SA Unit
8. Well Number 311
9. OGRID Number 157984
10. Pool name or Wildcat Hobbs; Grayburg-San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Occidental Permian Ltd.

3. Address of Operator
P.O. Box 4294, Houston, TX 77210-4294

4. Well Location
Unit Letter B : 1022 feet from the North line and 2310 feet from the East line
Section 34 Township 18-S Range 38-E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3641' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See Attached

The Oil Conservation Division Must be notified
24 hours prior to the beginning of plugging operations.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mark Stephens TITLE Regulatory Compliance Analyst DATE 3/4/11

Mark_Stephens@oxy.com

Type or print name Mark Stephens E-mail address: Mark_Stephens@oxy.com PHONE (713) 366-5158

For State Use Only

APPROVED BY [Signature] TITLE State Manager DATE 3-9-2011

Conditions of Approval (if any):

North Hobbs G/SA Unit Well No. 311
API No. 30-025-12509

Plug and abandon the subject well per the following procedure -

- 1) Notify the NMOCD 24 hours prior to the beginning of plugging operations.
- 2) MI x RU plugging unit.
- 3) RIH x tag existing CIBP at 4083'.
- 4) Circulate well with approved 10# mud-laden fluid.
- 5) Spot 30 sx. cement on top of CIBP at 4083'.
- 6) Spot 30 sx. cement from 2900' - 2800'. WOC x tag.
- 7) Perforate at 1820'. Squeeze with 65 sx. cement x displace to 1650'. WOC x tag.
- 8) Perforate at 400'. Squeeze well with 180 sx. cement x circulate cement to surface.
Verify x top off as necessary.
- 9) Cut off wellhead x install dry hole marker with labeling.
- 10) RD plugging unit, remove anchors, and reclaim surface as required.

Occidental Permian Ltd.

NHSAU 34-311

30-025-12509

1022' FNL and 2310' FEL

Section 34, Township 18S, Range 38E

Lea County, New Mexico

12 1/2", 50# @ 282' with 50 sx cmt

9 5/8", 36# @ 1700' with 625 sx cmt

Top of Salt @ 1770'

Top of Yates (Bottom of Salt) @ 2850'

7", 23# @ 4134' with 250 sx cmt
TOC @ 2470'

San Andres Open Hole 4134' - 4258'

CIBP @ 4083' with 2 sx cmt.

TD: 4258'

Occidental Permian Ltd.

NHSAU 34-311

30-025-12509

1022' FNL and 2310' FEL

Section 34, Township 18S, Range 38E

Lea County, New Mexico

12 1/2". 50# @ 282' with 50 sx cmt

9 5/8". 36# @ 1700' with 625 sx cmt

Top of Salt @ 1770'

Top of Yates (Bottom of Salt) @ 2850'

7". 23# @ 4134' with 250 sx cmt
TOC @ 2470'

San Andres Open Hole 4134' - 4258'

TD: 4258'

Perforate @ 400'. Squeeze with 180 sx
cmt to surface. Verify. Top-off if
necessary.

Perforate @ 1820'. Squeeze with 65
sx cmt and displace to 1650'. WOC. Tag.

Spot 30 sx cmt from 2900' - 2800'.
WOC. Tag.

RIH and tag CIBP @ 4083'. Circulate
well with plugging mud. Spot 30 sx cmt
on top of CIBP.