
Submit 3 Copies To Appropriate District Office	State of New Mexico	Form C-103 June 19, 2008
Energy, Minerals and Natural Resources 1625 N. French Dr., Hobbs, NM 882		WELL API NO. 30-025-07291 /
DISTRICT OUT CONSERVATION DIVISION		
District III MAD 9 1 7 11 11 220 South St. Francis Dr		STATE FEE 🛛
1220 S. St. Francis Dr., Santa Fe, NMOBBSOOD		6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A		7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		ROSE EAVES /
1. Type of Well: Oil Well Gas Well	Other /Swo	8. Well Number 2
2. Name of Operator MAS OPERATII	NG CO.	9. OGRID Number 267077
3. Address of Operator PO Box 923, KERMIT, TX 79745		10. Pool name or Wildcat DRY HOLE
4. Well Location P 660	South line and	660 East line
	et from the line and	NMPM County LEA
	n (Show whether DR, RKB, RT, GR	
GL: 3695		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND TEMPORARILY ABANDON CHANGE P		WORK ☐ ALTERING CASING ☐ ☐ EDRILLING OPNS.☐ PAND A ☐
PULL OR ALTER CASING MULTIPLE		_
DOWNHOLE COMMINGLE		
OTHER:	OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion		
or recompletion.		
(See attached before and after wellbore schematic) notify Hobbs OCD 575-393-6161 ext 114 24 hrs before rigging up on well.		
1) RIH tag plug in open hole @ 7800' 2) Set 25 sxs cement plug from 6520' to 6420' WOC TAG — Circ w/MLF 3) Set 35 sxs cement plug across 8 5/8 shoe from 4860' to 4760' (8 5/8 shoe @ 4810') WOC TAG		
3) Set 33 sas certient plug across 6 3/6 since from 4000 to 4/00 (6 5/6 since to 4/00) 1/00 1/10		
4) Load hole with 9.5 plugging brine Apply 50. 50. 50. 50. 50. 50. 50. 50. 50. 50.		
this depth) were - tag		
6) Set 50 sxs cement stub plug from 1460-1350 (top 8 5/8 stub @ 1408') WOC TAG 7) Set 65 sxs cement shoe plug from 380-270 (13 3/8 shoe @ 323') WOC TAG		
8) Load hole with 9.5 plugging brine		
9) Set surface plug 40 sxs from 60 to surface	The Oil Conservatio	n Division Must be notified
	24 hours prior to the	beginning of plugging operations.
Spud Date:		
	1	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
G , \		
SIGNATURE LA	TITLE Ag	entDATE03/18/2011
Type or print name Eddie W Seay	E-mail address: seay(4@leaco.net PHONE: 575-390-2454
For State Use Only		
APPROVED BY: Janyaha	TITLE STAH MA	DATE 5-23-2011
Conditions of Approval (if any):		
/ 0		

<

WELLBORE SCHEMATIC AFTER

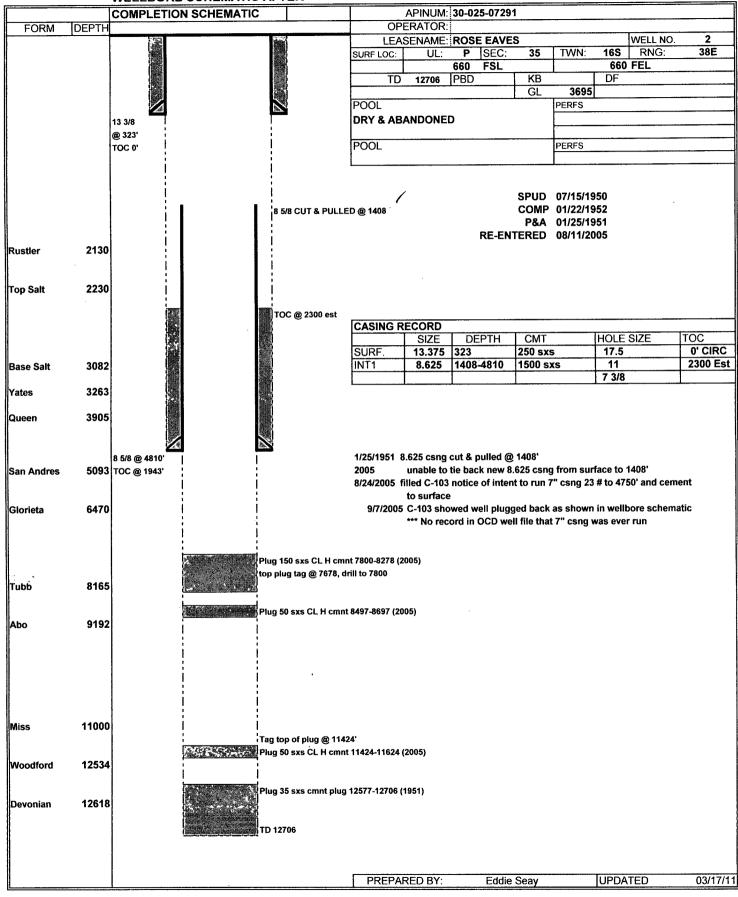

WELLBORE SCHEMATIC AFTER

