Form 3160-5 (August 2007)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010

5. Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS BOULD  Do not use this form for proposals to drill or to re-enter an				WM 22809	
			6. If Indian, Allo	ottee or Tribe Name	
	Use Form 3160-3 (AP				
SUBMIT IN TRIPLICATE – Other instructions on page 2.				7. If Unit of CA/Agreement, Name and/or No.	
1. Type of Well		,			
Oil Well X Gas Well Other				8. Well Name and No.1 North Bilbrey/Federal ##1	
2. Name of Operator ConocoPhillips Company			9. API Well No. 30-025-27	603	
3a. Address 3b. Phone No. (include area code)				10. Field and Pool or Exploratory Area	
3300 N. "A" St., Bldg. 6 Midland TX 79705 (432)688-6813			Maliamar:	Maljamar; Grayburg-San Andres	
4. Location of Well (Footage, Sec., T./R., M., or Survey Description)				11. Country or Parish, State	
2180' FSL & 1980' FEL \\			Lea Count	ty / NM	,
	CK THE APPROPRIATE BOX	(ES) TO INDICATE NATUR			
TYPE OF SUBMISSION		· · · · · · · · · · · · · · · · · · ·			
			TPE OF ACTION	· · · · · · · · · · · · · · · · · · ·	
Notice of Intent	Acidize	Deepen	Production (Start/Resun	·	
	Alter Casing	Fracture Treat	Reclamation	Well Integrity	
X Subsequent Report	Casing Repair	New Construction	Recomplete	X Other Downhole	
Final Abandonment Notice	Change Plans Convert to Injection	Plug and Abandon Plug Back	Temporarily Abandon Water Disposal	Repair	
13. Describe Proposed or Completed O					
Work commenced on 12/7  POH tubing and cleaned to down to 7000'; could not fis tool and sent to be repaired packer fluid; X-N plug stucl packer @ 13052', circulate below packer. Fill tagged a Waiting on coil tubing unit to the commence of	r final inspection.)  /2010 to repair downhous  /2010 to repair downhous  /2010 to repair downhous  // Had h  // An Plug and recove  // TIH with packer and  // Blow well dry with for  // 460 bbls packer fluid,  // An 13062', appears to be  // Co clean out the well, dr	ole failure, but was unstole in joint 381 to surfering sand; blow well defining to 13029'; set parm unit; latch onto pact X-N plug stuck again. e sand. RDMO on 1/2 ill out the plug, and plate	successful.  ace; circulate 460 bbls ry with foam unit; latch backer, release on-off to ker with on-off tool and TIH with cutter, but co 0/2011.  ace back on production	n onto packer with on-off tool, circulate 460 bbls d sent to be repaired; set ould not get into sub	t ~
w:H:~ 90		iwadi			
	as and softeed. Name (11 meu 1		Anni Canalettet		
Jalyn N. Fiske	Title Regula	Title Regulatory Specialist			
Signature		Date 03/18/2	2011	HED FOR RECORD	
	THIS SPACE FO	OR FEDERAL OR ST	ATE OFFICE USE		T
					L

Title

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any departing of agency of the United States any false,

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Approved by

3 2011

ALL OF LAND MANAGEMENT