Submit 3 Copies To Appropriate District Office State of New Mexico	Form C-103
District I Energy, Minerals and Natural Resour	rces May 27, 2004
1625 N. French Dr., Hobbs, NM 87240 District II	WELL API NO.
1301 W. Grand Ave., Artesia, NM 8821 HOBBS CONSERVATION DIVISIDES 1220 South St. Francis Dr.	ON 30-025-25512
District 137	STATE FEE X
1220 S. St. Francis Dr., Santa Fe, NM 8 ADR 28 2011	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name:
(DO NOT USE THIS FORM FOR PROPOSED PRILL OR TO DEEPEN OR PLUG BAD DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCI	CKTO A CITIES THOMAS
PROPOSALS.)	
1. Type of Well: Oil Well 🔯 Gas Well 🗍 Other	8. Well Number
Oil Well X Gas Well Other 2. Name of Operator	002
CD COUNTY TO THE	9. OGRID Number
3. Address of Operator	162683
600 N. MARIENFELD, SUITE 600, MIDIAND, TEXAS 79701	LANGLIE MATTIX; 7 RIVERS-ON-GB
4. Well Location	TERRITARITA, 7 RIVERS ON GB
Unit Letter A : feet from the NORTH lin	
	e and 660 feet from the EAST line
Section 19 Township 19s Range	37 34E NMPM County LEA
11. Elevation (Show whether DR, RKB, R	PT, GR, etc.)
3,292' - GR	
Pit or Below-grade Tank Application ☐ or Closure ▼	
Pit type STEEL Depth to Groundwater Distance from nearest fresh water well	
Pit Liner Thickness: mil Below-Grade Tank: Volumebbls;	Construction Material * NONE WITHIN 1,000'.
12. Check Appropriate Box to Indicate Nature of NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL	SUBSEQUENT REPORT OF: WORK ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMEN	The OPNS. PLUG AND
PULL OR ALTER CASING MULTIPLE CASING CEMEN	The OPNS. PLUG AND ABANDONMENT 24 hours prior to the beginning of plugging operations: Attach wellbore PLUG AND ABANDONMENT PLUG AND ABANDONMENT I ABAN
OTHER: OTHER:	the beautision
13. Describe proposed or completed operations. (Clearly state all pertinent detail	Ginning Must b
of starting any proposed work). SEE RULE 1103. For Multiple Completion or recompletion.	s; and give p s: Attach wellbore
PROPOSED PLUC AND ABANDONMENT PROCEDURE:	refations.
	2.2.1
1) TAG EXISTING 4-1/2" CIBP @ +/-3,350'; PUMP A 55 SX. CMT. PI 2) CIRC. WELL W/ PXA MUD. 3) PIMP A 35 SX. CMT. PINC @ 1455 1 1555 (7) (2000 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	UG @ 2,950 '-2,700'(T/7R,T/YATES/B/SALT).
 PUMP A 35 SX. CMT. PLUG @ 1455'-1,155'(T/SALT,B/ANHY/T/ANHY PUMP A 25 SX. CMT. PLUG @ 550'-300'(8-5/8" CSG.SHOE). 	(); WOC X TAG TOP OF CMT. PLUG.
5) MIX X CIRC. TO SURF. A 10 SX. OMT. PLUG @ 63'-3'.	
6) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD ON STEEL PLATE I	O CASINGS X INSTALL DRY HOLE MADRED
I hereby certify that the information above is true and complete to the best of my grade tank has been/will be constructed or closed according to NMOCD guidelines X, a gener	knowledge and balls Core
SIGNATURE TITLE	AGENT DATE 04/26/11
Type or print name DAVID A. EYLER E-mail address:	deyler@milagro-res.com Telephone No. (432)687-3033
For State Use Only	,
APPROVED BY TITLE	Aft MGZ DATE 4-28-2011
Conditions of Approval, if any	

