

Submit 1 Copy To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION

RECEIVED
South St. Francis Dr.
Santa Fe, NM 87505

MAY 26 2011

WELL API NO. 30-041-10110
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/> Fed.
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Horton Federal
8. Well Number 14
9. OGRID Number 257420
10. Pool name or Wildcat Milnesand, San Andres

SUNDY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator EOR Operating Company	
3. Address of Operator 200 N. Loraine, Suite 1440 Midland, TX 79701	
4. Well Location Unit Letter <u>M</u> : <u>990</u> feet from the <u>S</u> line and <u>330</u> feet from the <u>W</u> line Section <u>30</u> Township <u>08S</u> Range <u>35E</u> NMPM County <u>Roosevelt</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

MAILED

5/21/11 by hand

EOR Operating requests approval to plug and abandon this well according to attached proposed procedure and wellbore diagram.

Est. start date 5/12/11

BLM

EOR will notify ~~24~~ 24 hours prior to the beginning of plugging operations.

**Note: EOR plans to use BCM & Associates to plug a total of 12 wells. EOR has scheduled to complete these 12 P&As prior to 6/30/11.

Accepted for Record Only

ELG 5-26-2011

Spud Date:

6/8/1992

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jana True TITLE Production Asst. DATE 4/28/11

Type or print name Jana True E-mail address: jtrue@enhancedoilres.com PHONE: 432-687-0303
For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____
Conditions of Approval (if any): _____

Plugging Procedure

Horton Federal #14

API No. – 30-041-10110

1. Prepare location and test anchors
2. MIRU plugging rig
3. Notify OCD/HFO 24 hours prior to commencement of P & A procedure.
4. NDWH/NU BOP
5. RIH w-4 ½ CIBP on 2 3/8 WS @ 4620' (+/-) – within 100' of top perf – 4667'
 - a. Spot 35' of cement on CIBP
 - b. Let cement cure – bump plug @ 4585' (+/-)
6. Load well with plugging mud and conduct MIT to 500 psi., test for leak off.
 - a. Bleed pressure off after MIT.
7. TIH to 4585' and spot 25 SX cement plug
 - a. Wait on cement and tag
8. MIRU WL and RIH w/perf gun to 3057'
 - a. perforate @ 2 JSPF
 - b. POOH w/WL
 - c. Rig WL down move off loc.
9. TIH w/WS – spot 25 SX cement plug @ 3057'
 - a. Wait on cement
 - b. Tag plug
10. MIRU WL and RIH w/perf gun to 1529'
 - a. perforate @ 2 JSPF
 - b. POOH w/WL
 - c. Rig WL down move off loc.
11. TIH w/WS – spot 25 SX cement plug @ 1529'
 - a. Wait on cement
 - b. Tag plug
12. MIRU WL and RIH w/perf gun to 420'
 - a. perforate @ 2 JSPF
 - b. POOH w/WL
 - c. Rig WL down move off loc.
13. TIH w/WS – spot 25 SX cement plug @ 420'
 - a. 8 5/8 csng. Shoe @ 405'
 - b. Wait on cement
 - c. Tag plug
14. TIH to tag plug @ 400' (+/-)
 - a. Spot cement plug
 - b. circulate cement to surface
 - c. TOH w/WS
15. RDMO Plugging Rig
 - a. Install P & A marker plate
 - b. Cut off dead men
 - c. Remediate Location

