Form 3160-5 (August 1999)

UNITED STATES N.M. Cil Cons. Division
DEPARTMENT OF THE INTERES N. French Dr.
BUREAU OF LAND MANAGEMENT N. French Dr.
SUNDRY NOTICES AND REPORTS ON WELLS 188240

FORM APPROVED OMB No. 1004-0135 Expires November 30, 2000

5.	Lease Serial No.	· · · · · · · · · · · · · · · · · · ·
L(C 031670B	
6.	If Indian, Allottee or Tribe Name	***************************************

abandoned well. Use Form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name			
SUBMIT IN TR	7. If Unit or	7. If Unit or CA/Agreement, Name and/or No.						
1. Type of Well Soil Well Gas Well		8. Well Name and No. Warren Unit-Blinebry/Tubb WF #62						
2. Name of Operator ConocoPhillips Company	9. API Well							
3a. Address	3b. Phone No.	(include area code)	20 025 26204					
4001 Penbrook Street Odessa TX 79762 (432)368				10. Field and Pool, or Exploratory Area				
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					linebry-Tubb or Parish, State			
660' FSL &	:0-S, R-38-E, U	JL P	Lea Coun	rty, New Mexico				
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA								
TYPE OF SUBMISSION		TYPE OF ACTION						
	☐ Acidize	☐ Deepen	Production (S	tart/ Resume)	☐ Water Shut-Off			
☐ Notice of Intent	☐ Alter Casing	Fracture Tre		•	☐ Well Integrity			
Subsequent Report	Casing Repair	☐ New Constru	uction Recomplete		Other			
☐ Final Abandonment Notice	☐ Change Plans	Plug and Ab						
La Trial Abandonnient Notice	Convert to Injection	☐ Plug Back	☐ Water Dispos	al	Pump Change			
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.) (1) 2/6/2004: HELD PJSM. UNHANG WELL, TRIED TO UNSEAT PUMP. PUMP STUCK. JARRED ON PUMP, PUMP STILL STUCK. BACKED OFF RODS. SHUT WELL IN, SIOWE. (2) 2/9/2004: HELD PJSM. COOH WITH RODS. WAIT ON TRUCK, ND WELLHEAD, NU BOP. TAC RELEASED, CAN GO DN, BUT CAN NOT COME UP WITH TUBING. TAC HANGING UP. WORKING ON COOH WITH TUBING, STUCK. SHUT DN, SION. (3) 2/10/2004: HELD PJSM. OPEN WELL, PULL ON TUBING. NO MOVEMENT ON TUBING, STUCK. MIRU PUMP TRUCK, DISPLACE 100 BBLS FW DN CSG, PULL ON TUBING, STILL STUCK. RD PUMP TRUCK. WAIT ON ROTARY. MIRU ROTARY, RIH AND FREE POINT TUBING, COOH, RIH AND CUT TUBING 10' ABOVE TAC. COOH WITH TUBING, TALLYING OOH. RIH WITH OVERSHOT, DRILL COLLARS, JARS, ETC. LEFT 20 STANDS IN DERRICK, SHUT DN, SION. **** CONTINUED ON BACK **** **** CONTINUED ON BACK **** **** CONTINUED ON BACK **** ***** **** **** **** **** ****								
14. I hereby certify that the foregoin Name (Printed/Typed)	ng is true and correct	1.	Title	527	101 13			
Stacey Linder			HSER Assistant	2526				
Signature D.			Date	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	ico			
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved by	DAVID R.GLASS	TO SE STATE DE SERVICE DE LA TOTAL	Title	Da	te			
Conditions of approval flags, are streetify that the applicant holds legal continuous which would entitle the applicant to continuous the streeting that the	does not warrant or the subject lease	Office						
Title 18 U.S.C. Section 1900 (nakes fraudulent statements on representation	医a stime for any person knowin 图象级 to any matter within its jur	ngly and willfully to risdiction.	make to any department or age	ncy of the United S	States any false, fictitious or			

Warren Unit #62

- (4) 2/11/2004: HELD PJSM. OPEN WELL, FINISH RIH WITH OVERSHOT, BUMPER SUB, DRILL COLLARS, TUBING. LATCH ON FISH, JAR ON FISH. JARRED ON FISH 1 HR, CAME FREE, COOH WITH TUBING. GOT OUT WITH 10' SECTION OF 2-3/8 TUBING, PULLED THREADS OUT OF COLLAR ON TOP OF TAC. WAIT ON EQUIP. PICK UP MILL, WASH OVER PIPE, DRILL COLLARS AND RIH WITH TUBING. PICK UP SWIVEL AND LOAD REVERSE UNIT PIT. TAGGED AT 5771', START MILLING OVER TAC. MILLED ON TAC FOR 1.75 HRS, CUT ON TAC ABOUT 3-4 INCHES. LAY DN SWIVEL. SHUT DN, SION.
- (5) 2/12/2004: SHUT DN DUE TO WEATHER.
- (6) 2/13/2004: SHUT DN DUE TO WEATHER.
- (7) 2/16/2004: HELD PJSM. OPEN WELL, PICK UP SWIVEL. START MILLING ON TAC. MILLED ON TAC 3.5 HRS. MADE 8 INCHES. COOH WITH TUBING AND MILL, LAY DN MILL. RIH WITH SPEAR, ON JARS, DRILL COLLARS, AND TUBING. LATCH ON TAC AND TUBING. STILL STUCK, JARRED ON IT, CAME FREE. START COOH WITH TUBING. TAC HANGING UP ONCE IN WHILE, WORK IT FREE. PULLED 96 JTS, SHUT WELL IN, SION.
- (8) 2/17/2004: HELD PJSM. FINISH COOH WITH TUBING, SPEAR. LOST FISH. RIH WITH SHORT CATCH OVERSHOT ON JARS, DRILL COLLARS, AND TUBING. LATCH ON FISH. COOH WITH FISH. TAC HANGING UP AND DRAGGING ON CSG COLLARS. PULLED 150 JTS. SHUT WELL IN, SION.
- (9) 2/18/2004: HELD PJSM. FINISH COOH WITH TUBING AND FISH. LAY DN DRILL COLLARS, JARS, ETC. LAY DN TAC. FINISH COOH WITH TUBING. TAGGED FILL AT 6653'. NO FILL. RD SMITH, RELEASE SMITH. RIH WITH TUBING OPEN ENDED. WAIT ON TUBOSCOPE. SCAN TUBING OOH. FOUND 194 YELLOW, 10 BLUE, 1 GREEN, 2 RED JTS. NEED TO REPLACE TOTAL OF 5 JTS. SHUT WELL IN, SION.
- (10) 2/19/2004: HELD PJSM. WAIT ON REPLACEMENT TUBING. OPEN WELL, RIH WITH PROD TUBING. RAN 2-3/8 SN WITH NOTCHED COLLAR BELOW SN, 1 JT 2-7/8 POLY LINED TUBING, 29 JTS 2-3/8 TUBING, TAC, 180 JTS 2-3/8 TUBING. MIRU PUMP TRUCK, ND BOP, SET TAC, FLANGE WELL HEAD UP. DISPLACE 500 GAL XYLENE FOLLOWED WITH 10 BBLS TREATED BW DN TUBING. WAIT 2.5 HRS. DISPLACE 500 GAL 15% ACID FOLLOWED WITH 10 BBLS TREATED BW DN TUBING. RD PUMP TRUCK. SHUT WELL IN, SION.
- (11)2/20/2004: HELD PJSM. OPEN WELL, RIH WITH SWAB AND SWAB ON WELL. MADE 3 RUNS. RIH WITH PUMP, SPACE WELL OUT, MIRU PUMP TRUCK, LOAD AND TEST. HELD 500 PSI, OK. HANG WELL ON. SHUT DN.
- (12)2/23/2004: HELD PJSM. WELL PUMPING GOOD. RIG DN PULLING UNIT. MOVE OFF LOCATION