

MAYO MARRS CASING PULLING INC.
BOX 863
KERMIT, TEXAS 79745

NEW MEXICO OCD HOBBS
BID ID # 03-521-07-00199
CONTRACT # 03-521-0750-125

OPERATOR: LEIGH OPERATING CO.
Lease: CAUDILL STATE # 2
Project: P & A – CEMENTING REPORT

12-29-03 – SPOT 25 SXS @ 6359'-6129' & TAG
01-05-04 – SPOT 50 SXS @ 4437'-4247' & TAG
01-05-04 - SPOT 40 SXS @ 2139'-2015'
01-05-04 - SPOT 40 SXS @ 472'-346' & TAG
01-06-04 - SPOT 20 SXS @ 60' TO SURFACE

INSTALL HOLE MARKER
CIRCULATE 10# MUD

MAYO MARRS CASING PULLING INC.
BOX 863 KERMIT, TEXAS 79745

NEW MEXICO OCD

SUPERVISOR-GALEN JENNINGS

Lease: CAUDILL STATE # 2
OPERATOR: LEIGH OPERATING CO.
Project: P & A - CONTRACT 03-521-0750-0125

12-12-03
MIRU -

12-15-03
OPEN WELL - NDWH - NUBOP- (SHUT DOWN FOR MOTOR REPAIR)

12-19-03
POOH WITH 10 JOINTS 2 3/8" TUBING - SHUT DOWN FOR HIGH WINDS - CLOSE IN

12-22-03
LAY DOWN TOTAL 161 JOINTS 2 3/8" TUBING - RIH WITH GAUGE RING & SET DOWN @ 4953' - RIH WITH WORKSTRING WITH NOTCHED COLLAR TO 4953' - CLOSE IN WELL

12-23-03 (11)(11 HRS, PUMP TRUCK, WATER, WORKSTRING)
DRILL TO 4940' - BEGIN WASHING DOWN - WASH DOWN TO 6325' - TUBING PLUG - POOH

12-24-03 (11)(11 HRS, PUMP TRUCK, SWIVEL, BRINE, MUD)(ABC RENTAL TANK)
PICK UP DRILL BIT - RIH - RIG UP SWIVEL - BEGIN DRILLING - MIX MUD (22 SXS GEL) - CIRCULATING IRON SULFATE - USE TWO LOADS OF BRINE - POOH - CLOSE IN WELL

12-29-03 (11 HRS)(8 RIG, WATER)
RIH & TAG FILL @ 6231' - WASH TO 6300' - OCD OK TO SPOT PLUG - CLEAN WELL BORE TO 6359' - SPOT 25 SXS @ 6359' - POOH - CLOSE IN WELL

12-30-03 (11 HRS)(2 HRS)
RIH & TAG @ 6129' - POOH - WELD ON PULL NIPPLE - CASING PARTED IN SLIPS - WELD ON WORK SLIPS OUT - WILL FREEPOINT IN AM

12-31-03
GANDY HAUL OIL FROM PIT - FREEPOINT CASING @ 4300' - CUT CASING @ 4385' - WORK CASING LOOSE - LAY DOWN 3 JOINTS

1-02-04
LAY DOWN 109 JOINTS CASING - RIG TO RUN TUBING - SHUT DOWN HIGH WINDS

1-05-04
RIH & CIR. 10# MUD - SPOT 50 SXS @ 4437' - POOH - WOC - RIH & TAG @ 4247' - POOH & SPOT 40 SXS @ 2139'-2015' - POOH & SPOT 40 SXS @ 472' - POOH

1-06-04
RIH & TAG @ 346' - POOH & SPOT 20 SXS @ 60' TO SURFACE - RIG DOWN - CUT OFF WELLHEAD & ANCHORS - INSTALL DRY HOLE MARKER - COVER PIT & CELLAR - MOVE OUT