	Submit 3 Copies To Appropriate District Office State of New Mexico					Form C-103			
	District I 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources				Revised June 10, 2003 WELL API NO.			
	District II	OIL CONSERVATION DIVISION			30-025-01294				
	1301 W. Grand Ave., Artesia, NM 88210 District III	1220 Sout		5. Indicate Type of Lease STATE X FEE					
	1000 Rio Brazos Rd., Aztec, NM 87410 District IV	Santa Fe, NM 87505				6. State Oil & Gas Lease No.			
	1220 S. St. Francis Dr., Santa Fe, NM 87505					E 1388			
	SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)					7. Lease Name or Unit Agreement Name Vickers State			
	1. Type of Well: Oil Well X Gas Well Other					8. Well Number			
	2. Name of Operator Saga Petroleum LLC					9. OGRID Number 148967			
	3. Address of Operator 415 W. Wall, Suite 1900 Midland, TX 79701					10. Pool name or Wildcat Maljamar Grayburg, San Andres			
	4. Well Location								
	Unit Letter M :	feet from the	, <u>S</u>	line and	330	_feet from the _	W	_line	
	Section 4	Township 17		ange 33E	NMPM	Coun	ty Lea		
		11. Elevation (Show w GR 4203.1	hether DF	R, RKB, RT, GR, e	etc.)				
L	12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data								
25	NOTICE OF IN			SUI	BSEQUEN	Γ REPORT (OF:		
	PERFORM REMEDIAL WORK	PLUG AND ABANDON	ı 🗆	REMEDIAL WO	RK	☐ ALTE	RING CASING	; 🗆	
	TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DR	RILLING OPNS. PLUG AND ABANDONMENT				
	PULL OR ALTER CASING	MULTIPLE COMPLETION		CASING TEST A CEMENT JOB	ND				
	OTHER:			OTHER: MIT - T	ГА			X	
-	13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed comp							ed date	
	or recompletion. 2-26 thru 3-4-04 MIT for TA - P	U 5-1/2" CIBP & RIH &	દે set CIBP	' @ 4300' (perfs 43	348'-66' & 438	38'-4400')		-	
RIH w/80 jts 2-3/8" J55, RU Hot oiler & pump 10 BHW dwn tbg, RIH w/34 jts & pump 9 bbls HW dwn tbg, when paraffin plugge up tbg, put 2500#. Failed to push paraffin out. RD Hot Oiler & POOH, LD tbg, LD all 144 jts on rack. Truck in 140 jts 2-3/8" tbg, RIH open ended w/137 jts RU pump trk & circ 100 BW w/pkr fluid. Press test CIBP & annulus to 460 psi for 10-mins. Held good. POOH LD 137 jts 2-3/8" tbg on rack. ND BOP & NUWH, leaving 1 jt (has collar on both pins end) in WH slips & walve in 15 Loa & retest 5-1/2" csg to 550 psi for 30-mins-good. Prep to clean location & set up OCD to witness test next week a 3-11-2004 Witness by Buddy Hill - chart attached Press up to 540 psi for 30 mins- good test - well TA'd Abandonment Expires								og,	
								oad	
								3.5 2.5.	
								191	
								T F	
		, (22)	,			N. C.	fa gy ^s	•*	
-	I hereby certify that the information a	above is true and comple	te to the b	est of my knowled	ge and helief		-		
	SIGNATURE BONNIU	Bustand		roduction Analyst	•		E 03/15/200)4	
	Type or print name Bonnie Husband	/	E-mail ac		sagapetroleur		e No. (432)68	84-4293	
-	(This space for State use)	1 . 1		C FIELD REPRESE	NTATIVE II "				
	APPPROVED BY Augl). Wink	TITLE		COMINE II/S	IATE MANA	# 2 3 20	04	
	Conditions of approval, if any	- III	·			D,,11			

- 1

