

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	3002506912
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil / Gas Lease No.	317230
7. Lease Name or Unit Agreement Name	HENDERSON, V. M.
8. Well No.	6
9. Pool Name or Wildcat	PADDOCK/BLINEBRY
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3496' GL	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
CHEVRON USA INC

3. Address of Operator
15 SMITH ROAD, MIDLAND, TX 79705

4. Well Location
Unit Letter C : 760 Feet From The NORTH Line and 1980 Feet From The WEST Line
Section 30 Township 21S Range 37E NMPM LEA COUNTY

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ADD PERFS IN PADDOCK & ACIDIZE ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-16-04: MIRU KEY #176.
2-17-04: REL TAC. MOVE OUT 2 3/8" PROD TBG. TIH & TAG SOLID @ 5342.
2-18-04: TIH W/BIT. C/O FR 5342-5927.
2-19-04: PERF 5424-28, 5434-38, 5480-84, 5512-18.
2-20-04: PERF 5173-76, 5184-90, 5198-5201, 5206-09, 5212-15, 5218-22, 5270-75. TIH W/PKR & SET @ 5100'.
2-23-04: ACIDIZE BLINEBRY & PADDOCK PERFS 5158-5653 W/4800 GALS 15% ANTI-SLUDGE HCL. SET PKR @ 5142. RU SWAB. 3 HR TEST.
2-24-04: 10 HR SWAB TEST.
2-25-04: SET PKR @ 5525. 9 HR SWAB TEST.
2-27-04: REL PKR. RET RBP. PUH & SET RBP @ 5312. PKR @ 5239. TEST PLUG TO 500 PSI. SWAB PERFS.
3-01-04: SWAB. MOVE TOOLS. SET RBP @ 5248. SET PKR @ 5170.
3-02-04: RU SWAB. 1 HR TEST. MOVE TOOLS. SET RBP @ 5170. SET PKR @ 5145. 8 HR SWAB TEST.
3-03-04: MOVE TOOLS. SET RBP @ 5312. SET PKR @ 5239. ACIDIZE PADDOCK PERFS 5270-75 W/1000 GALS 15% ANTI-SLUDGE HCL. RU SWAB. 6 HR TEST.
3-05-04: SET TAC @ 5115. NUWH. RIG DOWN. CLEAN LOCATION. TURN WELL OVER TO PRODUCTION TO SET PUMPING UNIT & RUN RODS.
FINAL REPORT

DHC #894 (MAY OF 1993)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Leake TITLE Regulatory Specialist

DATE 3/11/2004

TYPE OR PRINT NAME Denise Leake

Telephone No. 915-687-7375

(This space for State Use)

APPROVED Ray W. Wink
CONDITIONS OF APPROVAL, IF ANY: TITLE

OC FIELD REPRESENTATIVE II/STAFF MANAGER

DATE

MAR 23 2004