

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-00042
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	40 ALH 2022: 280 AC V-3833
7. Lease Name or Unit Agreement Name	STATE COM. <i>Ut.</i>
8. Well No.	1
9. Pool name or Wildcat	East Caprock-Mississippian Gas
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
4343' GR	

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	2. Name of Operator W.O.G., INC.
3. Address of Operator P.O. BOX 1813, Midland, Texas 79702	4. Well Location Unit Letter <u>A</u> : <u>660</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>East</u> Line Section <u>11</u> Township <u>11-S</u> Range <u>32E</u> NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4343' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- (1) Cut & pull 5½ casing @ 6476'
- (2) Spot 35 sacks cement plug @ 5½ stub 6510' W.O.C. Tag plug @ 6324'
- (3) Spot 40 sack cement plug @ 3564 9 5/8 shoe W.O.C. Tag plug @ 3442'
- (4) Spot 40 sack cement plug @ 434'
- (5) Spot 10 sack cement plug at surface, set up P&A marker.

Set CIBP @ 10,090, whipstock on top. Attempted to cut window, could not drill out  
25 sx plug in window and whipstock  
Cleaned up location  
Cut off Anchors  
Hauled off debris  
Ready for Inspection

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jim Hearn TITLE MGR. DATE 1-21-94  
TYPE OR PRINT NAME Jim Hearn TELEPHONE NO. (915) 685-0738

(This space for State Use)

APPROVED BY Jack Griffin OIL & GAS INSPECTOR DATE APR 22 1994  
CONDITIONS OF APPROVAL, IF ANY: JC

RECEIVED

APR 20 1994

OFFICE