

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Enr Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-00061
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. b-9639
7. Lease Name or Unit Agreement Name N.M. "BO" State
8. Well No. 3
9. Pool name or Wildcat Moore Devonian

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER Water Disposal	
2. Name of Operator Texaco Inc.	
3. Address of Operator P.O. Box 730, Hobbs, N.M. 88240	
4. Well Location Unit Letter D : 660 Feet From The North Line and 660 Feet From The West Line Section 24 Township 11-S Range 32-E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4348' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

On Back.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Richard DeSoto TITLE Engineering Technician DATE 11-30-90
TYPE OR PRINT NAME Richard DeSoto TELEPHONE NO. 393-7191

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:


RECOMMENDATION FOR ABANDONMENT
MOORE (DEVONIAN) COOP SWD SYSTEM WELL NO. 3
MOORE DEVONIAN FIELD
LEA COUNTY, NEW MEXICO

ABANDONMENT PROCEDURE

1. MIRU pulling unit. Install BOP. TIH with 2 7/8" workstring, and clean out to 10,600'.
2. Spot 170 sx. cement from 9100-10,600. (Class H cement, 15.6 ppg, 1.18 cu. ft./sx., 5.19 gal/sx.). Tag plug. TOH.
3. TIH with cement retainer on workstring. Set c.r. at ± 8200 . Squeeze casing leaks from 8400-9060 with 200 sx. cement.
4. Load hole with 10# brine containing 25 lb. of salt gel per barrel.
5. Pull up hole. Spot 25 sx. (220') cement plug from 5400-5620. Tag plug. This cement plug and all shallower plugs to contain 2% CC.
6. Pull up hole. Spot 25 sx. (220') cement plug from 3380-3600 across 8 5/8" casing shoe. Tag plug.
7. Pull up hole. Spot 34 sx. (300') cement plug from 1200-1500. Tag plug.
8. Pull up hole. Spot 56 sx. cement plug from 500' to surface.
9. Cut off wellhead. Install marker. Clean location.

WELL Moore Sub. No. 3
 DATE 10-3-90 KGS
 ELEVATION 4348' CF

Present

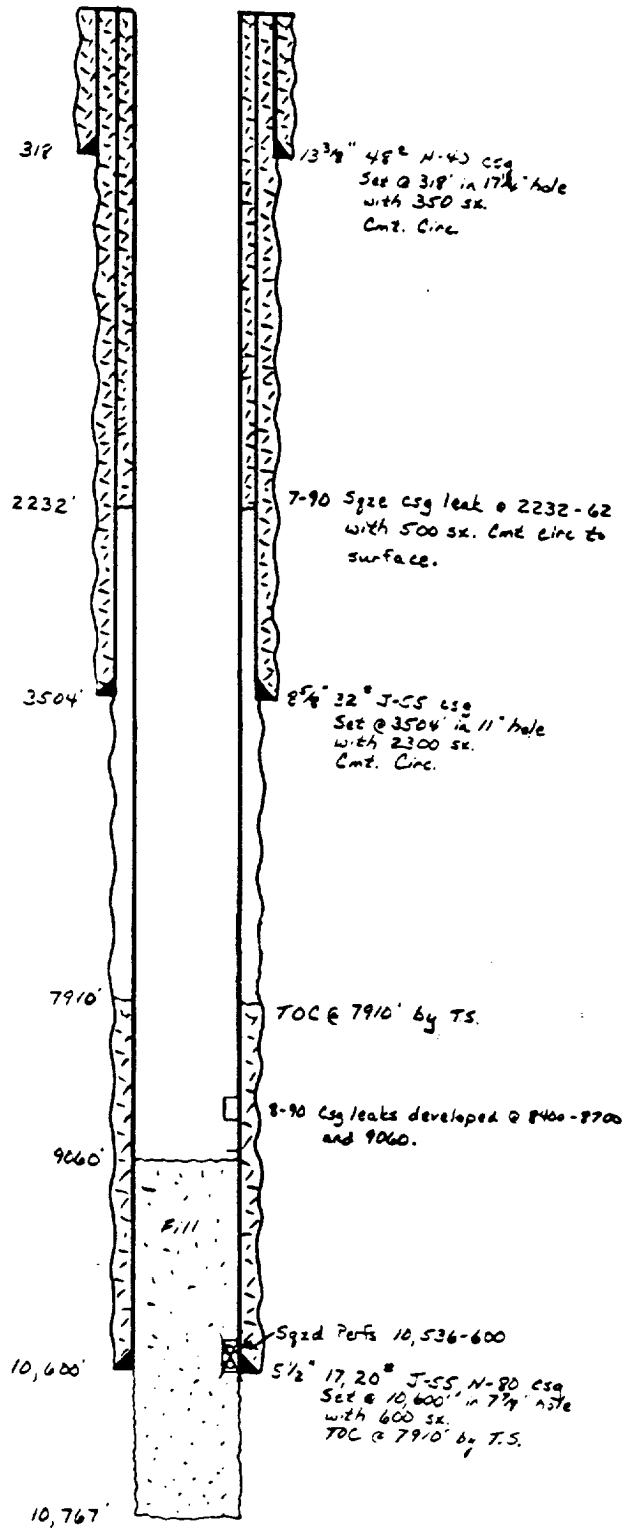

Proposed

