

NUMBER OF COPIES RECEIVED	
DISTRIBUTION	
SANITARY	
FILE	
CLERK	
CARD OFFICE	
TRANSPORTER	
PRODUCTION OFFICE	
OPERATOR	

## NEW MEXICO OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

### MISCELLANEOUS NOTICES

strict Office, Oil Conservation Commission, before the work specified is to begin. A copy will be returned to the sender on which will be given the approval, with any modifications considered advisable, or the rejection by the Commission or agent, of the plan submitted. The plan as approved should be followed, and work should not begin until approval is obtained. See additional instructions in the Rules and Regulations of the Commission.

Indicate Nature of Notice by Checking Below

NOTICE OF INTENTION TO CHANGE PLANS		NOTICE OF INTENTION TO TEMPORARILY ABANDON WELL		NOTICE OF INTENTION TO DRILL DEEPER	
NOTICE OF INTENTION TO PLUG WELL	XX	NOTICE OF INTENTION TO PLUG BACK		NOTICE OF INTENTION TO SET LINER	
NOTICE OF INTENTION TO SQUEEZE		NOTICE OF INTENTION TO ACIDIZE		NOTICE OF INTENTION TO SHOOT (Nitro)	
NOTICE OF INTENTION TO GUN PERFORATE		NOTICE OF INTENTION (OTHER)		NOTICE OF INTENTION (OTHER)	

OIL CONSERVATION COMMISSION  
SANTA FE, NEW MEXICO

Hebbs, New Mexico  
(Place)

July 10, 1963  
(Date)

Gentlemen:

Following is a Notice of Intention to do certain work as described below at the

**Skelly Oil Company** **Mexico "T"** Well No. **1** in **"H"**  
(Company or Operator) (Unit)  
**SE 1/4 NE 1/4** of Sec. **2**, T. **12-S**, R. **32-E**, NMPM, **East Caprock Devonian** Pool  
(40-acre Subdivision)  
**Lea** County.

### FULL DETAILS OF PROPOSED PLAN OF WORK

(FOLLOW INSTRUCTIONS IN THE RULES AND REGULATIONS)

The oil zone of this well is depleted with the well producing 100% water. There are no other commercial zones of oil or gas in this well. We plan to plug and abandon this well in the following manner:

1. Move in and rig up pulling unit.
2. Pull rods and tubing.
3. Mix mud and lead hole.
4. Set cast iron bridge plug at approx. 11,245'.
5. Dump 5 sacks of cement on top of bridge plug at 11,245'.
6. Rig down and move out pulling unit.
7. Move in and rig up hydraulic casing jacks.
8. Run free point indicator and cut 5-1/2" OD casing off at approx. 6400'.
9. Pull and lay down 5-1/2" OD casing.
10. Spot 25 sack cement plugs at the following depths:
  1. In and out of cut off 5-1/2" OD casing.

(Continued on reverse side)

Approved....., 19.....  
Except as follows:

Approved.....  
OIL CONSERVATION COMMISSION

By.....  
Title.....

**Skelly Oil Company**  
Company or Operator

By.....  
Position..... **Dist. Supt.**

Send Communications regarding well to:

Name..... **Skelly Oil Company**  
Address..... **Box 730 - Hebbs, New Mexico**

2. At top of Abo 7194' (only if casing is cut off below this point.)
3. At top of Tabbs 6382'.
4. At top of Glorietta 4940'.
5. At base (in and out) of 8-5/8" OD casing 3655'.
6. 10 sack plug at surface with 10' x 4" steel marker.

11. All intervals not cemented will be filled with heavy mud laden fluid.