STATE OF NEW MEXICO ENERGY AND MINERALS DEPARTMENT

| THREE INDIVIDUALITYES O | | |
|-------------------------|-----|--------------|
| we, or Cortes acceives | | |
| DISTRIBUTION | | |
| SANTA FE | | 1 |
| FILE | | |
| U.S.G.S. | | |
| LAND OFFICE | | 1 |
| 0224708 | - 1 | ł |

IL CONSERVATION DIVISIO.. P. O. BOX 2088 SANTA FE, NEW MEXICO 87501

Form C-103 Revised 10-1-78

5a. Indicate Type of Lease State X 5, State Oil & Gas Lease No. E-1765 SUNDRY NOTICES AND REPORTS ON WELLS TOO HOT USE THIS FORM FOR PHOPOSALS TO THILL OR TO DEEPLE OR PLUG BACK TO A DO USE "APPLICATION FOR PERMIT -" FORM C-1011 FOR SUCH PROPOSAL 7. Unit Agreement Name Dry WELL OTHER-8. Farm or Lease Name 2. Name of Operator Gross State Union Oil Company of California 9. Well No. 3. Address of Operator 79702 Midland, Texas P. O. Box 671 10. Field and Pool, or Wildcat E. Caprock Penn. 4. Location of Well 1,980 South UNIT LETTER . 12-S 11 West 15. Elevation (Show whether DF, RT, GR, etc.) 12. County Lea 4,407' GR Check Appropriate Box To Indicate Nature of Notice, Report or Other Data SUBSEQUENT REPORT OF: NOTICE OF INTENTION TO: ALTERING CASING PERFORM REMEDIAL WORK PLUG AND ABANDONMENT COMMENCE DRILLING OPNS. CASING TEST AND CEMENT JOB 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

| 18. I hereby certify that the information abo | ve is true and complete to the best of my knowledge and | belief. |
|---|---|----------|
| Jan J. T. R. Hu | -1 . D-1- Cut | 10 01 00 |

9- 7-82 MIRUPU - release Model "R" pkr @ 9,458'. Displace hole w/10 PPG mud.

WELL PLUGGED AND ABANDONED 9-8-82.

9- 8-82 Ran tbg open ended to 6,510' and spot 30 sx cmt 6,510'-5,230' Plug No. 2 Pull up to 3,346' and spot 40 sx cmt 3,346'-3,179' Plug No. 3

POOH w/tbg & pkr. Set CIBP @ 9,430' - dump 4 sx cmt on CIBP to 9,395'

Pull up to 1,555' and spot 50 sx cmt 1,555'-1,380' in 8-5/8" csg Plug No. 4 POOH w/tbg, spot 10 sx cmt 50' to surface Plug No. 5. Pump 10# mud between all plugs. Install 4" x 4' dry hole marker and clean location.

J.R. Hughes